

List of Recalls and Replacement Parts for Child Restraints

October 13, 2017

The latest recall is for certain Diono safety seats. Certain models, if installed forward facing, untethered, and with a lap-only belt have the potential to cause chest injuries. New seats also have been added. Safety seats discontinued or manufacturers out of business for 10 years or more are not included. For information on older seats or out-of-business manufacturers, call SafetyBeltSafe U.S.A.

How can you tell if your safety seat is safe?

Make sure that the expiration date stamped on the plastic has not passed and it has never been used in a crash. You can't be sure about the history of a used seat unless you got it from a friend or relative. You will need the detailed instruction booklet (it can be ordered from the manufacturer if it is missing) to check that the seat has all of its parts and to find out how to use it correctly. Check for possible damage, such as cracks in the plastic, frayed straps, stiff buckles or harness adjusters. If the safety seat passes all of these criteria, you still need to check for possible recalls.

What is a safety seat recall?

Just like cars and other products, a safety seat may be "recalled" because of a defect that could injure your child. Manufacturers are required to fix the problem free of charge. If your seat is recalled, be sure to get it fixed right away.

Does the safety seat have to be sent back?

Not usually. Most problems can be fixed by replacing a part that the manufacturer will send you for free. Sometimes, with an older seat or when the company is out of business, you will need to take it to a special recycling center (go to www.carseat.org/recycling_la.html for more info) or, if none is available in your area, destroy the seat to make sure it is not picked up by someone and used by another child. Break it with a sledgehammer, crush it, or take it completely apart and mark it "not for use as a safety seat" before throwing it away wrapped securely in a heavy trash bag.

Should I keep using a recalled seat?

Many defects are minor, but some are quite serious. All problems should be corrected as soon as possible. Unless you have another seat, you should go on using the recalled one while you are waiting for the repair kit. Using a recalled safety seat almost always is safer than letting your child ride in a safety belt only.

How to check your safety seat for recalls

1. Look up the name of the manufacturer.
2. Look up the name of your specific model. Important: the model name may not be found anywhere on the seat, and many safety seats have similar model names. Some rear-facing-only seats are sold as a part of a stroller system. Since stroller model names are not included on this list, it is necessary to determine the name of the corresponding rear-facing-only seat to be sure all recalls and warnings have been found. Some manufacturers have style names (i.e., Oshkosh, Disney characters, etc.) sewn on the fabric or used in promotional materials. These names are used for more than one product and cannot be used to determine whether or not the seat has a recall. If you are not sure of the exact name of your seat, check the Color Pictorial Guide to Child Restraints (you may order a hard copy or license to print from SafetyBeltSafe U.S.A.) or contact the manufacturer or SafetyBeltSafe U.S.A. to help you identify it.
3. If you are sure of the EXACT name of your seat, you are ready to look it up on the recall list. Every model certified by the manufacturer to meet U.S. safety standards and made within the last 10 years is on this list, either with a recall or under the "no recall" section at the end of each manufacturer's section.
4. If your model has a recall listed, you need to compare the date of manufacture of your particular seat with the dates affected by the recall. The date is computer-generated on a paper sticker attached to the side or the back of the seat. Disregard dates on tags attached to the fabric cover or pre-printed in the corner of certification or instruction labels. For some recalls, you also will need to check the model number, which is found on the same sticker as the date. If the date sticker is missing or the date is not clearly marked, assume that all possible recalls apply to your seat. Even if no recall applies, do not use a seat if it has passed its expiration date (specified by the manufacturer in the instruction booklet, usually 4 to 10 years from the date of manufacture), which usually is stamped into the plastic shell.

Special Features of the *SafetyBeltSafe* U.S.A. List of Recalls and Replacement Parts for Child Restraints

1. New recalls are added to this list as soon as they can be verified. Recall Update Service subscribers receive notification by e-mail. To verify that a printed copy of this list is current, go to www.carseat.org and click on Recalls (left frame) or call 310-318-5111.
2. Voluntary customer notification campaigns, special warnings, and additional replacement parts available from manufacturers are included on the list. Some of these are not widely announced and are provided for the benefit of parents and child restraint checkers. The bracketed phrase [Not publicized] indicates usage advice or repair kit availability that has been verified with but not announced by the manufacturer. If a child restraint with one of these problems or any defect which has not been recognized with an official recall is found, it is important to notify officials responsible for defect investigations. To report a defect, call the National Highway Traffic Safety Administration (NHTSA) at 888-327-4236 or 800-424-9393 or go to <http://www-odi.nhtsa.dot.gov/ivoq>.
3. Recall wording, including manufacturer contact information, has been clarified and updated. The “Problem” is described clearly and briefly. The wording under “Action Needed” is based on current information supplied by the manufacturer instead of the original recall notice, which may contain ambiguous or obsolete information.
4. Model names are listed alphabetically. For ease of use and accuracy, all recalls are grouped by the model name of the restraint. Model numbers are also listed, if provided by the manufacturer.
5. All child restraint models made in the past 10 years, with or without a recall, are listed (models without a recall are at the end of each manufacturer’s section). If the model name is not found on the list, the child restraint should not be used.
6. When problems with instruction booklets are identified, corrections and updates are obtained from manufacturers and added to the list.

Child Restraint Manufacturer Recalls and Free Replacement Parts

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|---|---------------------------------|---------------------|--|---|
| 4Moms 912 Fort Duquesne Blvd., Pittsburgh PA 15222 888-614-6667 www.4Moms.com | | | | |
| 4Moms | Self-Installing Car Seat (1032) | 7/1/16 - 10/31/16 | Due to an overly tight rivet on safety seat, safety seat may not attach correctly to base, increasing risk of injury during a crash. | Call 4Moms at 888-614-6667 for a free replacement safety seat. BASE IS NOT AFFECTED. |
| 4Moms models with no recalls, replacement parts, or warnings: none | | | | |
| Aidia, Inc. 1459 18th St., San Francisco, CA 94107 866-328-8661 www.aidiaproducts.com | | | | |
| Aidia models with no recalls, replacement parts, or warnings: Explorer, Pathfinder, Scout. | | | | |
| Angel Guard Products, Inc. (c/o Mercury Distributing, 7001 Wooster Pike, Medina, OH 44256 800-815-6330) www.angel-guard.com | | | | |
| Angel Guard model with no recalls, replacement parts, or warnings: AngelRide Infant Car Bed | | | | |
| Aprica 3 Glenlake Parkway, Atlanta, GA 30328, 888-927-7422 www.aprica.com | | | | |
| Aprica | A30 | 7/1/11-4/30/12 | May be difficult to release harness buckle, which could cause risk to child in emergency. | Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com |
| Aprica models with no recalls, replacement parts, or warnings: n/a | | | | |
| Aria Child, Inc. – See Goodbaby USA | | | | |
| Baby Jogger 4110 Premier Dr., High Point NC 27265 1-800-241-1848 www.babyjogger.com | | | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|---|--|--|--|--|
| Baby Jogger | City Go safety seats (BJ64510, BJ64529), bases (BJ80400, BJ61500), City Mini Travel Systems (BJ72510), Vue Lite Travel Systems (BJ70411, BJ70424, BJ70431) | 11/3/14 to 4/30/15 | Information on some labels, instruction manuals, and/or registration cards is missing, sized incorrectly, out of order, or has the wrong background color. | Call Baby Jogger at 800-241-1848 for a free replacement safety seat. |
| Baby Jogger models with no recalls, replacement parts, or warnings: none | | | | |
| Baby Trend 1607 S. Campus Ave. Ontario CA 91761 800-328-7363 www.babytrend.com | | | | |
| Baby Trend | Hybrid LX 3-in-1 Centennial FB58181 and Kiwi FB48417 | FB58181 mfd. on 7/23/16, FB48417 mfd. on 7/14/16 | Center rivet on harness adjuster may fail if child weighs more than 40 lbs., increasing risk of injury during a crash. | Call 1-800-328-7363 for free replacement safety seat or refund. |
| Baby Trend | Rigid Latch-Loc 6439, 6448, 6481 and Latch-Loc Base 6400 | 5/14/07 to 4/1/08 | LATCH connector metal locking parts can crack, allowing connectors on the base to release from vehicle anchors in a severe crash. | Call for replacement Flex-Loc Base in exchange for Rigid Latch-Loc Base. Until replaced, secure base or seat alone with vehicle belt. |
| Baby Trend | Trendz Fastback 3-in-1 #FB60070; FB60408 | 10/1/11 to 7/31/13 | May be difficult to release harness buckle, which could cause risk to child in emergency. | Call 1-800-328-7363 for replacement buckle. |
| Baby Trend models with no recalls, replacement parts, or warnings: Baby Trend Booster, EZ Flex-Loc, EZ Flex-Loc 32, EZ-Loc, Euro Sport, Flex-Loc, Inertia, PROtect Elite, PROtect Premiere/Sport, PROtect Yumi Booster, PROtect Yumi 2-in-1, Secure 35, Secure Snap Gear 32. | | | | |
| Bergeron Health Care, 15 South Second Street, Dolgeville, NY 13329, 800-371-2778, www.adaptivemall.com | | | | |
| Bergeron model with no recalls, replacement parts, or warnings: Special Tomato | | | | |
| Britax Child Safety, 13501 So. Ridge Dr., Charlotte, NC 28273, 888-427-4829, www.britaxusa.com | | | | |
| Britax | Advocate 70 CS | 7/1/2010 to 8/31/2011 | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall] | Call Britax for more information and replacement kit, if needed. |
| Britax | Advocate 70-G3 E9LG81A, E9LG83N, E9LG83P, E9LG83X, E9LG83Y, E9LL21A, E9LL23P, E9LL23Y | 6/1/2012 to 8/31/2012 | Material of HUGS chest pads is too soft, which could be a choking hazard. | Monitor child and call for replacement pads. |
| Britax | Advocate ClickTight E1A025Q, E9LT95N, E9LT95Q, E9LT95Z | 8/1/2014 to 7/29/2015 | Red harness adjustment button may remain in release position after harness is tightened, enabling shoulder straps to loosen. | Call Britax for repair kit that includes lubricant to apply once only, directly to harness adjustment button. |
| Britax | BOB B-Safe 35 All models | 11/1/15-5/31/17 | Center tab on chest clip may break, posing a choking hazard to child. | Call 833-474-7016 for repair kit. |
| Britax | Boulevard 70, Boulevard 70 CS | All made before 10/5/10 | Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall] | Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present). |
| Britax | Boulevard 70, Boulevard 70 CS | 7/1/2010 to 8/31/2011 | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall] | Call Britax for more information and replacement kit, if needed. |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|-------------|---|-----------------------------|---|---|
| Britax | Boulevard 70-G3 E9LJ91A, E9LJ91M, E9LJ91S, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A | 6/1/2012 to 8/31/2012 | Material of HUGS chest pads is too soft, which could be a choking hazard. | Monitor child and call for replacement pads. |
| Britax | Boulevard ClickTight E1A015Q, E1A016A, E1A016H, E1A135Q, E9LT85Q, E9LT85S, E9LT86A, E9LT86F, E9LT86G, E9LT86H | 8/1/2014 to 7/29/2015 | Red harness adjustment button may remain in release position after harness is tightened, enabling shoulder straps to loosen. | Call Britax for repair kit that includes lubricant to apply once only, directly to harness adjustment button. |
| Britax | B-Safe 35 All models | 10/1/2014 to 7/1/2015 | Carry handle may develop cracks in, under, or around handle grip, which may lead to handle fracturing. | Do NOT carry by handle. Call 800-683-2045 for repair kit. |
| Britax | B-Safe 35 All models | 11/1/15- 5/31/17 | Center tab on chest clip may break, posing a choking hazard to child. | Call 833-474-7016 for repair kit. |
| Britax | B-Safe 35 Travel System All models | 10/1/2014 to 7/1/2015 | Carry handle may develop cracks in, under, or around handle grip, which may lead to handle fracturing. | Do NOT carry by handle. Call 800-683-2045 for repair kit. |
| Britax | B-Safe 35 Travel System All models | 11/1/15- 5/31/17 | Center tab on chest clip may break, posing a choking hazard to child. | Call 833-474-7016 for repair kit. |
| Britax | B-Safe 35 Elite All models | 10/1/2014 to 7/1/2015 | Carry handle may develop cracks in, under, or around handle grip, which may lead to handle fracturing. | Do NOT carry by handle. Call 800-683-2045 for repair kit. |
| Britax | B-Safe 35 Elite All models | 11/1/15- 5/31/17 | Center tab on chest clip may break, posing a choking hazard to child. | Call 833-474-7016 for repair kit. |
| Britax | B-Safe 35 Elite Travel System All models | 11/1/15- 5/31/17 | Center tab on chest clip may break, posing a choking hazard to child. | Call 833-474-7016 for repair kit. |
| Britax | Chaperone E9L69N9, E9L69P2, E9L69P3, E9L69P5 | 4/1/09 to 5/31/10 | Chest clip may break when engaged, causing risk of laceration or choking on small piece. | Call for new chest clip. |
| Britax | Chaperone E9L692J, E9L692K, E9L692L, E9L692M | 9/1/2010 to 4/30/11 | Harness adjuster may detach from shell due to improperly installed rivet. If adjuster is detached, do not use seat until repaired. | Call to order repair kit. |
| Britax | Companion E9L14, E9L20, E9L80 | All made before 11/1/07 | Instructions have been revised to specify use of inner crotch strap location for children under 11 lbs. and to change the maximum head height to one inch from top of restraint shell. | Call Britax or go to its Web site to receive revised instructions and labels. |
| Britax | Decathlon E9L47 | 2/12/05 to 7/31/07 | If harness adjuster strap is pulled from the side, the plastic housing around the release button may come loose, allowing the adjuster to move out of position and making the harness difficult to tighten. | Call for repair kit consisting of push rivet fasteners to keep harness adjuster in position. |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|---|--|---|--|
| Britax | Frontier (model numbers starting with E9L54) | 4/1/08 to 9/14/08 (black harness) 4/1/08 to 9/17/08 (beige harness) | When loosening harness by pulling on only one strap, straps may become detached from harness yoke (splitter plate) on back of seat, resulting in child not being restrained. | Call for repair kit with plastic pieces to cover harness yolk ends. Instructions state to always pull on both straps when loosening harness. |
| Britax | Husky | All | LATCH belt path may be used if lap-shoulder belt is too short for belt path shown in instructions (tether must be attached). Recline bar is not required if top tether is attached, regardless of type of lower installation used. [Not publicized] | |
| Britax | Husky | All | Use of the long belt path with a lap belt only may allow excessive forward head movement in a crash. | Call for new labels and instructions; use the short belt path with recline bar. |
| Britax | Marathon 70 | All made before 10/5/10 | Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall] | Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present). |
| Britax | Marathon 70 | 7/1/2010 to 8/31/2011 | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall] | Call Britax for more information and replacement kit, if needed. |
| Britax | Marathon ClickTight E1A005R, E1A006B, E1A116L, E9LT71Q, E9LT75R, E9LT76B, E9LT76L, E9LT76N, E9LT76P, EXA116L | 8/1/2014 to 7/29/2015 | Red harness adjustment button may remain in release position after harness is tightened, enabling shoulder straps to loosen. | Call Britax for repair kit that includes lubricant to apply once only, directly to harness adjustment button. |
| Britax | Pavilion 70-G3 E9LK31A, E9LK31Q, E9LK32D, E9LK32Z, E9LK33Q, E9LL11A, E9LL11Q, E9LL12D, E9LL12Z | 6/1/2012 to 8/31/2012 | Material of HUGS chest pads is too soft, which could be a choking hazard. | Monitor child and call for replacement pads. |
| Britax | Roundabout 55 | All made before 10/5/10 | Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall] | Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present). |
| Britax | Roundabout 55 | 7/1/2010 to 8/31/2011 | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall] | Call Britax for more information and replacement kit, if needed. |
| Britax models with no recalls, replacement parts, or warnings: Advocate, Advocate ClickTight ARB, Advocate CS, Advocate 2013/G4, Boulevard ClickTight ARB, Boulevard CS, Boulevard 2013, B-Safe, Diplomat, Endeavours, Frontier 85, Frontier 85 SICT, Frontier 90, Highway, Highway 65, Marathon CS, Marathon 70 G3, Marathon 2013, Monarch, Parkway (all models), Pavilion 2013, Pinnacle 90, Pioneer 70, Roundabout 50, Roundabout 55 G 3, Roundabout 2013. | | | | |
| BubbleBum, 7380 Sand Lake Road, Suite 500, Orlando, FL 32819, 800-969-6586, www.bubblebum.us | | | | |
| BubbleBum models with no recalls, replacement parts, or warnings: BubbleBum Booster | | | | |
| Carfoldio 10685-B Hazelhurst Dr. #17695 Houston TX 77043 www.mifold.com | | | | |
| Carfoldio models with no recalls, replacement parts or warnings: Mifold Grab-and-Go Booster | | | | |
| Car Seat Specialty. See Team-Tex America | | | | |
| Chicco, 1842 William Penn Way, Ste. 101, Lancaster, PA 17601, 877-424-4226, www.chiccousa.com | | | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|---|---|--------------------------------------|--|--|
| Chicco | KeyFit, KeyFit 30, or Cortina Travel System (base only) | 2/26/08 to 3/17/08 | Some bases have a defect that can prevent achieving a tight fit when LATCH is used for installation. | Call to order new base. Use vehicle belt for installation until new base is received. |
| Chicco models with no recalls, replacement parts, or warnings: Fit2, GoFit, KeyFit 30 Magic, KeyFit Strada, KidFit Booster, NextFit, NextFit IX, NextFit Zip | | | | |
| Clek Inc., 12 Upjohn Road, Suite 1, Toronto, Ontario M3B 2V9, Canada 866-656-2462, clekinc.com | | | | |
| Clek models with no recalls, replacement parts, or warnings: Fllo, Foonf, Olli, Oobr, Ozzi | | | | |
| Columbia Medical – See Inspired by Drive | | | | |
| Columbia models with no recalls, replacement parts, or warnings: #2000, #2500, Spirit (#2400) | | | | |
| Combi USA, 3520 Westinghouse Blvd., Suite B, Charlotte, NC 28273, 800-992-6624, www.combiusa.com | | | | |
| Combi | Centre & Shuttle 8065, 8074, 8086, 8087, 8520, 4400, 4515, 4520 | 10/19/05 to 12/15/07 | Based on testing at speeds higher than required by federal standard, safety seat shell could separate from base in frontal collision. Combi states no injuries have been reported. | Call to order retrofit kit. Until modification is completed, use seat without base. |
| Combi | Coccoro 8220 | January 1, 2009 to December 31, 2012 | Webbing (without seat) tore partially in static test because of embedded plastic button that keeps buckle tongues from sliding out of reach. Complete restraint system complies with all requirements. | Call 844-697-1690 for free harness replacement kit. Continue using seat until new harness is received. |
| Combi | Coccoro 8220 | January 1, 2009 to June 29, 2016 | If installed forward facing with a lap-only belt, excessive force may be transferred to the child in a crash, increasing the risk of injury. | Call 888-232-3294 for free cover for bottom of seat to reduce child's risk of injury during a crash. |
| Combi | Zeus 360 8836 | February 1, 2009 to May 31, 2012 | Webbing (without seat) tore partially in static test because of embedded plastic button that keeps buckle tongues from sliding out of reach. Complete restraint system complies with all requirements. | Call 844-697-1690 for free harness replacement kit. Continue using seat until new harness is received. |
| Combi | Zeus Turn 8815 | July 1, 2007 to March 31, 2009 | Webbing (without seat) tore partially in static test because of embedded plastic button that keeps buckle tongues from sliding out of reach. Complete restraint system complies with all requirements. | Call 844-697-1690 for free harness replacement kit. Continue using seat until new harness is received. |
| Combi models with no recalls, replacement parts, or warnings: Connection, Dakota, Kobuk, Kobuk Air-Thru, Navette 22, Shuttle 33, Shuttle 35. | | | | |
| Compass. See Tomy International. | | | | |
| Convoid, 2830 California St., Torrance, CA 90503 888-266-8243, www.convoid.com | | | | |
| Convoid models with no recalls, replacement parts, or warnings: Carrot, Carrot 3, Convoid Special Needs Car Seat | | | | |
| Cosco. See Dorel Juvenile Group. | | | | |
| Cybex 560 Harrison Ave., Ste. 411, Boston MA 02118 877-242-5676 www.cybex-online.com/US | | | | |
| Cybex | Solution X-fix booster | 2/1/10 to 2/28/10 | Incorrect label states that unoccupied booster may be attached with LATCH only. Vehicle belt must be attached. | Call manufacturer for new label. |
| Cybex models with no recalls, replacement parts, or warnings: Aton, Aton 2, Aton Q, Cloud Q, Solution M Fix, Solution Q Fix, Solution Q2 Fix, X Fix Q | | | | |
| Diono LLC, 418 Valley Ave. NW, Suite 100, Puyallup, WA 98371, 855-463-4666, www.diono.com | | | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|--|--|--|---|
| Diono | Olympia, Pacifica, Radian R100, Radian R120, Radian RXT, Rainier | 11/25/13 to 9/5/17 | If installed forward facing and untethered with lap-only belt, child may suffer chest injury in a crash. | Call 253-256-9939 for updated instruction manual, energy-absorbing pad, and new chest clip. |
| Diono or Sunshine Kids models with no recalls, replacement parts, or warnings: Cambria, Monterey, Radian models 65, 65SL, 80, 80SL, XT, XTSL, Santa Fe, Snug Seat Pilot, Solana. | | | | |
| Dorel Juvenile Group, 2525 State St., Columbus, IN 47201, 800-544-1108, www.djgusa.com | | | | |
| Note: Dorel is the parent company for Cosco, Eddie Bauer, Maxi-Cosi, Safety 1st, Alpha Elite, and Alpha Sport brands. Some models are marketed with multiple names. | | | | |
| Dorel | Some infant seats sold with travel systems (rear adjust only). | 1/6/08 to 4/6/09 "Made in China" on label. | Handle may detach as screws loosen, allowing baby to fall out of seat. | Call for repair kit. Do not use handle until repaired. Does not apply to all model numbers; check with Dorel. |
| Dorel | 3-In-1 | See Alpha Omega. | | |
| Dorel | Adjustable Highback Booster | See Prospect. | | |
| Dorel | All in One | See Alpha Omega. | | |
| Dorel | Alpha Luxe | See Alpha Omega Elite. | | |
| Dorel | Alpha Omega 22150, -52, -59, -72, -77, -78, -85, 22412, -59, -69 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call to get lubricant for harness adjuster pivot pins. |
| Dorel | Alpha Omega Elite 22148-49, 22154-55, -58, -88, -95, 22456, -59, -62, -65, 22755, -58, -59, -90, -99 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call to get lubricant for harness adjuster pivot pins. |
| Dorel | Alpha Omega Elite 22187, 22465, CC033, CC046 or Deluxe 3 in 1 22790, CC046 | 7/20/10 to 5/18/11 | Labels with arrows for rear-facing belt path are incorrect, which could result in belt being placed in forward-facing belt path. | Call 877/675-2355 for a kit with modified labels and installation instructions. |
| Dorel | Avenue 22439, 22449 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call to get lubricant for harness adjuster pivot pins. |
| Dorel | Comfy Carry IC123FSM | 5/1/11 to 4/30/12 | Some seats were sold without detachable base containing the required LATCH system. | Call for base with LATCH system. |
| Dorel | Complete Air LX CC050, Complete Air SE CC051 | 7/20/10 to 5/18/11 | Labels with arrows for rear-facing belt path are incorrect, which could result in belt being placed in forward-facing belt path. | Call 877/675-2355 for a kit with modified labels and installation instructions. |
| Dorel | Deluxe 3 in 1 | | See Alpha Omega Elite | |
| Dorel | Deluxe Infant | See recall at top of Dorel section. | | |
| Dorel | Deluxe Convertible | See Enspira | | |
| Dorel | Deluxe 3-in-1 | See Alpha Omega Elite. | | |
| Dorel | Designer 22 | See recall at top of Dorel section. | | |
| Dorel | Dream Ride, Dream Ride Ultra | Many older seats have been recalled. Do not use if past expiration date or if date is unknown. | | |
| Dorel | Echelon | See Alpha Omega Elite. | | |
| Dorel | Eddie Bauer | See specific model name. | | |
| Dorel | Enspira 22452-53, 22740-41, 22458 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call to get lubricant for harness adjuster pivot pins. |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|-------------|---|---|---|---|
| Dorel | High Back Booster (generic) | Note: Dorel identifies various models as "High Back Boosters," including several combination seats (used as child seat with harness or as booster after removing harness; with or without armrest; with front or rear harness adjuster) as well as boosters only (no harness included). | | |
| Dorel | Maxi-Cosi Mico 22356, 22371-72 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call for lubricant for harness adjuster pivot pins. |
| Dorel | Maxi-Cosi Mico 22-371, 22-372 or base only 22-515 | All made before 6/28/08 | Shell may not attach securely to base or may be difficult to detach. | Call for kit to replace springs in base. Use without base until repaired. |
| Dorel | Maxi-Cosi Priori 22476, 22486 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call for lubricant for harness adjuster pivot pins. |
| Dorel | Olympian | See Touriva | | |
| Dorel | onBoard 22077-78, 22356 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call for lubricant for harness adjuster pivot pins. |
| Dorel | onBoard 35 IC124FSM | 5/1/11 to 4/30/12 | Some seats were sold without detachable base containing the required LATCH system. | Call for base with LATCH system. |
| Dorel | Prospect 22580, 22880 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call for lubricant for harness adjuster pivot pins. |
| Dorel | Regal Ride | See Touriva. | | |
| Dorel | Safety 1st | See specific model name. | | |
| Dorel | Scenera 22120-22128, 22160, 22162, 93120 | All made before 3/24/08 | Harness webbing may be damaged if it slides over pointed guides on bottom of plastic shell. Keep webbing behind guides. | If damaged, call Dorel for replacement harness and instructions for keeping webbing in correct position. [Not publicized] |
| Dorel | Starter | See recall at top of Dorel section. | | |
| Dorel | SureFit 22657, 22346, IC072 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call for lubricant for harness adjuster pivot pins. |
| Dorel | Surveyor | See Vantage Point. | | |
| Dorel | Touriva, 5-point harness, T-shield, or overhead shield | Many older seats have been recalled. Do not use if past expiration date or if date is unknown. | | |
| Dorel | Touriva or Regal Ride, 5-point harness 22100TTD, 22100TIP, 2111FSM2, 2130WAL, 2139MON | 9/28/04 to 9/20/07 | Elastic straps that secure cover to shell may come loose, allowing child to wrap them around parts of body. | Call or visit Dorel Web site to order repair kit. |
| Dorel | Turnabout | See Arriva. | | |
| Dorel | Uptown 22475 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call for lubricant for harness adjuster pivot pins. |
| Dorel | Vantage, Vantage Point 22546-47, -53, -54, -60, -61, -64, -67, -74 | 5/1/08 to 4/30/09 | Harness may gradually loosen during normal use, which could increase risk to child in crash. | Call for lubricant for harness adjuster pivot pins. |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|--|--|--|---|
| Dorel models with no recalls, replacement parts, or warnings: Able65, Advance 70 Air+, Advance EX 65 Air+, Advance SE or LX 65 Air +, Alpha Elite 65, Ambassador, Apex 65, Apt 40 RF, APT 50, Aquos 65, Boost A Pak, Boost Air Protect, Chart Air 65, Comfort High Back Booster, Comfort Ride, Comfy Convertible, Commuter, Complete Air, Complete Air 65, Complete Air 70, Complete Voyager, Continuum, Deluxe Backed BPB, Deluxe Harness 65, Deluxe Highback 65, Designer, Destination, Dream Ride SE, Easy Elite, EasyFit 65, Elite 80 Air+, Elite 100 Air +, enRoute, Essential Air, EverFit, Finale, Go Hybrid, Grand Explorer, Grow and Go, Grow and Go EX Air, Guide 65, High Rider, Incognito, Light 'N Comfy, Maxi-Cosi Cosi35, Maxi-Cosi Mico AP/Mico Nxt, Maxi-Cosi Mico 30, Maxi-Cosi Mico Max 30, Maxi-Cosi Prezi, Maxi-Cosi Pria 70 (all models), Maxi-Cosi Pria 85, Maxi-Cosi Pria 85 Max, Maxi-Cosi Rodi (all models) Maxi-Cosi RodiFix, Maxi-Cosi Vello 65, Maxi-Cosi Vello 70, Mighty Fit 3-in-1, Multi Fit 3-in-1, onBoard 35 Air (all models), onSide Air Convertible, Portable Car Seat, Pronto, Protek, Rightway, Rise, Rumi Air, Scenera 40RF, Scenera Next, Scenera Versa-Fit OHB, Sport, Stack It!, Store 'N Go, Summit, Summit 65, Summit Deluxe, Top Side Booster, Tote 'n Go, Travel Vest, Traveler, Vantage, Ventura, Vista, XRS 65. | | | | |
| Dream On Me, 170 Circle Drive North, Piscataway NJ 08854, 732-748-1300, www.dreamonme.com | | | | |
| Dream On Me models with no recalls, replacement parts, or warnings: Coupe backless booster, Deluxe highback booster, Mia Moda Certo (see also recall under Mia Moda) | | | | |
| Easycarseat (Inflatable booster available online). According to NHTSA, the manufacturer states that all of the boosters sold in the U.S. were withdrawn. | | | | |
| Eddie Bauer. See Dorel Juvenile Group. | | | | |
| Evenflo, 225 Byers Rd Miamisburg, OH 45342, 800-233-5921, www.evenflo.com | | | | |
| Evenflo | Big Kid Booster 30911173AD, 3091967AD, 30911118AD, 30911120D | Unknown. Shipped 8/6/12 to 9/18/12 | Registration card and instruction manual are missing. Sticker on backrest: "Display Only. Not intended for sale." | Call for missing card and manual. If seat has been distributed by program, notify recipient. |
| Evenflo | Chase, Chase LX, DLX, Chase Select 306xxxx, 329xxxx | 8/23/11 to 3/3/14 | May be difficult to release harness buckle, which could cause risk to child in emergency. | Call 800-490-7591 or go to www.buckle.evenflo.com for replacement buckle. |
| Evenflo | Discovery with 3- or 5-pt harness 390, 391, 534, 552 | 4/27/05 to 1/29/08 | Safety seat shell could separate from base in high-impact side collision. | Call to order dual-hook fastener strap. Until modification is completed, use seat without base. |
| Evenflo | Discovery 3021769Z, 3021854Z | 2/4/08 only | Some seats were made without complete assembly of red release handle located on the back. Under certain conditions, the shell could separate from its base, possibly resulting in serious injury. | Call for a replacement safety seat. Until new seat is received, use without base. |
| Evenflo | Embrace 35 | 12/2011- 5/2013. CHECK COLUMNS AT RIGHT FOR MODEL #'s | May be difficult to release harness buckle, which could cause risk to child in emergency. Model #'s 30711365, 31511040, 31511323, 31511400, 3151198, 3151953, 31521138, 46811205, 46811237, 48111200, 48111215, SEE COLUMN AT RIGHT FOR ADDITIONAL MODEL #s. | Call 800-490-7591 or go to www.embracebuckle.evenflo.com for replacement buckle. Additional model numbers: 48111215A, 48111218, 48111234, 48111235, 48111235A, 48111462, 48411391, 48411391D, 48411392, 48411504, 48411504D, 52911307A, 52921040, 55311138, 55311238, 55311292 |
| Evenflo | Evolve 34411700 | 2/26/15 to 2/9/16 | Child can reach & release button loosening seat harness, a risk for injury. If child has discovered how to release adjuster, stop using seat. | Call 800/233-5921 for free repair kit & front adjuster components. |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|---|---|--|---|--|
| Evenflo | Evolve 34411741 | 5/27/15 to 2/9/16 | Child can reach & release button loosening seat harness, a risk for injury. If child has discovered how to release adjuster , stop using seat. | Call 800/233-5921 for free repair kit & front adjuster components. |
| Evenflo | Express 329xxx | 10/31/11 to 3/3/14 | See Chase listed above for details. | |
| Evenflo | First Choice 3604098 | 1/16/09 to 9/29/09 | Missing labels regarding contact information and aircraft certification. | Call to order labels. |
| Evenflo | Fresh Air | Refer to specific model name. Fresh Air is name of style/fabric. | | |
| Evenflo | Maestro, Maestro Performance 310xxxx | 8/22/11 to 10/17/13 | See Chase listed above for details. | |
| Evenflo | Momentum 65, 65 LX, 65 DLX | 2011-2015, select models | A screw on the harness adjuster, front & center below the adjuster strap, may detach or loosen. (Does not affect performance; not a recall) | Call 800-233-5921 (Evenflo) or go to www.safety.evenflo.com for replacement screw. |
| Evenflo | Momentum 65, 65 LX, 65 DLX 385xxxx | 3/4/13 to 8/26/13 | See Chase listed above for details. | |
| Evenflo | Secure Kid, Secure Kid LX, DLX, 100/300/400, 308xxxx | 12/13/11 to 3/3/14 | See Chase listed above for details. | |
| Evenflo | SureRide, SureRide Deluxe, Titan 65 | 2011-2015, select models | A screw on the harness adjuster, front & center below the adjuster strap, may detach or loosen. (Does not affect performance; not a recall) | Call 800-233-5921 (Evenflo) or go to www.safety.evenflo.com for replacement screw. |
| Evenflo | SureRide DLX 371xxxx | 6/20/12 to 10/17/13 | See Chase listed above for details. | |
| Evenflo | Symphony 65, 65 E3, LX, DLX | 2011-2015, select models | A screw on the harness adjuster, front & center below the adjuster strap, may detach or loosen. (Does not affect performance; not a recall) | Call 800-233-5921 (Evenflo) or go to www.safety.evenflo.com for replacement screw. |
| Evenflo | Symphony 65, 65 E3, LX, DLX 345xxxx, 346xxxx | 10/2/12 to 8/26/13 | See Chase listed above for details. | |
| Evenflo | Titan 65 71xxxx | 6/20/12 to 10/17/13 | See Chase listed above for details. | |
| Evenflo | Transitions 34411686, 34411695, 34411029 | 12/18/14 to 1/29/16 | Child can reach & release button loosening seat harness, a risk for injury. If child has discovered how to release adjuster , stop using seat. | Call 800/233-5921 for new bottom seat pad & front adjuster components. Important: view video at www.transitions.evenflo.com . |
| Evenflo models with no recalls, replacement parts, or warnings: Amp, Confidence, Embrace 35 Advanced (w/SensorSafe), Generations, Generations 65, Lite Max 35, Nurture, Orion, Right Fit (all models), SafeMax All-in-One, SecureRide 35, Serenade, Sightseer (highback booster), Sonus 50, Sonus 65, Spectrum, Stratos, Symphony, Titan Elite, Titan Sport, Traditions, Tribute Sport, Triumph Advance 50, Triumph Advance 65, Vanguard, Victory, Vision. | | | | |
| ExoMotion, 309 South Cloverdale Street, Unit B 12, Seattle WA 98108, 866-870-2122, www.exomotion.com | | | | |
| Distributor for Recaro Monza Reha, Recaro ProSport Reha (no recalls) | | | | |
| E-Z-ON Products, 605 Commerce Way West, Jupiter, FL 33458, 800-323-6598, www.ezonpro.com | | | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|---|---|---|--|
| E-Z-On models with no recalls, replacement parts, or warnings: Vests and Harnesses | | | | |
| Fisher-Price, 636 Girard Ave., East Aurora, NY 14052, 800-432-5437, www.fisher-price.com | | | | |
| Fisher-Price models with no recalls, replacement parts, or warnings: Safe Voyage Convertible, Safe Voyage Deluxe Convertible, Safe Voyage Booster, Safe Voyage Infant. | | | | |
| GOBOOSTER – All models sold within US have been withdrawn, per NHTSA. | | | | |
| Goodbaby USA 560 Harrison Ave. Boston MA 02118 844-543-2020 GBchildusa.com | | | | |
| Goodbaby USA models with no recalls, replacement parts or warnings: Asana 35, Asana 35AP, Idan, Phil&Teds Alpha Protect, Aria Child/Urbini Petal, Urbini Touri, Urbini Sonti. | | | | |
| Graco Children’s Products, 150 Oaklands Blvd, Exton, PA 19341, 800-345-4109 www.gracobaby.com. | | | | |
| Graco | Argos 70, Argos 70 Elite | 5/1/11 to 7/31/13 | May be difficult to release harness buckle, which could cause risk to child in emergency. | Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com |
| Graco | CarGo 8D02, 8D03 | 1/9/07 to 3/3/08 | Incorrect phone number for NHTSA on sticker. | Call Graco for correct sticker. |
| Graco | Classic Ride 1812930 | 3/1/ 14 to 2/28/15 | Labels missing information on location of instruction manual. | Call 1-800-345-4109 for replacement label. |
| Graco | Classic Ride 50 | 10/1/11 to 9/30/13; see Argos 70 listed above for details. | | |
| Graco | ComfortSport 1794333, 1813040 | 3/1/ 14 to 2/28/15 | Labels missing information on location of instruction manual. | Call 1-800-345-4109 for replacement label. |
| Graco | ComfortSport | 10/1/10 to 9/30/13; see Argos 70 listed above for details. | | |
| Graco | ComfortSport with 5-pt harness 8433, 8629-39, 8C00-04 | 1/2/07 to 7/31/07 | The LATCH strap may be incorrectly routed over instead of under the harness straps, allowing excessive rotation of rear-facing seat in a crash. | Call Graco or view drawing on Web site and correct strap routing before installing with LATCH. |
| Graco | ComfortSport with 5-pt harness C04FRR, 8C04FRR2 | 11/1/06 to 10/8/07 | Body pillow partially covers airbag warning label on seat cover. | Remove pillow, which is an optional comfort feature. |
| Graco | CozyCline | 1/1/06 to 4/30/10; see Argos 70 listed above for details. | | |
| Graco | Extend2Fit 1954477 | 11/27/15 to 1/20/16 | Information on recline label (upright for infant; reclined for older child) risks injury. Check labels on sides of seat to determine that one side is all English, other side, all Spanish. | If languages are mixed on either side of seat, call 1-800-345-4109 for replacement label. |
| Graco | Head Wise 70 w/Safety Surround | 1/1/12 to 7/31/13 and 8/3/13; see Argos 70 listed above for details. | | |
| Graco | Milestone 191030, 1923980, 1926538, 1926539 | 7/9/15 to 10/9/15 | Label missing directive to install child restraint using lower anchors or safety belt. | Contact Graco at 800-345-4109 for free replacement label. |
| Graco | My Ride 65, My Ride 65 with Safety Surround | 4/1/09 to 7/31/13, and 9/30/13; see Argos 70 listed above for details. | | |
| Graco | My Ride 65 | Model #s 1794334 (mfd. 5/20/14-7/15/14), 1813015 (mfd. 7/3/14-7/24/14), 1813074 (mfd. 6/20/14-7/27/14), 1853478 (mfd. 7/11/14-7/27/14), 1871689 (mfd. 7/5/14-7/24/14), 1872691 (mfd. 5/16/14-8/1/14), 1877535 (mfd. 5/26/14-7/27/14), and 1908152 (mfd. 7/23/14-7/27/14). Affected models also have “2014/06” on harness tag. These harnesses may fail in a crash. Contact Graco for a free replacement harness. 800-345-4109 | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|--|--|--|---|
| Graco | My Ride 70 | 5/1/12-7/31/13; See Argos 70 listed above for details. | | |
| Graco | My Size 70 | 1/1/12 to 7/31/13, and 8/3/13; see Argos 70 listed above for details. | | |
| Graco | Nautilus 3-in-1, Nautilus Elite, Nautilus Plus | 10/1/07 to 7/31/13 and 8/19/13; see Argos 70 listed above for details. | | |
| Graco | Platinum CarGo 8689, 8D01, 8D04, 8D05,8D10 | 1/9/07 to 3/3/08 | Incorrect phone number for NHTSA on sticker. | Call Graco for correct sticker. |
| Graco | Ready Ride 1924519, 1924520 | 3/1/ 14 to 2/28/15 | Labels missing information on location of instruction manual. | Call 1-800-345-4109 for replacement label. |
| Graco | Ready Ride | 10/1/10 to 9/30/13 | See Argos 70 listed above for details. | |
| Graco | Size4Me 70 | 1/1/12 to 7/31/13 and 8/3/13; see Argos 70 listed above for details. | | |
| Graco | Smart Seat | 12/1/10-9/30/13 and 10/9/2013, 12/25/2013, 1/10/2014; see Argos 70 listed above. | | |
| Graco | SnugRide, SnugRide Classic Connect | 3/1/11 to 5/31/13 | May be difficult to release harness buckle, which could cause risk to child in emergency. | Call 877-766-7470 for replacement buckle. |
| Graco | SnugRide 30, SnugRide Classic Connect 30 | 7/1/10 to 1/31/13 | See SnugRide, SnugRide Classic Connect listed above for details. | Call 877-766-7470 for replacement buckle. |
| Graco | SnugRide 35, SnugRide Classic Connect 35 | 5/1/11 to 1/31/13 | See SnugRide, SnugRide Classic Connect listed above for details. | Call 877-766-7470 for replacement buckle. |
| Graco | SnugRide Click Connect 40 | 6/1/12 to 12/31/12 | See SnugRide, SnugRide Classic Connect listed above for details. | Call 877-766-7470 for replacement buckle. |
| Graco | Treasured CarGo 8686 | 1/9/07 to 3/3/08 | Incorrect phone number for NHTSA on sticker. | Call Graco for correct sticker. |
| Graco | TurboBooster 1963973 | 3/8/16 to 4/2/16 | Instructions don't state that booster must be securely belted to vehicle at all times, even when booster is not occupied. | Call 800-345-4109 for revised instruction booklet. |
| Graco | TurboBooster 1963974 | 12/22/15 to 3/30/16 | See reason at TurboBooster 1963973 above. | Call 800-345-4109 for revised instruction booklet. |
| Graco | TurboBooster 1963975 | 12/22/15 to 3/17/16 | See reason at TurboBooster 1963973 above. | Call 800-345-4109 for revised instruction booklet. |
| Graco | TurboBooster 1963976 | 2/17/16 to 3/24/16 | See reason at TurboBooster 1963973 above. | Call 800-345-4109 for revised instruction booklet. |
| Graco | TurboBooster 1967886 | 1/13/16 to 4/5/16 | See reason at TurboBooster 1963973 above. | Call 800-345-4109 for revised instruction booklet. |
| Graco | TurboBooster 1975173 | 3/29/16 | See reason at TurboBooster 1963973 above. | Call 800-345-4109 for revised instruction booklet. |
| Graco | Ultra CarGo 8487 | 1/9/07 to 3/3/08 | Incorrect phone number for NHTSA on sticker. | Call Graco for correct sticker. |
| Graco models with no recalls, replacement parts, or warnings. 4Ever, 4Ever Extend2Fit, Affix, Affix w/Safety Surround, AirBooster, Argos 65, Argos 80 Elite, Assura, Atlas 65, CarGo, Cherish Car Bed, Colorz, Connex, Contender 65, Fit4Me 65, Head Wise 65, Infant Safe Seat, MySize 65, Nautilus 65 LX/DLX, Nautilus 80 Elite, Sequel 65, Size4Me 65, SlimFit 3-in-1, SnugRide 32, SnugRide Click Connect 30, SnugRide Click Connect 35, SnugRide SnugLock 30, SnugRide SnugLock 35 (all models), Tranzitions. | | | | |
| Harmony Juvenile Products, 1600 53rd Street, North Bergen, NJ 07047, 877-306-1001, www.harmonyjuvenile.com | | | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|------------------------------------|---|--|--|
| Harmony models with no recalls, replacement parts, or warnings: Baby Armor, Big Boost Deluxe, Carpooler, Cruz, Defender 360, Dreamtime Comfort, Folding Travel Booster, LiteRider, Olympian, Transit, Transit Deluxe, V6 Highback, Youth Booster. | | | | |
| hauck Fun for Kids, 212 A Wilkinson Rd., Brampton, Ont., L6T 4M4 Canada 905 455 5888 | | | | |
| hauck Fun for Kids models with no recalls, replacement parts, or warnings: iCoo, iGuard, PROsafe 35 | | | | |
| IMMI (Also See SafeGuard) 18881 IMMI Way Westfield, Indiana 46074 317-896-9531 www.imminet.com | | | | |
| IMMI Models with no recalls, replacement parts or warnings: Go Combination Child Seat | | | | |
| Inspired by Drive 11724 Willake St. Santa Fe Springs CA 90670 800-454-6612 www.inspiredbydrive.com | | | | |
| Inspired by Drive models with no recalls, replacement parts or warnings: Spirit, Spirit Plus, Spirit IPS | | | | |
| Jané USA, P.O. Box 410007, San Francisco, CA 94141, 415-824-1237, www.janeusa.com | | | | |
| Jané USA models with no recalls, replacement parts, or warnings: Indy, Indy Plus, Montecarlo R1, Team, Team Plus. | | | | |
| Jeffco Fibres, 451 Quarry St. Fall River, MA 02722 508-673-1001, www.jeffcofibres.com (out of safety seat field) | | | | |
| Jeffco or LaRoche models with no recalls, replacement parts, or warnings: Grizzly Bear, Polar Bear, Teddy Bear | | | | |
| J J Cole - See Tomy | | | | |
| Jupiter Industries, 1399 Kennedy Rd., #22, Scarborough, Ontario M1P2L6 Canada, 800-465-5795, 416-285-7525, www.jupiterindustries.com | | | | |
| Jupiter models with no recalls, replacement parts, or warnings: Komfort Kruiser. | | | | |
| Kiddy, 2420 Wild Iris Lane, Dacula, GA, 30019, 678-377-3309, www.kiddyusa.com | | | | |
| Kiddy USA | World Plus 51 100 WP | 2/1/12 to 10/5/13 (all models ever produced) | Buckle tongue may not fully engage on affected seats. | Contact manufacturer for full refund of purchase price. Call 1-855-925-4339 for more information. |
| Kiddy models with no recalls, replacement parts, or warnings: Cruiserfix Pro, Cruiser 3 | | | | |
| KidsEmbrace, 4830 Rusina Rd., Suite B, Colorado Springs, CO 80907, 866-947-3287, www.kidsembrace.com | | | | |
| KidsEmbrace models with no recalls, replacement parts, or warnings: Combination seat, Toddler Booster, Fun Ride | | | | |
| Kids ii, 333 Piedmont Rd. NE, Ste. 1800, Atlanta GA 30305 770-551-0442 www.kidsii.com | | | | |
| Kids ii models with no recalls, replacement parts, or warnings: Ingenuity InTrust 35 | | | | |
| Learning Curve. See Tomy International. | | | | |
| Lil Fan 17401 Tiller Ct., Ste. A, Westfield IN 46074 317-804-9160 www.lilfan.com | | | | |
| Lil Fan models with no recalls, replacement parts, or warnings: Box Seat, Club Seat | | | | |
| Lilly Gold 5468 Maple Ridge Ct., Minnetonka MN 55343 800-829-1625 www.lillygold.com | | | | |
| Lilly Gold | Sit'n' Stroll 4002 | 5/5/08 | Center adjuster webbing doesn't comply with required breaking strength. | Call for repair kit and instructions to replace webbing. |
| Little Tikes 2180 Barlow Rd. Hudson OH 44326 800-321-0183 www.littletikes.com | | | | |
| Little Tikes products with no recalls, warnings or replacement parts: Highback Booster, Backless Booster, Hip | | | | |
| Maxi-Cosi. See Dorel. | | | | |
| Mercedes-Benz USA, Accessories, P.O. Box 350, Montvale, NJ 07645, www.mbusa.com | | | | |
| Mercedes models with no recalls, replacement parts, or warnings: Baby Safe Plus, Child Booster, Duo Plus, KidFix. | | | | |
| Merritt Manufacturing, P. O. Box 17152, Indianapolis, IN 46217, 317-409-0148, www.eztether.com | | | | |
| Merritt Manufacturing models with no recalls, replacement parts, or warnings: Chamberlain, Churchill, Hope Car Bed, Jefferson, Roosevelt, Wallenberg | | | | |
| Mia Moda Inc., 170 Circle Drive North Piscataway, NJ 08854, 866-642-6632 www.miamodainc.com | | | | |
| Mia Moda (See also Dream On Me) | Viva, Viva Supreme 5000-5081 | All (discontinued 4-30-09) | (1) Splitter plate has sharp edges which can cut harness. (2) Base could crack in a crash. | Do not use. Go to www.vivacarseatrecall.com or call Lerado Group USA (877-546-8437) for refund. |
| Nania. See Team Tex America. | | | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|--|--|--|---|
| Nuna Baby Essentials Inc., 70 Thousand Oaks Blvd., Morgantown, PA 19543, 855-686-2872 www.nuna.eu/USA/index | | | | |
| Nuna model with no recalls, replacement parts, or warnings: AACE, Pipa, Pipa Lite, Rava | | | | |
| Orbit Baby Inc., 5437 Central Avenue, Suite 10, Newark, CA 94560, 877-672-2229, www.orbitbaby.com | | | | |
| Orbit Baby | Original Car Seat Base | All before 2/1/08 | Original base sold with Infant Car Seat is not compatible with Toddler Car Seat. | Call or go to Web site for upgrade. |
| Orbit Baby | G2 Car Seat Base ORB822000, Batch #A0840, A0860, A0880 | 3/20/13 to 7/20/13 | StrongArm knob may detach or spin without tightening base. | Call to order repair kit. Use seat without base until base is repaired. |
| Orbit Baby Inc. models with no recalls, replacements parts, or warnings: Infant/Infant G2/Infant G3, Orbit Toddler/Toddler G2/Toddler G3 (see above for information about bases) | | | | |
| Peg Perego U.S.A., 3625 Independence Dr., Fort Wayne, IN 46808, 800-671-1701, us.pegperego.com | | | | |
| Peg Perego | Primo Viaggio SIP 30-30 | 7/1/07 to 3/15/08 | Plastic housing on harness adjuster may have sharp edge that scratches child's feet. | Call to order replacement adjuster cover. |
| Peg Perego | Primo Viaggio | All models with stroller base that has front bar | Stroller use: To prevent possibility of baby's fall due to incorrect placement of seat on stroller, make sure that front bar is installed on stroller and that seat is latched firmly to stroller with two hooks. Test by yanking seat toward front of stroller. | |
| Peg Perego model with no recalls, replacement parts, or warnings: Performance Coupe, Primo Viaggio 4-35, Primo Viaggio 4-35 Nido, Primo Viaggio Convertible, Primo Viaggio SIP ES 30-30, Primo Viaggio SIP 5-70, Viaggio Flex 120 | | | | |
| Phil&Teds – See Goodbaby | | | | |
| Porsche Cars of North America. Contact Britax. | | | | |
| Porsche models with no recalls, replacement parts, or warnings: Baby Seat, Junior Seat G1, Junior Seat Plus G2, G3. | | | | |
| ProRider 7818 S 212th St Ste. 106, Kent, WA 98032 800-414-5560 www.prorider.com | | | | |
| ProRider model with no recalls, replacement parts, or warnings: CNS Booster, ProRider Booster | | | | |
| Recaro Child Safety Systems North America, 1600 Harmon Rd., Auburn Hills, MI 48326, 888-973-2276 us.recaro-cs.com | | | | |
| Recaro | Como or Signo | All made before 12/18/07 | Looped ends of harness may become disconnected from harness connector when child is placed in or removed from seat. | Call for kit with two rubber caps to prevent harness loops from slipping off by closing gaps. |
| Recaro | Como or Signo (model numbers start with 330 or 331) | 11/1/07 to 2/16/09 | If metal frame around harness release lever is gold, adjuster may be defective, allowing front adjuster strap to slip so harness is loose on child. If metal frame is silver, adjuster is not defective. | Check adjuster by tightening harness, then pulling on shoulder straps to see if harness loosens. Call or go to recarokids.com for instructions to test adjuster and to request replacement seat if necessary. |
| Recaro | Performance RIDE, all models beginning with 333.01 | 1/15/13 to 6/9/15 | Tether may detach from car seat during crash. | Retrofit kit will be provided by Recaro. Customers may also call 1-866-628-4750 to request retrofit kit. |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|--|---|--------------------------|---|--|
| Recaro | ProRIDE, all models beginning with 332.01 | 4/9/10 to 6/9/15 | Tether may detach from car seat during crash. | Retrofit kit will be provided by Recaro. Customers may also call 1-866-628-4750 to request retrofit kit. |
| Recaro | ProSport (model numbers start with 385) | 6/16/10 to 1/31/13 | Excess head excursion if restraint is installed with lower anchors and not tethered. | Call mfr. for label & revised instructions; discontinue use of lower anchors when child reaches 40 lbs. |
| Recaro models with no recalls, replacement parts, or warnings: Como G2, Euro, Performance Booster, Performance Coupe, Performance Crossover, Performance Racer/Rally, Performance Roadster, Performance Sport, ProBooster, Signo G2, Start, Vivo, Vivo Lite, Young Sport, Young Style. See also Exomotion. | | | | |
| Safe Traffic System Inc., 10201 Pacific Ave. Franklin Park IL 847-233-0365 , www.safetrafficsystem.com | | | | |
| Safe Traffic System models with no recalls, replacement parts, or warnings: Ride Safer Vests, Delighter booster | | | | |
| SafeGuard, 18881 US 31 North, P.O. Box 408, Westfield, IN 46074, 800-586-7839, www.safeguardseat.com | | | | |
| SafeGuard models with no recalls, replacement parts, or warnings: SafeGuard, SafeGuard Go. | | | | |
| Safety Angel/Safe Start, P.O. Box 740151, Boynton Beach, FL 33474, 561-732-1233, www.safetyangel.com | | | | |
| Safety Angel model with no recall: Ride Rytte | | | | |
| Safety 1st. See Dorel Juvenile Group. | | | | |
| Safety Baby. See Team Tex America. | | | | |
| Sammons Preston Rolyan, 1000 Remington Blvd, Bolingbrook, IL 60440, 800-323-5547, www.sammonspreston.com | | | | |
| Sammons Preston Rolyan models with no recalls, replacement parts, or warnings: Tumble Forms Carrie Seats | | | | |
| Simple Parenting 168 E Main St. Prospect Park NJ 07508 862-240-1755 www.happykidssmartparents.com | | | | |
| Simple Parenting products with no recalls, warnings or replacement parts: Doona | | | | |
| Sentry Baby Products, 6660 Delmonico Dr., Ste. D470 Colorado Springs CO 80919 719-212-6016 www.sentrybabyproducts.com | | | | |
| Sentry Baby Products models with no recalls, replacement parts, or warnings: Guardimals | | | | |
| Snug Seat. Box 1739, Matthews, NC 28106, 800-336-7684, www.snugseat.com | | | | |
| Snug Seat models with no recalls, replacement parts, or warnings: Hippo, Pilot, SS1000, Snug Seat Car Bed, Traveler Plus EL, Wee Go. | | | | |
| Snugli, 225 Byers Rd Miamisburg, OH 45342, 1-800-374-3603, www.snugli.com | | | | |
| Snugli | All-in-One | 2011-2015, select models | A screw on the harness adjuster, front & center below the adjuster strap, may detach or loosen. (Does not affect performance; not a recall) | Call 800-233-5921 (Evenflo) or go to www.safety.evenflo.com for replacement screw. |
| Snugli | All-in-One 346xxxx | 10/2/12 to 8/26/13 | May be difficult to release harness buckle, which could cause risk to child in emergency. | Call 800-490-7591 (Evenflo) or go to www.buckle.evenflo.com for replacement buckle. |
| Snugli | Booster 308xxxx | 12/13/11 to 3/3/14 | See All-in-One | |
| Snugli models with no recalls, replacement parts, or warnings: Infant Car Seat | | | | |
| Summer Infant, 1275 Park East Drive, Woonsocket, RI 02895, 800-268-6237, www.summerinfant.com | | | | |
| Summer Infant models with no recalls, replacement parts, or warnings: Prodigy | | | | |
| Team-Tex America (formerly Car Seat Specialty), P. O. Box 3194, Rock Hill, SC 29732, 877-912-1313 | | | | |
| Team Tex | Baby Ride 374099, 374199 | 12/18/08 | Belt routing label with "horizontal reference line" is incorrectly placed on child restraint. | Call for correct label and placement instructions. |
| Team-Tex models with no recalls, replacement parts, or warnings: Beline, Dream, Dreamway SP, HighRide | | | | |
| Teutonia USA, 150 Oaklands Boulevard, Exton, PA 19341, 877-838-8664, www.teutoniausa.com | | | | |
| Teutonia models with no recalls, replacement parts, or warnings: T-Tario 32, T-Tario 35 | | | | |

| MFR. | MODEL NAME (MODEL #) | DATES APPLICABLE | PROBLEM | ACTION REQUIRED |
|---|-------------------------|---------------------|---------|-----------------|
| Tomy International, 1111 W. 22nd Street, Suite 320, Oak Brook, IL 60523, 1-800-704-8697, www.tomy.com (previously Learning Curve) | | | | |
| Tomy, Learning Curve, and Compass models with no recalls, replacement parts, or warnings: I 410, Via (all models), Compass Folding Adjustable Boosters (all models), all True Fit convertible models | | | | |
| TriplePlay Products See Lilly Gold | | | | |
| UPPAbaby, 60 Sharp Street, Hingham, MA 02043, 781-413-3000 www.uppababy.com | | | | |
| UPPAbaby models with no recalls, replacement parts, or warnings: Mesa | | | | |
| Urbini – See Aria Child | | | | |
| Volvo Cars of North America, 7 Volvo Dr., Rockleigh NJ 07647 800-458-1552 www.volvocars.com | | | | |
| Volvo models with no recalls, replacement parts, or warnings: Child Booster or Child Cushion and Backrest | | | | |

BMW of North America is recalling 7,162 2016 BMW 5 Series sedans to fix a problem with the child-restraint lower anchor system. The 2016 BMW 5 Series models are listed on the following page. The affected vehicles have an inboard lower anchor for child restraints on the left rear seat that may have been bent downwards, preventing the child seat from fully engaging both lower anchors, thus, increasing a child's risk of injury in a crash. The month and year of manufacture can be found on the VIN sticker on the inside driver door panel. Caregivers installing a restraint here should use the safety belt instead, until the lower anchor is inspected/repaired by BMW.

BMW of North America announced an additional recall on July 12, 2016 affecting certain X3 and X4 models, manufactured between 2011 and 2016. Please see table below.

Nissan North America has announced a recall on its 2013-2016 Sentras. Please see table on following page.

| | | | | |
|---------------------------|-------------------|--------------------|----------------------|---|
| BMW of North America, LLC | 528i Sedan | 8/15/15 to 9/14/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | 528i xDrive Sedan | 7/20/15 to 9/11/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | 535i Sedan | 7/20/15 to 9/8/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | 535i xDrive Sedan | 7/20/15 to 9/9/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | 535d xDrive Sedan | 7/21/15 to 9/3/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | 550i Sedan | 7/20/15 to 9/3/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | 550i xDrive Sedan | 7/20/15 to 9/3/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | 535d Sedan | 7/20/15 to 9/8/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | M5 Sedan | 7/21/15 to 9/11/15 | See paragraph above. | Owners should contact BMW Customer Service at (800) 525-7417. |

| | | | | |
|----------------------------|---|---|--|---|
| BMW of North America, LLC | X3 xDrive28d | 2015-2017 model year, manufactured 3/10/14 to 3/31/16 | Lower anchors may be damaged if child restraint is installed using rigid lower connectors, increasing risk of injury to child. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | X3 sDrive28i, X3 xDrive28i, X3 xDrive35i | 2011-2017 model year, manufactured 7/2/10 to 4/14/16 | Lower anchors may be damaged if child restraint is installed using rigid lower connectors, increasing risk of injury to child. | Owners should contact BMW Customer Service at (800) 525-7417. |
| BMW of North America, LLC | X4 xDrive28i, X4 xDrive35i, X4 xDriveM40i | 2015-2017 model year, manufactured 3/3/14 to 4/15/16 | Lower anchors may be damaged if child restraint is installed using rigid lower connectors, increasing risk of injury to child. | Owners should contact BMW Customer Service at (800) 525-7417. |
| Nissan North America, Inc. | Sentra | 2013-2016 model year (approximately 620,000 vehicles) | Front passenger seat safety belt bracket may become deformed if child restraint is installed, which may cause air bag not to shut off. | As of 5/8/16, Nissan North America, Inc. has not found a solution for the problem. Do not install any child restraint in this seating position. |