

SSM 47575	<p>Some 2017-2018 Escape vehicles equipped with a 1.5L or 2.0L engine may exhibit fuse F34 open, an illuminated MIL with diagnostic trouble codes (DTCs) P0034, P023A, P0245, P0480, P0481, P0645, P06A0, P06DB, P188D, P02602, and/or P2681 in the powertrain control module (PCM). The vehicle may also exhibit an all-wheel drive (AWD) fault warning and/or traction control (TC) light on. Inspect the 12A690 (1.5L) or 12C508 (2.0L) wiring harness from the battery junction box (BJB) to the PCM for wiring harness retainers not installed correctly allowing chafing to occur at multiple points. Repair damaged wiring as required. Refer to the Wiring Diagram for repair information. For claiming, use causal part 12A690 (1.5L) or 12C508 (2.0L) and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) manual.</p>
--------------	--