Product Group:	Date Issued:	Service Bulletin No.	
Power Solutions	08/21/12	GSP20120817	
Bulletin Type		Models/Series Affected: DCA25USI2 S/N 8104240-8104314	
X Mandatory			
Information Only			
Recommended Change			

Details

Problem:

The generator base metal stopper plates were welded with too much clearance and may cause excessive movement of the generator during transportation.

Solution:

Install additional metal shim to reduce clearance.

Parts Information

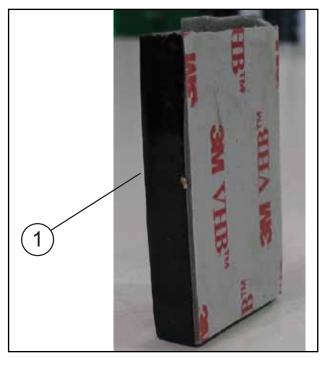


Figure 1. Metal Shim

Item No.	Part No.	Description	QTY.	Remarks
1	DCA25USI2SHIM	Metal Shim	2	

PROCEDURE

Left Metal Stopper Plate

- 1. Open the left door (when facing the front of the generator) of the DCA25USI2 generator.
- 2. Wipe off any dust from the welded stopper plate to ensure that the metal shim will stick when installed.
- 3. Peel off the adhesive backing from the metal shim (Part No. DCA25USI2SHIM). See Figure 2.



Figure 2. Peeling Off Adhesive Backing

4. Attach the metal shim to the left welded stopper plate (Figure 3).

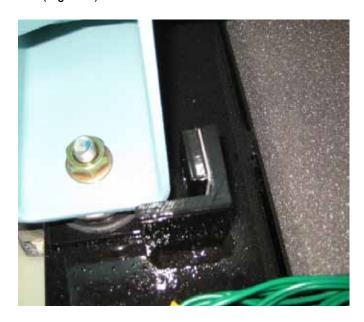


Figure 3. Attaching the Metal Shim

5. Using a screwdriver, press the shim towards welded stopper plate to make sure adhesive sticks completely. (Figure 4).



Figure 4. Checking Adhesive

Right Metal Stopper Plate

- 1. Open the front door covering the control panel to gain access to the top screws on the front panel.
- 2. Remove the front panel by removing the 6 screws and washers that secure it in place. Set the removed hardware aside (Figure 5).



Figure 5. Removing Front Panel

- 3. Repeat steps 2 to 5 of previous section to install metal shim to the right welded stopper plate.
- 4. Reinstall front panel with the six screws and washers.

Warranty Information			
Campaign Reference No. 20120817			
Please contact Chris Fairchild or Wendy Sanchez @ 1-800-421-1244 for warranty claim number and warranty form.			
Labor Allowance: Flat Rate to install – 0.5 Hours.			

Tel. (800) 421-1244

Fax (310) 537-3927

Fax: 310-537-4259

HERE'S HOW TO GET HELP

PLEASE HAVE THE MODEL AND SERIAL NUMBER ON-HAND WHEN CALLING

UNITED STATES

Multiquip Corporate Office

18910 Wilmington Ave. Carson, CA 90746

Contact: mg@multiquip.com

Service Department

800-421-1244 310-537-3700

Technical Assistance

800-478-1244

MEXICO

MQ Cipsa

Carr. Fed. Mexico-Puebla KM 126.5 Momoxpan, Cholula, Puebla 72760 Mexico

Contact: pmastretta@cipsa.com.mx

Fax: 310-943-2238

Tel: (52) 222-225-9900

Fax: (52) 222-285-0420

UNITED KINGDOM

MQ Parts Department

Warranty Department

800-427-1244

310-537-3700

800-421-1244

310-537-3700

Multiquip (UK) Limited Head Office

Unit 2, Northpoint Industrial Estate, Globe Lane.

Dukinfield, Cheshire SK16 4UJ Contact: sales@multiquip.co.uk

Tel: 0161 339 2223 Fax: 0161 339 3226

Fax: 800-672-7877

Fax: 310-637-3284

Fax: 310-943-2249

CANADA

Multiquip

4110 Industriel Boul. Tel: (450) 625-2244 Laval, Quebec, Canada H7L 6V3 Tel: (877) 963-4411 Fax: (450) 625-8664 Contact: jmartin@multiquip.com

© COPYRIGHT 2012. MULTIQUIP INC.

Multiquip Inc and the MQ logo are registered trademarks of Multiquip Inc. and may not be used, reproduced, or altered without written permission. All other trademarks are the property of their respective owners and used with permission.

The information and specifications included in this publication were in effect at the time of approval for printing. Illustrations, descriptions, references and technical data contained in this document are for guidance only and may not be considered as binding. Multiquip Inc. reserves the right to discontinue or change specifications, design or the information published in this publication at any time without notice and without incurring any obligations.

Your Local Dealer is:

