

TransPort[®] PT900

Portable Ultrasonic Flow Meter for Liquids

User's Manual



imagination at work

910-315 Rev. C

Transport[®] PT900

Portable Ultrasonic Flow Meter for Liquids

User's Manual

910-315 Rev. C
September 2019



www.gemeasurement.com

©2017 General Electric Company. All rights reserved.
Technical content subject to change without notice.

[no content intended for this page]

Typographical Conventions	vii
Safety Issues	viii
Auxiliary Equipment	ix
Product Registration	x
Services	x
Terms and Conditions	x
Regulatory Compliance	xi

Chapter 1. Introduction

1.1 Product Registration	1
1.2 System Description	1

Chapter 2. Installation

2.1 Introduction	3
2.2 Unpacking the PT900	4
2.3 Installing a Battery Pack in the Transmitter	6
2.4 Mounting the PT900 Transmitter	7
2.5 Installing the Clamp-On Fixture and Transducers	7
2.5.1 A Sample Installation	8
2.5.2 Transducer Spacing Calculation	9
2.5.3 Mounting the PT9 Clamp-On Fixture	9
2.5.4 Checking the Transducer Holders	16
2.5.5 Installing the Transducers	17
2.5.6 Even and Odd-Traverse Installations	21
2.6 Making the Electrical Connections	33
2.6.1 Connecting the Line Power	33
2.6.2 Connecting the Transducers	35
2.6.3 Connecting the Digital Output	36
2.6.4 Connecting the Analog Inputs and Output	37
2.6.5 Connecting the Energy Cables	37
2.6.6 Using the USB Port	38
2.6.7 Using the Bluetooth Wireless Interface	38
2.7 Caring for the PT900 Batteries	38
2.7.1 Charging and Storing the Batteries	39
2.7.2 Replacing the Batteries	40
2.7.3 Disposing of the Batteries	41
2.8 Powering On and Off	41

2.9	PT900 LED Indicators	42
2.9.1	Power LED	43
2.9.2	Bluetooth LED	43
2.9.3	Status LED	43
2.9.4	Battery LED	43

Chapter 3. Initial Setup

3.1	Introduction	45
3.2	Charging the PT900 Transmitter and Tablet	45
3.3	Installing or Updating the PT900 APP.....	45
3.3.1	Checking the APP Version.....	45
3.3.2	Installing or Updating the PT900 Android and iOS APP.....	46
3.3.3	Installing the Tablet APP from the SD Card (Applicable only to Android APP)47	
3.4	Pairing the Tablet and the Transmitter	49
3.4.1	Removing paired devices from PT900 APP	58
3.4.2	Removing paired devices from iPhone/Tablet.....	59
3.5	Using the APP Main Menu and the Slide Menu	61
3.5.1	The Main Menu	61
3.5.2	The Slide Menu (Applicable only to Android)	62

Chapter 4. Programming

4.1	Configuring the Units of Measurement	63
4.2	Configuring a Channel.....	65
4.3	Programming the PIPE Menu	67
4.3.1	Pipe Materials	68
4.3.2	Pipe Dimensions.....	68
4.3.3	Pipe Lining	69
4.4	Programming the FLUID Menu.....	70
4.5	Programming the TRANSDUCERS Menu	73
4.5.1	Programming the Transducer Parameters	74
4.5.2	Setting the Reynolds Correction Factor	76
4.5.3	Programming the Meter Factor.....	76
4.6	Programming the PLACEMENT Menu.....	78
4.6.1	Viewing the Traverse Configuration	78
4.6.2	Viewing the Transducer Spacing	79
4.7	Configuring the Program Options	83

4.7.1	Programming the ENERGY Tab	85
4.7.2	Programming the INPUTS Tab	87
4.7.3	Programming the OUTPUTS Tab	88
4.7.4	Programming the USER FUNCTIONS Tab	93

Chapter 5. Measurements

5.1	Introduction	97
5.2	Setting Up the Measurements for Display	98
5.3	Viewing Measurements	100
5.3.1	Displaying Multiple Measurements	101
5.3.2	Displaying a Single Measurement	102
5.3.3	Displaying the Totalizer Screen	105
5.3.4	Displaying the Diagnostics Parameters	106

Chapter 6. Logging Data

6.1	Introduction	107
6.2	Adding a Log	108
6.3	Deleting, Stopping or Editing a Log	110
6.3.1	Deleting a Log	111
6.3.2	Editing a Log	112
6.3.3	Viewing a Log	113

Chapter 7. Configuring the Transmitter

7.1	Introduction	115
7.2	Updating the PT900 Transmitter Software	118
7.3	Programming the Transmitter SERVICE Menu	121
7.3.1	Programming the CALIBRATION Menu	121
7.3.2	Programming the METER SETUP Menu	124
7.3.3	Programming the TESTING Menu	127
7.3.4	Programming the ERROR LIMITS Menu	130

Chapter 8. Error Codes and Troubleshooting

8.1	Error Codes	133
8.1.1	Error Header	133
8.1.2	Flow Errors	133
8.2	Diagnostics	135
8.2.1	Introduction	135
8.2.2	Fluid and Pipe Problems	135

8.3	Diagnostic Parameters	138
8.4	Getting Help	139
8.4.1	The About Screen	140
8.4.2	The Diagnostics Screen	141
8.4.3	The Service Screen	142
8.4.4	The Spare Parts Screen	143
8.5	Help Topics List	144
8.6	The Quick-Start Guide	146

Chapter 9. Communication

9.1	Modbus Communication	147
9.2	Modbus Register Map	147
9.3	Bluetooth Communication	156

Appendix A. Specifications

A.1	Operation and Performance	157
A.2	PT900 Flow Transmitter	158
A.3	User Interface	159
A.4	Software Application (PT900 APP)	159
A.5	Clamp-On Transducers	160
A.6	Accessories	160
A.7	Options	161
A.8	Customer Cable Requirements for AIO/DIO Connections	161

Appendix B. Data Records

B.1	Service Record	163
B.2	Initial Settings	164
B.3	Initial Diagnostic Parameters	165

Typographical Conventions

Note: *“Note” paragraphs provide additional information about the topic which is helpful but is not essential to proper completion of the task.*

Important: *“Important” paragraphs provide emphasis to instructions that are essential to proper setup of the equipment. Failure to follow these instructions carefully may cause unreliable performance.*



CAUTION! *“Caution” paragraphs indicate a potentially hazardous situation which can result in minor or moderate injury to personnel or damage to the equipment.*



WARNING! *“Warning” paragraphs indicate a potentially hazardous situation which can result in serious personal injury or death.*

Paragaphes d'informations

Remarque: *Ces paragraphes fournissent des informations à même de faciliter la compréhension de la situation, mais n'est pas indispensable à la bonne utilisation des instructions.*

Important: *Ces paragraphes fournissent des informations qui mettent l'accent sur les instructions qui sont essentielles à une configuration correcte de l'équipement. Le non-respect de ces instructions peut entraîner une dégradation des performances.*



MISE EN GARDE ! Ce symbole indique un risque potentiel mineur de blessure aux personnes et / ou de sérieux dommages à l'équipement, à moins que ces instructions soient rigoureusement suivies.



AVERTISSEMENT ! Ce symbole indique un risque potentiel grave de blessures aux personnes, à moins que ces instructions soient rigoureusement suivies.

Safety Issues



WARNING! It is the responsibility of the user to make sure all local, county, state and national codes, regulations, rules and laws related to safety and safe operating conditions are met for each installation.



WARNING! If the clamp-on fixture and transducers are installed on a pipeline above a work area or walkway, safe work site practices for protection from falling objects must be followed.



WARNING! It is the responsibility of the user to make sure the PWR, Hart, Modbus and IO cables meet the cable specifications listed in *Appendix A*.

Questions de sécurité



AVERTISSEMENT ! Il est de la responsabilité de l'utilisateur de s'assurer que tous les règlements, codes et lois locaux, nationaux et européens relatifs à la sécurité et aux conditions d'exploitation en toute sécurité soient respectés pour chaque installation. La sécurité de tout système intégrant l'équipement est de la responsabilité de celui qui l'assemble.



AVERTISSEMENT ! If the clamp-on fixture and transducers are installed on a pipeline above a work area or walkway, safe work site practices for protection from falling objects must be followed.



AVERTISSEMENT ! Il est de la responsabilité de l'utilisateur de s'assurer que les câbles d'alimentation, Hart, Modbus et Entrées / Sorties répondent à la spécification décrite à l'annexe A.

Auxiliary Equipment

Local Safety Standards

The user must make sure that he operates all auxiliary equipment in accordance with local codes, standards, regulations, or laws applicable to safety.

Working Area



WARNING! Auxiliary equipment may have both manual and automatic modes of operation. As equipment can move suddenly and without warning, do not enter the work cell of this equipment during automatic operation, and do not enter the work envelope of this equipment during manual operation. If you do, serious injury can result.



WARNING! Make sure that power to the auxiliary equipment is turned OFF and locked out before you perform maintenance procedures on the equipment.

Matériel auxiliaire

Standards de sécurité locaux

L'utilisateur doit s'assurer que les équipements auxiliaires utilisés sont en tout point conforme aux codes, standards et réglementations relatifs à la sécurité.

Zone de travail



AVERTISSEMENT ! Les équipements auxiliaires peuvent avoir à la fois des modes de fonctionnement manuel et automatique. Comme l'équipement peut bouger brusquement et sans signe préalable, ne pas entrer dans la zone de travail de ce dernier pendant le fonctionnement automatique, et ne pas s'en approcher de trop près pendant le fonctionnement manuel. Si vous le faites, cela peut entraîner de graves blessures.



AVERTISSEMENT ! Assurez-vous que l'alimentation de l'équipement auxiliaire est éteinte et verrouillée avant d'effectuer toute opération de maintenance ou d'entretien de l'équipement.

Qualification of Personnel

Make sure that all personnel have manufacturer-approved training applicable to the auxiliary equipment.

Personal Safety Equipment

Make sure that operators and maintenance personnel have all the safety equipment applicable to the auxiliary equipment. Examples include safety glasses, protective headgear, safety shoes, etc.

Unauthorized Operation

Make sure that unauthorized personnel cannot gain access to the operation of the equipment.

Product Registration

Thank you for purchasing a model *TransPort*® PT900 from GE. Please register your product at www.gemeasurement.com/productregistration for product support such as the latest software/firmware upgrades, product information and special promotions.

Services

GE provides customers with an experienced staff of customer support personnel ready to respond to technical inquiries, as well as other remote and on-site support needs. To complement our broad portfolio of industry-leading solutions, we offer several types of flexible and scalable support services including: Training, Product Repairs, Service Agreements and more. Please visit www.gemeasurement.com/services for more details.

Terms and Conditions

GE's sales *Terms and Conditions* for your recent purchase of a GE product, including the applicable product Warranty, can be found on our website at the following link: www.gemeasurement.com/sales-terms-and-conditions

Regulatory Compliance

Waste Electrical and Electronic Equipment (WEEE) Directive

GE is an active participant in Europe's *Waste Electrical and Electronic Equipment* (WEEE) take-back initiative (Directive 2012/19/EU).



The equipment that you bought has required the extraction and use of natural resources for its production. It may contain hazardous substances that could impact health and the environment.

In order to avoid the dissemination of those substances in our environment and to diminish the pressure on the natural resources, we encourage you to use the appropriate take-back systems. Those systems will reuse or recycle most of the materials of your end life equipment in a sound way. The crossed-out wheeled bin symbol invites you to use those systems.

If you need more information on the collection, reuse and recycling systems, please contact your local or regional waste administration. Visit <http://www.gemeasurement.com/environmental-health-safety-ehs> for take-back instructions and more information about this initiative.

RoHS

The *TransPort*® PT900 fully complies with RoHS regulations (Directive 2011/65/EU).

FCC Rules/Industry Canada License



CAUTION! This device complies with Part 15 of the FCC Rules / Industry Canada licence-exempt RSS standard(s). Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.



MISE EN GARDE ! Le présent appareil est conforme aux CNR d'Industrie Canada applicables aux appareils radio exempts de licence. L'exploitation est autorisée aux deux conditions suivantes : (1) l'appareil ne doit pas produire de brouillage, et (2) l'utilisateur de l'appareil doit accepter tout brouillage radioélectrique subi, même si le brouillage est susceptible d'en compromettre le fonctionnement.

Changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

FCC Rules/Industry Canada License (cont.)

Under Industry Canada regulations, this radio transmitter may only operate using an antenna of a type and maximum (or lesser) gain approved for the transmitter by Industry Canada. To reduce potential radio interference to other users, the antenna type and its gain should be so chosen that the equivalent isotropically radiated power (e.i.r.p.) is not more than that necessary for successful communication.

Conformément à la réglementation d'Industrie Canada, le présent émetteur radio peut fonctionner avec une antenne d'un type et d'un gain maximal (ou inférieur) approuvé pour l'émetteur par Industrie Canada. Dans le but de réduire les risques de brouillage radioélectrique à l'intention des autres utilisateurs, il faut choisir le type d'antenne et son gain de sorte que la puissance isotrope rayonnée équivalente (p.i.r.e.) ne dépasse pas l'intensité nécessaire à l'établissement d'une communication satisfaisante.

This device complies with Industry Canada's licence-exempt RSSs. Operation is subject to the following two conditions:

1. This device may not cause interference; and
2. This device must accept any interference, including interference that may cause undesired operation of the device.

MPE Reminding

To satisfy FCC/IC RF exposure requirements, a separation distance of 20 cm or more should be maintained between the antenna of this device and persons during device operation. To ensure compliance, operations at closer than this distance is not recommended.

Les antennes installées doivent être situées de façon à ce que la population ne puisse y être exposée à une distance de moins de 20 cm. Installer les antennes de façon à ce que le personnel ne puisse approcher à 20 cm ou moins de la position centrale de l'antenne. La FCC des États-Unis stipule que cet appareil doit être en tout temps éloigné d'au moins 20 cm des personnes pendant son fonctionnement.

Taiwan Warning Letter

低功率電波輻射性電機管理辦法

第十二條 經型式認證合格之低功率射頻電機，非經許可，公司、商號或使用者均不得擅自變更頻率、加大功率或變更原設計之特性及功能。

第十四條 低功率射頻電機之使用不得影響飛航安全及干擾合法通信；經發現有干擾現象時，應立即停用，並改善至無干擾時方得繼續使用。

Korean KCC Warning

1. EMC (B Type) Warning

기종별	사용자안내문
B 급 기기 (가정용 정보통신기기)	이 기기는 가정용 (B 급) 전자파적합기기 로서 주로 가정에서 사용하는 것을 목적으로 하며, 모든 지역에서 사용할 수 있습니다.

2. RF Warning

당해 무선설비는 전파혼신 가능성이 있으므로 인명안전과
관련된 서비스는 할 수 없음

Chapter 1. Introduction

1.1 Product Registration

Thank you for purchasing a TransPort® PT900 from GE. Please register your product at www.gemeasurement.com/productregistration for product support such as the latest software/firmware upgrades, product information and special promotions.

1.2 System Description

The PT900 is a portable flow transmitter for the measurement of liquid products. It utilizes a new electronics platform and a simplified industrial design to make it extremely easy to install and use. The system includes: a transmitter, a pair of transducers, a new clamp-on fixture and a transducer cable (see *Figure 1* below).

Optional accessories for the PT900 include: a tablet with the Android® or iOS operating system (see *Figure 1* below), a thickness gauge, clamp-on temperature transmitters and a clamp-on mounting fixture for pipes up to 48" in diameter. The PT900 communicates with its remote *display tablet* via Bluetooth®.



Figure 1: A PT900 Mounted on a Pipe and a Tablet (sold separately)

[no content intended for this page]

Chapter 2. Installation

2.1 Introduction

To ensure safe and reliable operation of the PT900, the system must be installed in accordance with established GE guidelines. Those guidelines are explained in detail in this chapter and include the following topics:

- Unpacking the PT900 (see page 4)
- Mounting the PT900 Transmitter (see page 7)
- Installing the Clamp-On Fixture and Transducers (see page 7)
- Making the Electrical Connections (see page 33)



WARNING! The PT900 flow transmitter can measure the flow rate of many fluids, some of which are potentially hazardous. The importance of proper safety practices cannot be overemphasized.



WARNING! Be sure to follow all applicable local safety codes and regulations for installing electrical equipment and working with hazardous fluids or flow conditions. Consult company safety personnel or local safety authorities to verify the safety of any procedure or practice.



ATTENTION EUROPEAN CUSTOMERS! To meet CE Mark and UL Mark requirements, all cables must meet the specifications in *“Customer Cable Requirements for AIO/DIO Connections” on page 161.*

2.2 Unpacking the PT900

Before removing the PT900 from its carrying case (see the optional hard shell carrying case in *Figure 2 on page 5*), inspect the contents of the case carefully. Before discarding any of the packing materials, account for all components and documentation listed on the packing slip. If anything is missing or damaged, contact *GE Customer Care* immediately for assistance.

Because the PT900 may be ordered in many different configurations, the following packing list is shown only as a typical example:

- | | |
|----------------------|-----------------------------------|
| 1. Transducers (2) | 7. Case |
| 2. Clamping Fixture | 8. PT900 Power Supply |
| 3. Transducer Cables | 9. OD Tape |
| 4. Transmitter | 10. Couplant |
| 5. Tablet Power Cord | 11. PT900 Mounting Strap w/Magnet |
| 6. SD Card | |

In addition to the standard components, the following optional components are available for use with the PT900:

- 12. Tablet with protective case
- 13. Energy kit with an RTD module and an RTD cable for connection to the PT900 transmitter
- 14. AIO cable with cabling box
 - DIO cable with cabling box
 - Battery charger
 - Transducer extension cable up to 100 ft long
 - 48" chain for the clamp-on fixture

2.2 Unpacking the PT900 (cont.)

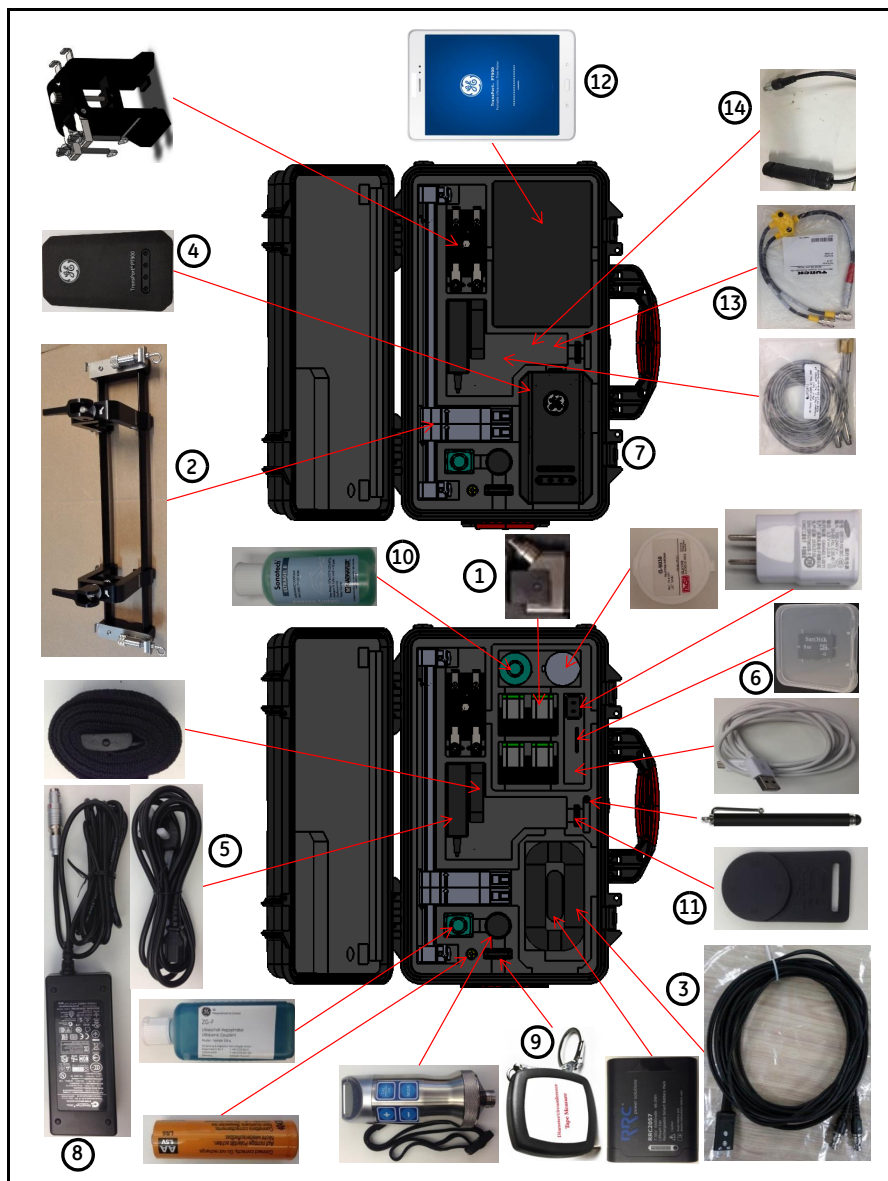


Figure 2: PT900 in Hard Carrier Case

2.3 Installing a Battery Pack in the Transmitter

To install a new battery pack in the transmitter (see *Figure 3* below):

1. Using a slotted screwdriver, rotate the two quick-screws on the battery cover 90° to open the transmitter.
2. Remove the existing battery pack.
3. Install the new battery pack in the battery compartment and replace the battery cover. Secure the cover by tightening the two quick-screws.

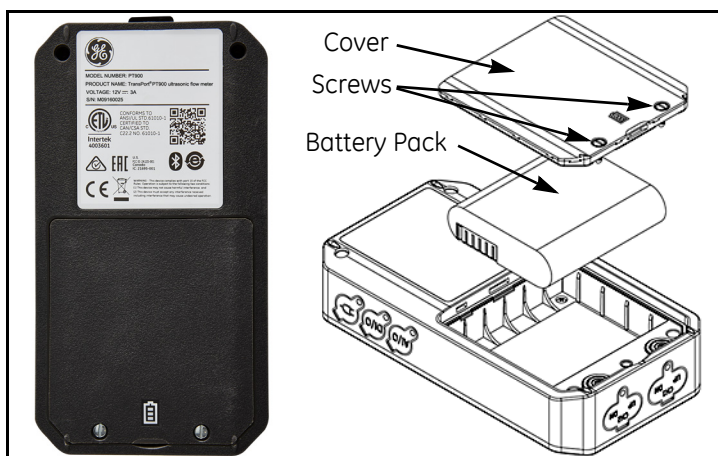


Figure 3: Installing the Battery Pack in the Transmitter

2.4 Mounting the PT900 Transmitter

The PT900 portable transmitter is housed in a durable rubberized enclosure suitable for indoor or outdoor use. It can be placed in the hard carrier case or mounted on the pipe with the either the soft strap or the magnetic clamp (see *Figure 4* below).

Note: *The pipe temperature must be between -20°C and about +40°C to safely use the soft strap or magnetic clamp for mounting the transmitter.*

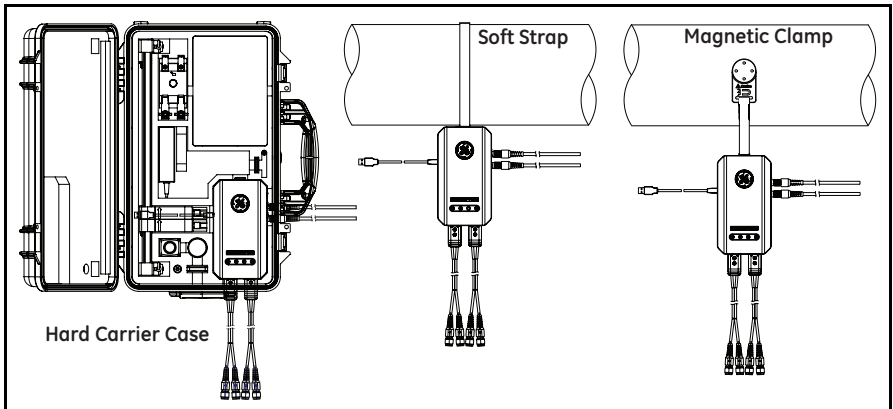


Figure 4: PT900 Transmitter Mounting Options

2.5 Installing the Clamp-On Fixture and Transducers

This section describes in detail how to mount the standard PT9 clamp-on transducer fixture on the pipe.

Note: *Consult GE for instructions on installing the optional CF-LP clamping fixture (shown in Figure 5 below).*

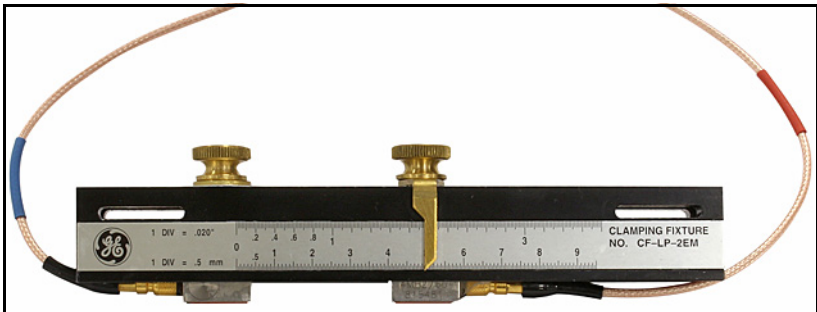


Figure 5: CF-LP Clamping Fixture

2.5.1 A Sample Installation

For reference, a typical completed PT900 installation is shown in *Figure 6* below.

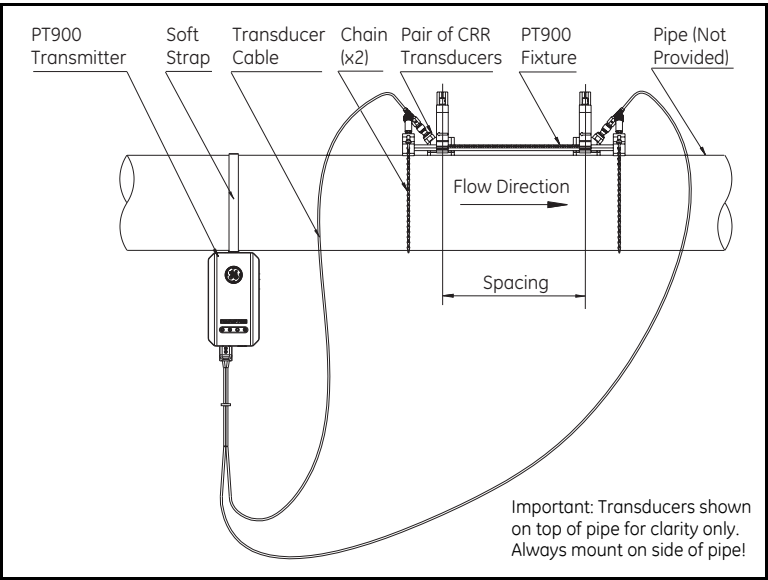


Figure 6: Typical PT900 Installation

2.5.2 Transducer Spacing Calculation



ATTENTION! The required transducer spacing is calculated by the APP after you program the PIPE, FLUID, TRANSDUCER and PLACEMENT menus. Before proceeding with this installation, you must complete the programming starting in *Chapter 4. Programming on page 63* up to “*Viewing the Transducer Spacing*” on *page 79*. Use that calculated transducer spacing in the following sections.

2.5.3 Mounting the PT9 Clamp-On Fixture

To mount the PT9 clamp-on fixture (see *Figure 7* below) on the pipe, complete the following steps:

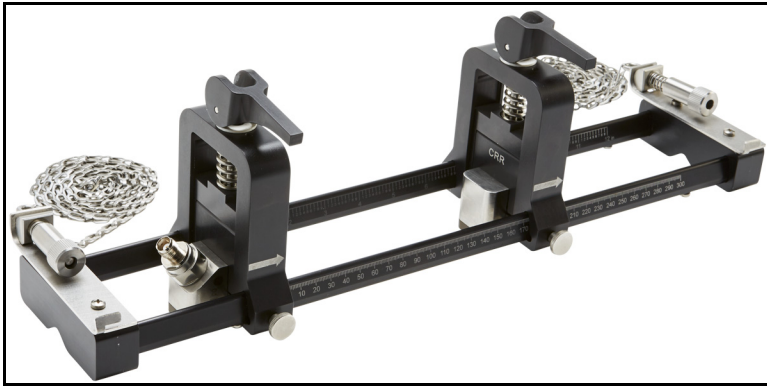


Figure 7: PT9 Clamp-On Fixture with CRR Transducers

1. Before mounting the clamp-on fixture, refer to *Figure 8 on page 10* and proceed as follows:
 - Ensure that the chain mechanism screws (**A**) that are attached to the end piece flats are fully loosened.
 - Ensure that the last link on the chain is secured within the chain mechanism screw slot (**B**) on both sides of the end piece.
 - Ensure that the thumb screw (**C**) is tightened on the movable clamp so that no motion is allowed during the mounting process.

2.5.3 Mounting the Clamp-On Fixture (cont.)

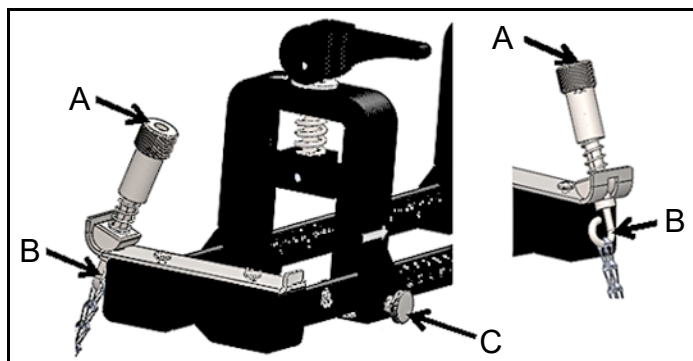


Figure 8: Bracket Preliminary Setup

2. Select a clamp-on fixture mounting location on the pipeline which meets the following requirements (see *Figure 9* below):
 - A straight pipe run of at least 10 nominal pipe diameters (with no fittings or bends) before the upstream transducer
 - A straight pipe run of at least 5 nominal pipe diameters (with no fittings or bends) after the downstream transducer
 - A clearance of at least 6" (150 mm) from the outer edge of each end piece to the nearest joint, welding or flange in the pipeline

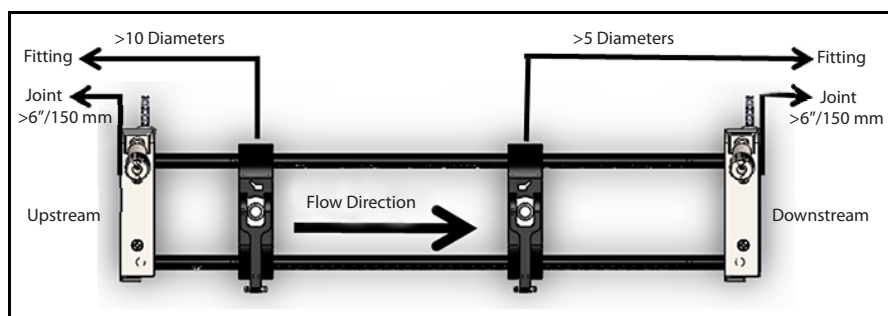


Figure 9: Selecting the Pipe Location

2.5.3 Mounting the Clamp-On Fixture (cont.)

3. Adjust the clamp-on fixture position so that the outer edge of the closest end piece is located at the chosen distance from the nearest inlet, outlet, joint or fitting in the pipeline (see *Figure 10* below).

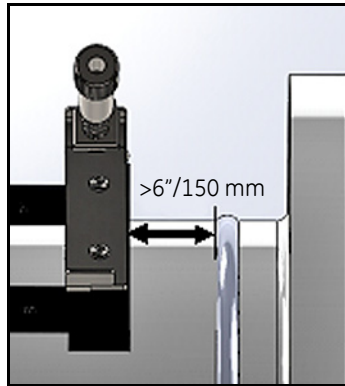


Figure 10: Adjusting the Fixture Position

4. Place the clamp-on fixture on top of the pipe so that minimal effort is required to maintain its position during installation (see *Figure 11* below).

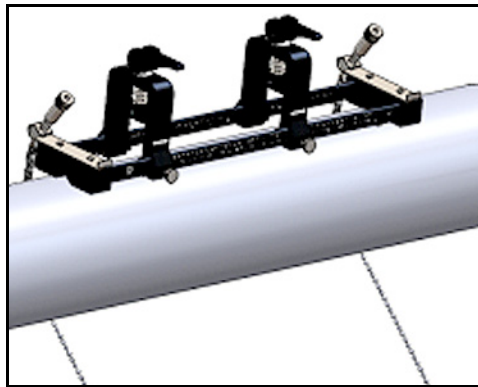


Figure 11: Fixture Placed on Top of Pipe

2.5.3 Mounting the Clamp-On Fixture (cont.)

5. Verify that the pipe rests in the small cutout slot on the bottom of the end pieces (see *Figure 12* below). Also, be sure that the scale markings on the rail rod of the clamp-on fixture can be easily read after the installation has been completed.



Figure 12: Cutout Slot

6. To install a chain around the pipe, refer to *Figure 13* on page 13 and complete the following steps:
 - a. Identify the *chain screw mechanism*, the *end flat* and the *chain slot* on the clamping fixture end piece closest to the reference pipe fitting.
 - b. Unscrew the chain screw mechanism, then wrap the metal chain all the way around the pipe.
 - c. Push down on the top of the chain screw mechanism and hold it down. Then, pull the chain so that it is snug around the pipe and slide the chain into the small slot located at the opposite side of the end piece from the chain screw mechanism.
 - d. Release the chain screw mechanism and tighten it just enough to remove any slack in the chain.

2.5.3 Mounting the Clamp-On Fixture (cont.)

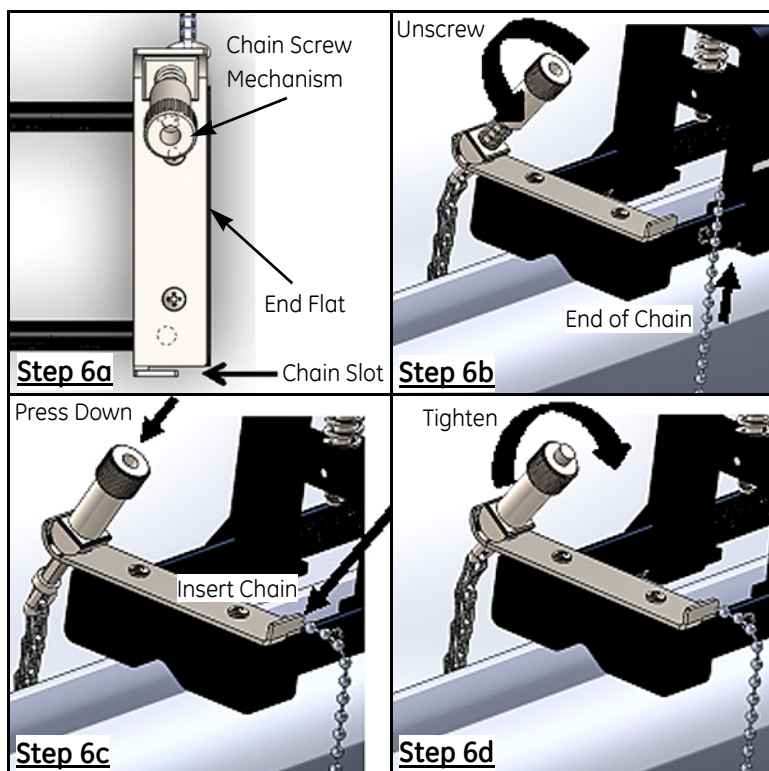


Figure 13: Installing a Chain

2.5.3 Mounting the Clamp-On Fixture (cont.)

7. Repeat the previous steps to install the chain at the opposite end of the clamp-on fixture (see *Figure 14* below). The clamp-on fixture should be firmly mounted to the pipe, but it should still be loose enough to allow final alignment.

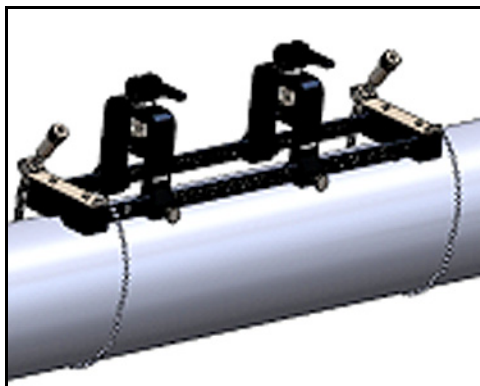


Figure 14: Fixture With Chains Installed

8. Rotate the fixture to the 3 o'clock or 9 o'clock position on the pipe (see *Figure 15* below). Installation on the top or bottom of the pipe is not recommended. Make sure the pipe still rests in the cutout slot on the bottom of both end pieces, to ensure that the fixture is parallel to the pipe centerline.



Figure 15: Fixture Rotated to Horizontal Position

2.5.3 Mounting the Clamp-On Fixture (cont.)

9. After final alignment is complete, fully tighten both chains by turning the nut on top of both chain screw mechanisms (see *Figure 16* below) until the chain is tight enough to resist any fixture movement.

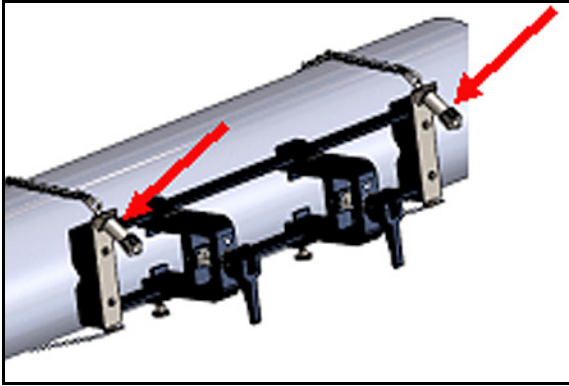


Figure 16: Secure the Fixture to the Pipe

Note: *As the last two steps affect each other, repeat them until the fixture is both properly aligned and securely fastened to the pipe.*

2.5.4 Checking the Transducer Holders

Before installing the transducers into the clamp-on fixture, a transducer holder must be attached to each transducer. A transducer holder is installed on each transducer by GE prior to shipment. Verify that your transducers have their holders already installed and that they are secure. If so, you may skip this section.

A complete transducer assembly includes the following components:

- **Clamp Holder:** Permanently attached to the fixture clamp
- **Transducer Holder:** Semi-permanently attached to the transducer
- **Transducer:** Prior to mounting, the *transducer* is installed into the *transducer holder* and secured with set screws. During mounting, the transducer holder slides into the *clamp holder* and attaches with a plunger

If for some reason a transducer's holder was not installed or has been removed, refer to *Figure 17* below and reinstall the holder as follows:

1. Slide the holder onto the top of the transducer so that the circle slots near the top of the transducer sides are closely aligned with the filled holes on the side of the transducer holder.
2. Screw the hex socket set screws from the transducer holder into the holes of the transducer. These screws will lock the holder into place.

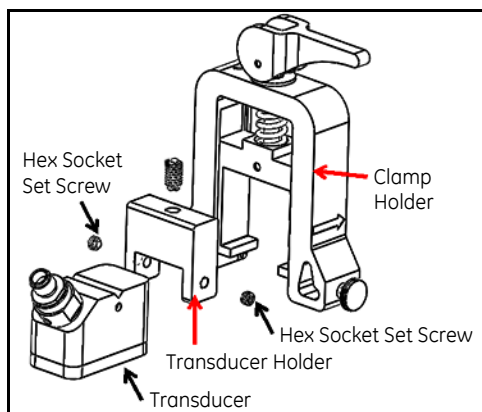


Figure 17: Transducer Assembly

2.5.5 Installing the Transducers

To install the transducers into the mounting bracket, complete the following steps:

1. If necessary, loosen the thumb screw on the movable transducer clamp to permit axial positioning.
2. Note that the fixed transducer clamp is set at the zero mark on the scale. Position the movable transducer clamp so that it aligns with the mark on the bracket's graduated scale that matches the calculated transducer spacing. Measurement markings should be read on the side of the transducer clamp indicated by the arrows. Typically, set the holder on the left to the zero position and the other holder to the desired spacing.

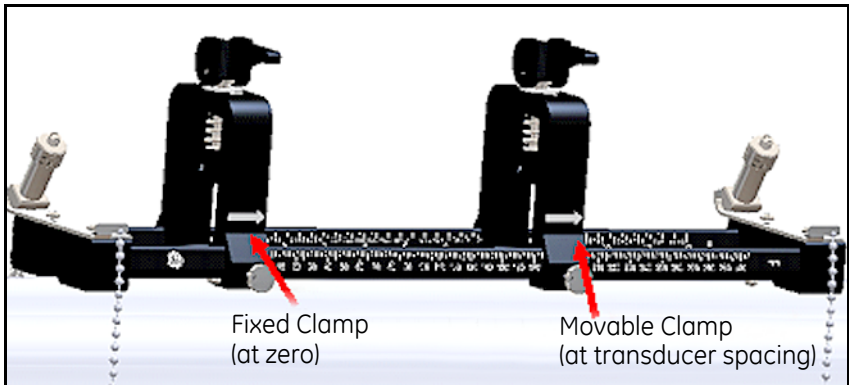


Figure 18: Secure the Fixture to the Pipe

Note: *The required spacing between the transducers varies based on many factors. The tablet APP automatically calculates your transducer spacing. (see “Viewing the Transducer Spacing” on page 79).*

3. Tighten the thumb screw to lock the movable transducer clamp into place, being cautious not to disturb the established axial positioning.

2.5.5 Installing the Transducers (cont.)

4. Move both cams to the loaded position, so that the clamp holders rest in their furthest radial position from the pipe (see *Figure 19* below).

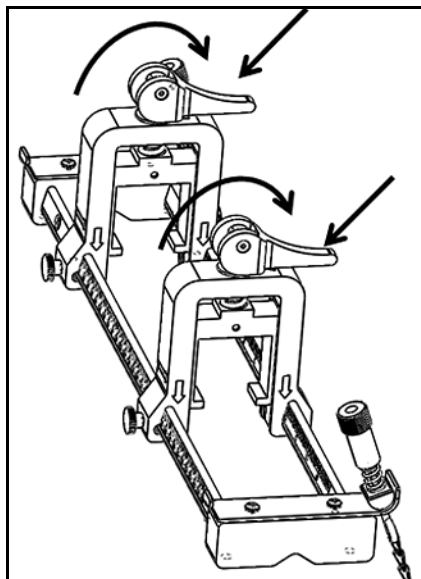


Figure 19: Loaded Cams

5. Apply the supplied couplant to both transducer faces (see *Figure 20* below). The couplant displaces any air gaps between the transducer and the pipe to ensure a uniform acoustic signal path. For pipes up to 14" OD, do not apply couplant in the red areas shown; for pipes >14" OD, cover the entire surface with couplant.

Note: *Using a water-based lubricant as a couplant is not recommended for heated or long-term installations.*

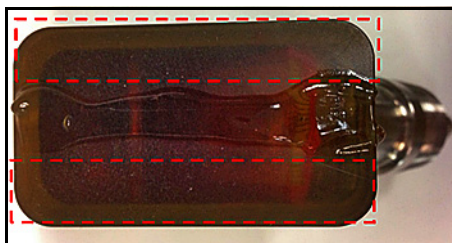


Figure 20: Transducer Face with Couplant

2.5.5 Installing the Transducers (cont.)

6. Slide a transducer, which is already locked into its transducer holder, into one of the clamp-on fixture's clamp holders until the plunger from the top of the transducer holder snaps into its position on the bottom of the clamp holder (see *Figure 21* below).

Important: *The cable connectors on the mounted transducers must point away from each other and toward opposite ends of the clamp-on fixture. To assist in this requirement, the arrows on the end pieces help to indicate the cable connector direction.*

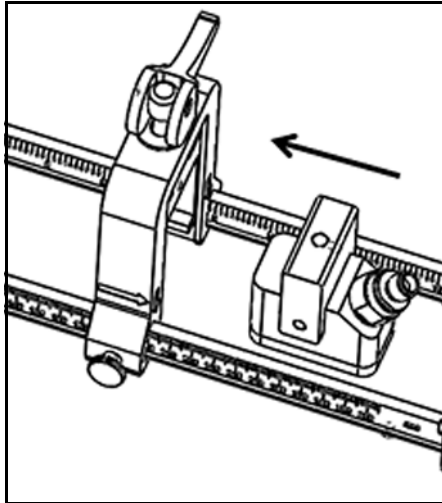


Figure 21: Inserting the Transducer

2.5.5 Installing the Transducers (cont.)

7. Release the cams on both transducer clamps so that the transducers are pushed towards the pipe to ensure that the couplant completely fills the gaps between the transducer faces and the pipe surface (see *Figure 22* below).



CAUTION! When releasing the cams, the cam springs may cause the cam to make hard contact with the clamp face. Any objects or body parts between the contact faces could suffer damage or minor injury.

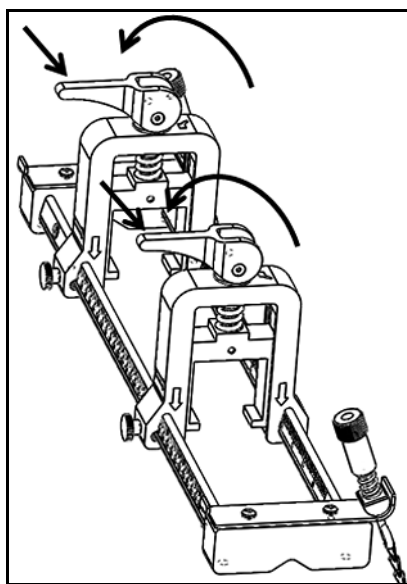


Figure 22: Released Cams

Important: *You must determine the required transducer spacing before proceeding (see “Viewing the Transducer Spacing” on page 79).*

2.5.6 Even and Odd-Traversal Installations

The transducers for a PT900 system may be installed in either of the following configurations:

- **Even-Traversal** - The signal from one of the transducers traverses the fluid flow an even number of times before being received by the other transducer (two traverses is recommended for most applications).
- **Odd-Traversal** - The signal from one of the transducers traverses the fluid flow once or an odd number of times before being received by the other transducer.

2.5.6a Even-Traversal Installations (Spacing <305 mm/12 in.)

The standard PT900 clamp-on fixture is designed for an *even-traversal* installation, as illustrated in *Figure 23* below. After mounting the clamp-on fixture on the pipe, refer to “*Viewing the Transducer Spacing*” on page 79 to adjust the spacing of the transducer clamps to the required axial distance.

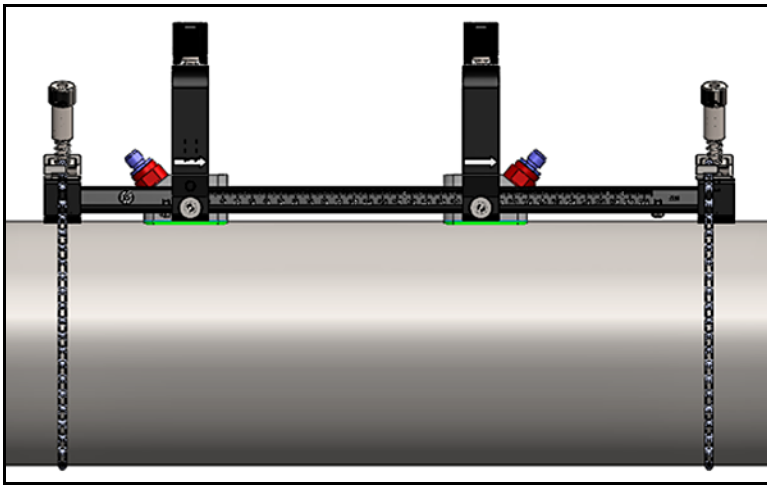


Figure 23: An Even-Traversal Installation (Top View)

Important: *The installation above assumes a transducer spacing of <305 mm/12 in. For even-traversal installations with transducer spacings >305 mm/12 in., see “Even-Traversal Installations (Spacing>305 mm/12 in.)” on page 28 for instructions.*

2.5.6b Odd-Traversal Installations

For an *odd-traverse* installation, the separate *yoke* included with the clamp-on fixture is required (see *Figure 24* below).

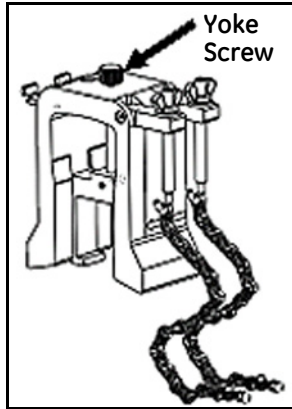


Figure 24: Yoke for Odd-Traversal Installations

Important: *The clamping fixture must be installed before the yoke (see “Mounting the PT9 Clamp-On Fixture” on page 9). You must determine the required transducer spacing before proceeding (see “Viewing the Transducer Spacing” on page 79).*

To install the yoke, complete the following steps:

1. Loosen the yoke screw at least 25 mm/1 in. (all the way for pipes <50 mm/2 in.) and loosen the J-Hooks all the way (see *Figure 25* below).

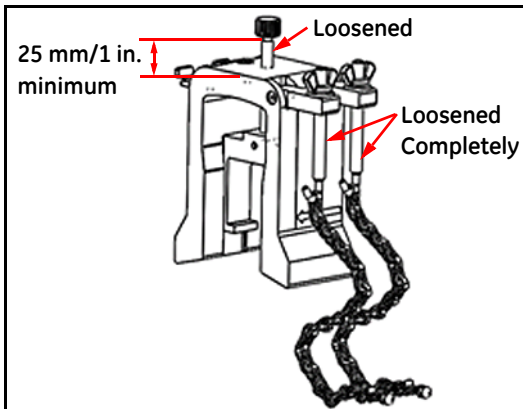


Figure 25: Loosened Yoke Screw and J-Hooks

2.5.6b Odd-Traverse Installations (cont.)

2. Place the yoke on the top of the pipe (see *Figure 26* below). If the required transducer spacing is $<305\text{ mm}/12\text{ in.}$, the yoke chain must be placed within the clamping fixture as shown.

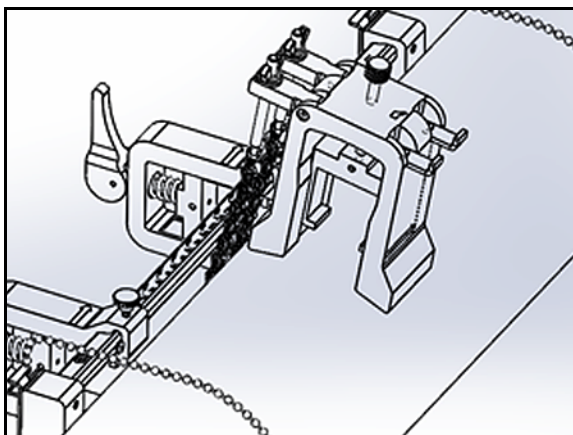


Figure 26: Yoke Placement On Top of Pipe

3. Wrap the yoke chains around the pipe and secure them to the yoke bracket, as shown in *Figure 27* below.

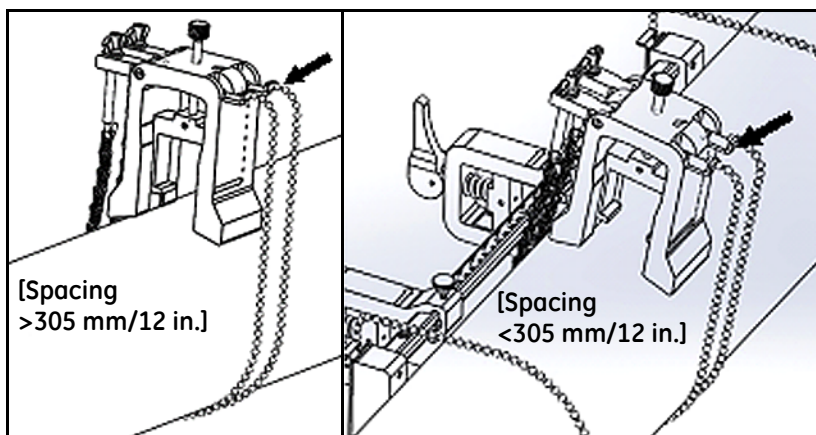


Figure 27: Yoke Chains Secured

2.5.6b Odd-Traversal Installations (cont.)

4. Rotate the yoke until it is located in a horizontal position on the opposite side of the pipe from the previously installed clamping fixture, as shown in *Figure 28* below.

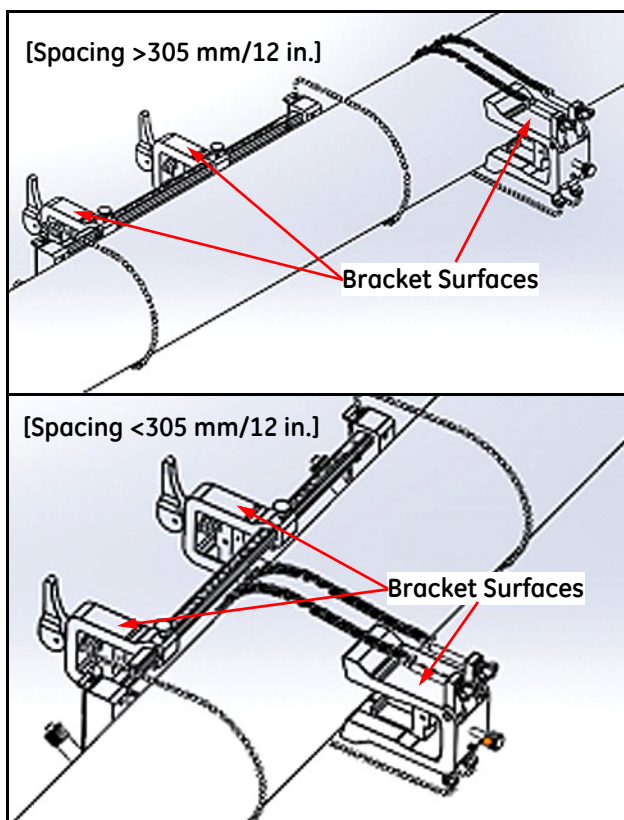


Figure 28: Yoke Rotated into Horizontal Position

5. Ensure that the top surfaces of the yoke bracket and the clamping fixture brackets lie precisely in the same horizontal plane (see *Figure 28* above). Place the fixed clamp in the clamping fixture at zero on the scale.

Note: *If the required axial spacing is 305-375 mm/12 in.-14.8 in., place the fixed clamp at 100/4 in. on the scale instead of zero.*

2.5.6b Odd-Traverse Installations (cont.)

6. Set the yoke axial position as follows:
 - **Spacing >305 mm/12 in.** (435 mm/17.13 in. is used as an example): Measure the required 435 mm/17.13 in. distance from the edge of the fixed clamp to the marked line on the yoke (see *Figure 29* below).

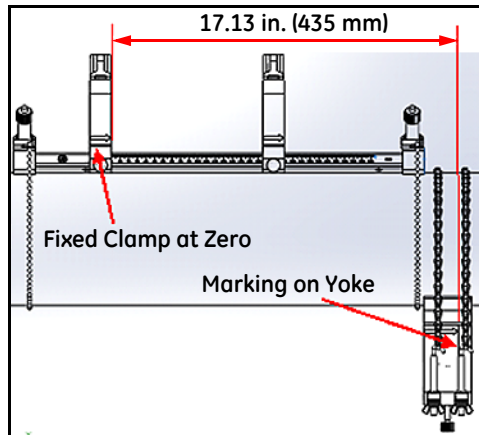


Figure 29: Yoke Set at 435 mm/17.13 in.

- **Spacing <305 mm** (120 mm/4.72 in. is used as an example): Measure the required 120 mm/4.72 in. distance from the edge of the fixed clamp to the marked line on the yoke (see *Figure 30* below).

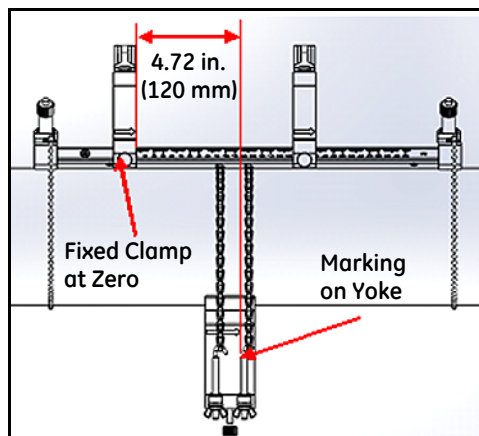


Figure 30: Yoke Set at 120 mm/4.72 in.

2.5.6b Odd-Traversal Installations (cont.)

7. Tighten the nuts to secure the yoke to the pipe (see *Figure 31* below).

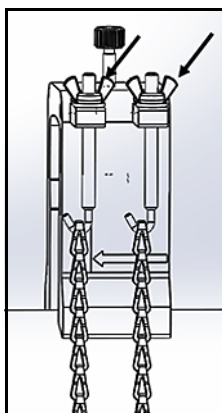


Figure 31: Secure the Yoke

8. Loosen the yoke screw. Then, apply couplant to the transducer face and insert the transducer into the yoke, as shown in *Figure 32* below.

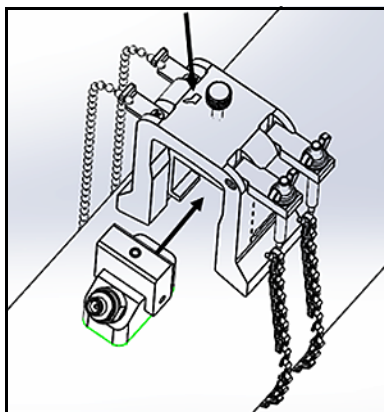


Figure 32: Insert Transducer into Yoke

2.5.6b Odd-Traversal Installations (cont.)

9. Tighten the yoke screw until the transducer firmly contacts the pipe. Your completed odd-traverse installation should look like *Figure 33* below.

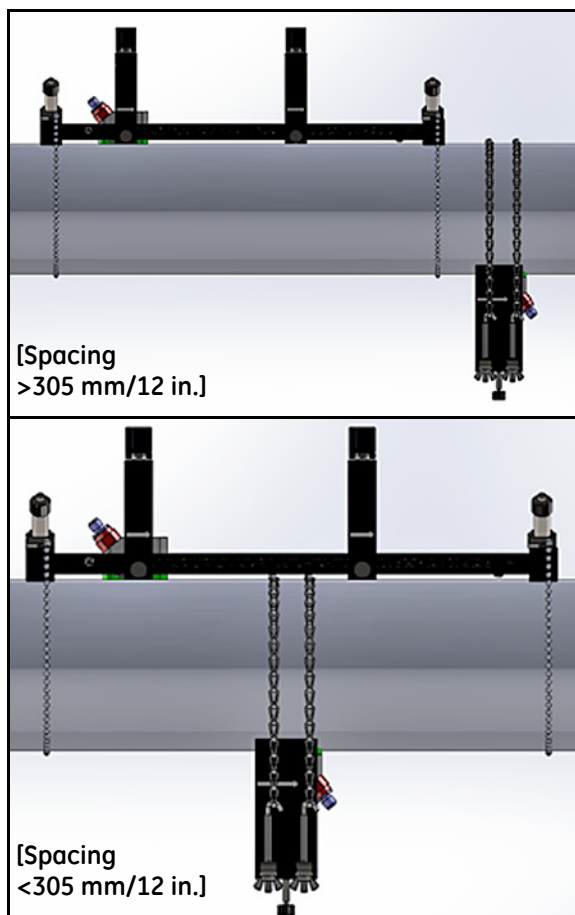


Figure 33: Completed Odd-Traverse Installation (Top View)

2.5.6c Even-Traversal Installations (Spacing > 305 mm/12 in.)

For an *even-traverse* installation with a transducer spacing > 305 mm/12 in., the separate *yoke* included with the clamp-on fixture is required (see *Figure 34* below).

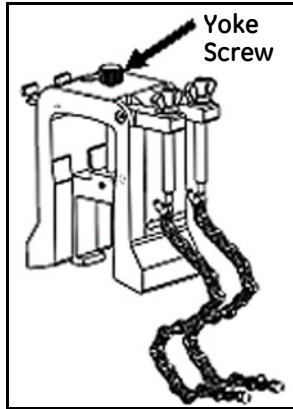


Figure 34: Yoke for Even-Traversal With $S > 305 \text{ mm}/12 \text{ in.}$

Important: *The clamping fixture must be installed before the yoke (see “Mounting the PT9 Clamp-On Fixture” on page 9). You must determine the required transducer spacing before proceeding (see “Viewing the Transducer Spacing” on page 79).*

To install the yoke, complete the following steps:

1. Loosen the yoke screw at least 25 mm/1 in. (all the way for pipes < 50 mm/2 in.) and loosen the J-Hooks all the way (see *Figure 25* below).

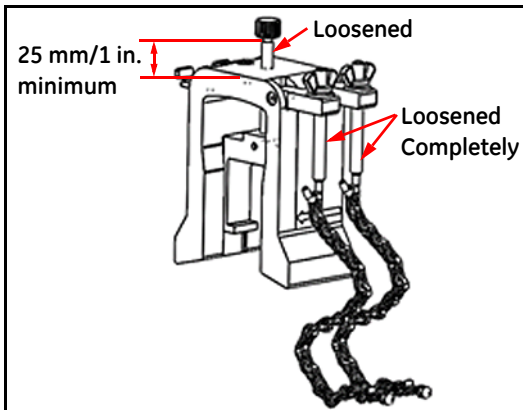


Figure 35: Loosened Yoke Screw and J-Hooks

2.5.6c Even-Traverse Installations (Spacing > 305 mm/12 in.) (cont.)

2. Place the yoke on the top of the pipe (see *Figure 36* below). If the required transducer spacing is <305 mm/12 in., the yoke chain must be placed within the clamping fixture as shown.

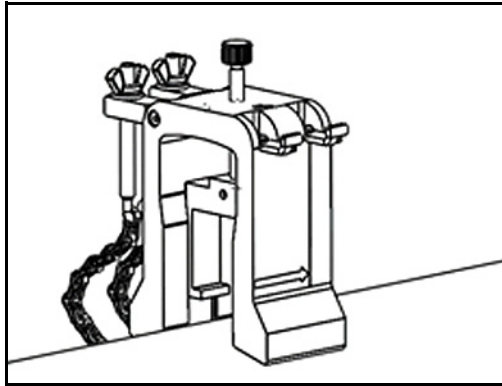


Figure 36: Yoke Placement On Top of Pipe

3. Wrap the yoke chains around the pipe and secure them to the yoke bracket, as shown in *Figure 37* below.

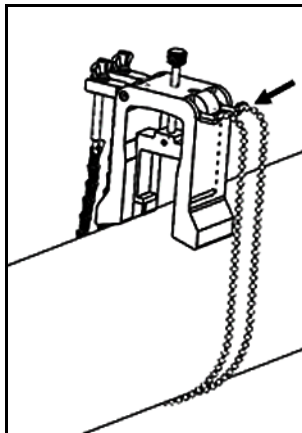


Figure 37: Yoke Chains Secured

2.5.6c Even-Traverse Installations (Spacing > 305 mm/12 in.) (cont.)

4. Rotate the yoke until it is located in a horizontal position on the same side of the pipe as the previously installed clamping fixture, as shown in *Figure 38* below.

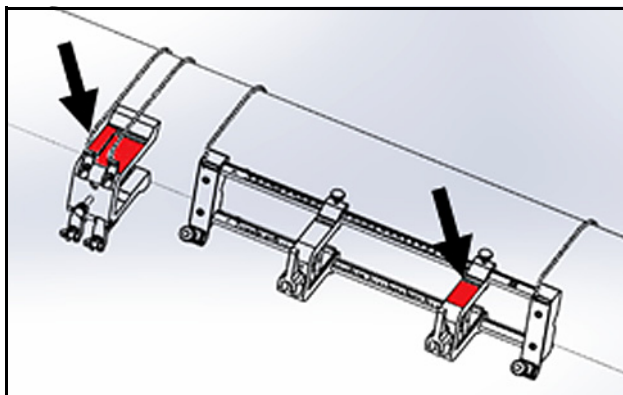


Figure 38: Yoke Rotated into Horizontal Position

5. Ensure that the top surfaces of the yoke bracket and the fixed clamping fixture bracket lie precisely in the same horizontal plane (see *Figure 38* above).

2.5.6c Even-Traversal Installations (Spacing > 305 mm/12 in.) (cont.)

6. Place the fixed clamp in the clamping fixture at zero on the scale. As an example, if the required transducer spacing is 435 mm/17.13 in., measure the required 435 mm/17.13 in. distance from the edge of the fixed clamp to the marked line on the yoke (see *Figure 39* below).

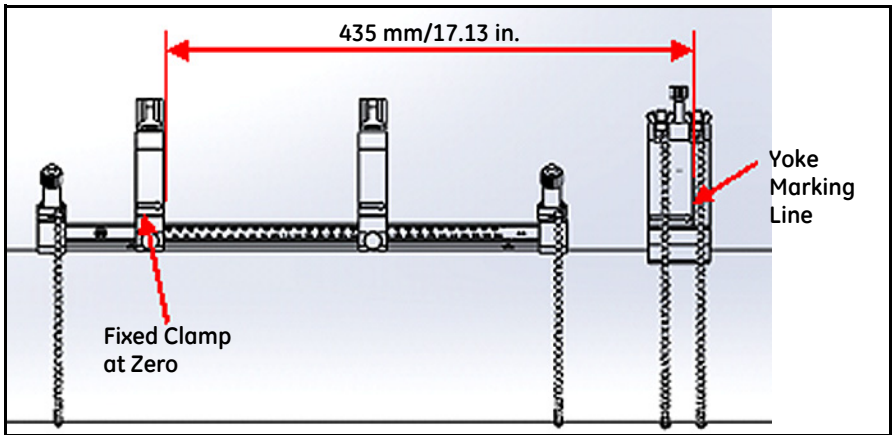


Figure 39: Yoke Set at 435 mm/17.13 in.

7. Tighten the nuts to secure the yoke to the pipe (see *Figure 40* below).

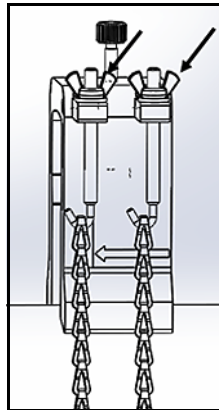


Figure 40: Secure the Yoke

2.5.6c Even-Traverse Installations (Spacing > 305 mm/12 in.) (cont.)

8. Loosen the yoke screw. Then, apply couplant to the transducer face and insert the transducer into the yoke, as shown in *Figure 41* below.

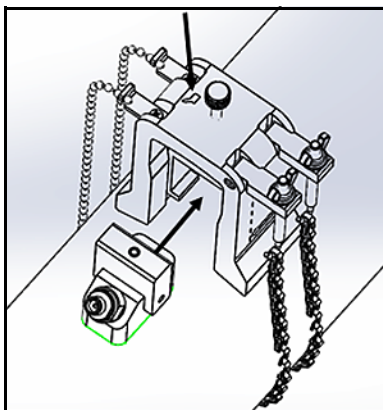


Figure 41: Insert Transducer into Yoke

9. Tighten the yoke screw until the transducer firmly contacts the pipe. Your completed odd-traverse installation should look like *Figure 42* below.

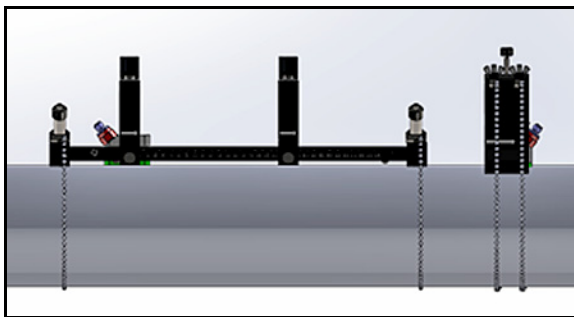


Figure 42: Completed Installation (Top View)

2.6 Making the Electrical Connections

Before taking measurements with the PT900, you must make all the necessary cable connections to the transmitter. To wire your transmitter, complete the following sections:

- Connecting the Line Power (see page 33)
- Connecting the Transducers (see page 35)
- Connecting the Digital Output (see page 36)
- Connecting the Analog Inputs and Output (see page 37)
- Using the USB Port (see page 38)
- Using the Bluetooth Wireless Interface (see page 38)

Note: *For basic operation, you only need to connect the Transducer cables. The I/O connections are required only if you intend to use those features.*

After the PT900 is completely wired, proceed to Chapter 3, *Initial Setup*, to configure the meter for operation.

2.6.1 Connecting the Line Power

An example of the PT900 transmitter product label is shown in *Figure 43* below. Be sure to power the transmitter only with the voltage specified on the label.

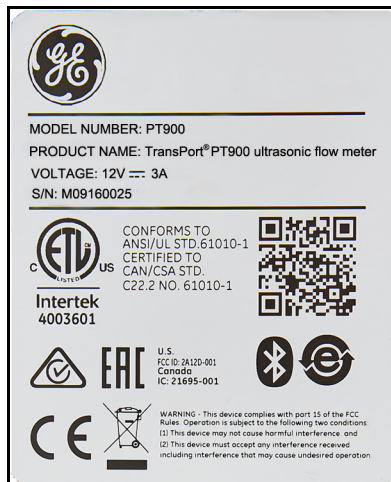


Figure 43: PT900 Transmitter Label

2.6.1 Connecting the Line Power (cont.)



WARNING! To ensure the safe operation, you must install and operate the PT900 as described in this manual. Also, be sure to follow all applicable safety codes and regulations for installing electrical equipment in your area. The PT900 and its transducers are designed for use only in general-purpose locations.

The PT900 is powered by either a 100-240 VAC wall mount plug-in module or by a Lithium Ion high-energy rechargeable smart battery pack. In either case, you must connect the power cord to the Power connector (see *Figure 44* below).

In normal operation mode, the PT900 can be operated with a battery pack in the transmitter. When you receive the PT900, the battery pack is not fully charged. To charge the battery pack, you must use an external power adapter with an input rating of 100-240VAC and output rating of 12VDC. When the AC power adapter is connected to the transmitter, the battery LED will start flashing, which indicates that the battery is charging. When the battery LED is continuously **On**, it indicates that the battery is at full charge. When the external power adapter is removed, the battery LED will be **Off**.



Figure 44: Transmitter Power Connection (Right Side)



WARNING! To ensure safe operation, do not turn the PT900 **On** while the battery pack is being charged by an external power adapter connected to a mains voltage of greater than 150VAC. If the PT900 is turned **On** in such a situation, make sure that you do not touch the transducer connectors.

2.6.2 Connecting the Transducers

To connect the transducers, see *Figure 45* below and proceed as follows:

1. Connect the cables from each of the transducers to the transmitter:
 - a. Connect the transducer cable with the **UP** label on the cable connector to the transmitter connector labeled **UP**.
 - b. Connect the transducer cable with the **DN** label on the cable connector to the transmitter connector labeled **DN**.
2. If your transmitter is configured for two channels, connect the second transducer pair by repeating the above step.
3. Properly configure the transmitter to work properly with your specific transducer type. See *“Programming the Transducer Parameters”* on page 74 for instructions.

Important: *Be sure to insert the cable connectors straight into the transmitter connectors to avoid damaging the connectors.*



Figure 45: Transducer Connections (Bottom)

2.6.3 Connecting the Digital Output

The PT900 provides one RS485/Modbus digital output and also supports a digital *frequency/pulse* output and a *totalizer/control gate* input. Connect the digital output as shown in *Figure 46* below (see the cable to the right). The pin numbers for the connector and the color code for the standard input/output cable are shown in *Table 1* below.

Table 1: DIO Cable Wiring Diagram

Connection	Pin #	Color	Description
RS484-	1	Black	RS485/Modbus Negative
RS485+	2	Red	RS485/Modbus Positive
RS485 COM	3	Green	RS485/Modbus Common
DIO	4	White	Digital IO Positive
DRTN	5	Yellow	Digital IO Return
SHD	6	Silver	Cable Shield



Figure 46: Transmitter I/O Connections (Right Side)

2.6.4 Connecting the Analog Inputs and Output

The PT900 provides one 0/4-20 mA analog current output and two 4-20 mA analog inputs, with a switchable 16 V supply for loop-powered temperature transmitters. Connect the analog inputs and output as shown in *Figure 46 on page 36* (see the cable to the left). The pin numbers for the connector and the color code for the standard input/output cable are shown in *Table 2* below.

Table 2: AIO Cable Wiring Diagram

Connection	Pin #	Color	Description
Aout+	1	Red	4-20mA OUTPUT
Aout-	2	Black	4-20mA RETURN
16VDC	3	Blue	+16VDC OUTPUT
ARTN	4	Yellow	ANALOG INPUTS RETURN
AIN1	5	Orange	ANALOG INPUT 1
AIN2	6	Green	ANALOG INPUT 2
SHD	7	Silver	Cable Shield

Important: *The Analog Output is an active mode type. Do not supply a 24V supply to this circuit, as the circuit is powered by the transmitter.*

2.6.5 Connecting the Energy Cables

The AIO port is commonly used for connecting a pair of energy cables to permit energy measurements (see *Figure 47* below).



Figure 47: Energy Cable Connection (Right Side)

2.6.6 Using the USB Port

The PT900 provides one USB2.0 full-speed interface. The receptacle is a micro-USB Type B connector, as shown in *Figure 48* below. Data logs and other information from the transmitter's embedded storage can be uploaded to a PC via the USB port. In addition, the transmitter's configuration files can be changed directly via the USB port.



Figure 48: Transmitter USB Connector (Left Side)

2.6.7 Using the Bluetooth Wireless Interface

The PT900 comes equipped with an internal *Bluetooth* transceiver that enables wireless communication between the transmitter and Bluetooth-enabled tablets. The transmitter can then be configured by the PT900 APP software installed on a tablet connected via the wireless Bluetooth interface. For more information on the APP, see Chapter 3, *Initial Setup*.

2.7 Caring for the PT900 Batteries

The PT900 comes with a self-contained, built-in, rechargeable battery pack to support portable operation. For optimum performance, these batteries require a minimum of maintenance.



CAUTION! Use only GE-approved batteries and desktop chargers, which are designed to maximize battery life. Using other batteries or chargers voids your warranty and may cause damage to the equipment.



CAUTION! For CE compliance, the PT900 is classified as a *battery-powered* device, and it is not to be operated with the AC power adapter connected.

2.7.1 Charging and Storing the Batteries

When you receive the PT900, you will need to initially charge the batteries. Also, the batteries may need to be recharged if they have not been used for a long period of time. The batteries must be charged for up to 3 hours to go from 0% (totally depleted) to 100% (fully charged). When fully charged, the batteries provide 18-20 hours of continuous operation. An internal battery gauge indicates the remaining power in the battery.

To charge the battery, simply plug the AC power adapter cord into the power jack (see *Figure 44 on page 34*) and be sure the battery pack is installed in the transmitter (see *“Installing a Battery Pack in the Transmitter” on page 6*). Whether the PT900 is **On** or **Off**, when the AC power adapter is plugged into line voltage the internal transmitter battery charger automatically charges the battery. The battery LEDs (see *Figure 49* below) indicate the battery charging status.

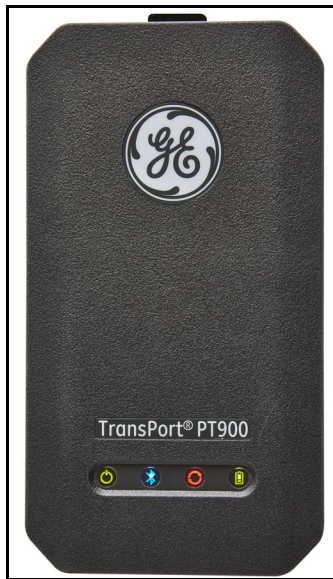


Figure 49: Battery Charging Status LEDs

For optimal run time, *charge the batteries* only in temperatures from 32°F to 113°F (0°C to 45°C). Otherwise, the batteries will not be properly charged and will have significantly reduced run time. *Store the batteries* at temperatures ranging from -4°F to 122°F (-20°C to 50°C). The recommended storage temperature range is -4°F to 77°F (-20°C to 25°C). Extended storage at temperatures above 104°F (40°C) could degrade battery performance and service life.

2.7.2 Replacing the Batteries



CAUTION! Replace the PT900 batteries only with the specified rechargeable batteries. The battery charges even when the unit is **Off**. Do not attempt to recharge non-rechargeable batteries.

To replace the battery pack:

1. Remove the rubber boot from the transmitter.
2. Open the panel on the back of the transmitter (see *Figure 50* below).
3. Disconnect and remove the old battery pack.
4. Install the new battery pack.
5. Reinstall the panel and the rubber boot on the transmitter.



Figure 50: Battery Panel Location

2.7.3 Disposing of the Batteries



CAUTION! Never dispose of the batteries by incineration. Do not attempt to disassemble or short-circuit the batteries. For safety, do not handle a damaged or leaking battery.



CAUTION! Be sure to dispose of your batteries properly. In some areas, battery disposal in business or household trash may be prohibited. For safe disposal options, contact your nearest GE authorized service center.

2.8 Powering On and Off

To operate the PT900, the power cord must be plugged into line voltage or the battery pack must be charged as described in the previous sections.



CAUTION! For CE compliance, the PT900 is classified as a *battery-powered* device, and it is not to be operated with the AC power adapter connected. To comply with CE certification, unplug the AC power adapter before operating the PT900.



WARNING! If the PT900 fails the backup battery test, you must send the unit back to the factory for a battery replacement. Make sure you keep the battery charged until you are ready to ship the unit back to the factory. Before shipping, print out all of the *log and site data*, or transfer it to your PC. Never dispose of the battery by incineration. Do not attempt to disassemble or short-circuit the battery pack. For safety, do not handle a damaged or leaking battery.

2.8 Powering On and Off (cont.)

To turn the PT900 **On**, press the *Power On/Off* button on the top of the transmitter (see *Figure 51* below) for about *3 seconds*. Initially, only the *Green Power LED* shows solid **On**. However, after the system powers up completely, all the LEDs show solid **On**.

To turn the PT900 **Off**, press the *Power On/Off* button on the top of the transmitter (see *Figure 51* below) for about *3 seconds*. All of the LEDs will turn **Off**.



Figure 51: Transmitter Power Button (Top)

2.9 PT900 LED Indicators

The four colored LEDs on the front of the PT900 transmitter (see *Figure 52* below) provide real time information on the meter status. See the next page for details.

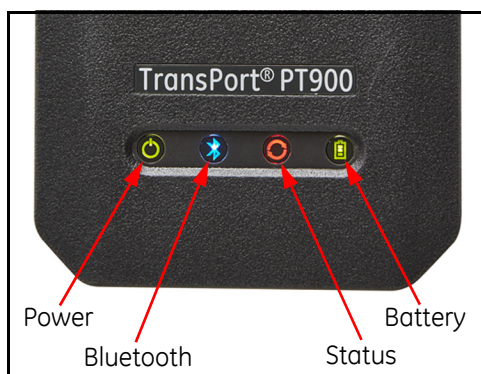


Figure 52: Transmitter LEDs (Front)

2.9.1 Power LED

- *Solid Green light* when the meter is powered **On**
- *No light* when the meter is **Off**
- *Blinking Green light* when the meter is in power save mode

2.9.2 Bluetooth LED

- *Solid Blue light* when Bluetooth® is linked to a transmitter
- *Blinking Blue light* when Bluetooth® is in the *click-button* to confirm pairing process
- *Solid Red light* when the meter is on and Bluetooth® is idle or is not linked to a transmitter
- *No light* when Bluetooth® is in configuration mode

2.9.3 Status LED

- *Solid Green light* when the meter is in measure mode without any errors
- *Red light* when an error occurs while the meter is in measure mode
- *No light* when the meter is in configure mode

2.9.4 Battery LED

- *Solid Green light* when the battery is fully charged ($>99\%$), but the AC adapter is connected
- *Solid Green light* when the battery level is high ($>20\%$), but the AC adapter is not connected
- *Blinking Green light* when the battery is not fully charged, but it is charging with the AC adapter connected
- *Red light* when the battery level is low ($\leq 20\%$) and the battery needs to be charged immediately
- *Blinking Red light* when the battery level is low ($\leq 10\%$) and the meter will be out of power soon
- *Light off* when the meter is **On**, but the battery is completely discharged and the AC adapter is connected

[no content intended for this page]

Chapter 3. Initial Setup

3.1 Introduction

This chapter provides instructions for programming the PT900 flow meter via the tablet APP prior to initial operation.

3.2 Charging the PT900 Transmitter and Tablet

Before proceeding, make sure that both the *PT900 Transmitter* and the *Tablet* are fully charged. The AC power adapters are shipped in the carry case. If either the transmitter or the tablet cannot be powered On after charging, contact your GE representative or visit www.gemeasurement.com for transmitter assistance or contact the tablet manufacturer for tablet assistance.

3.3 Installing or Updating the PT900 APP

The instructions in the following sections explain the procedures for downloading the current version of the PT900 APP and installing it on your tablet.

3.3.1 Checking the APP Version

To check the APP version currently on your tablet, click on the **About** option in the **Help** menu to open a screen similar to *Figure 53* below. This screen displays general information about the PT900. This information includes: model name, instrument type, software version, and the copyright year of the APP.

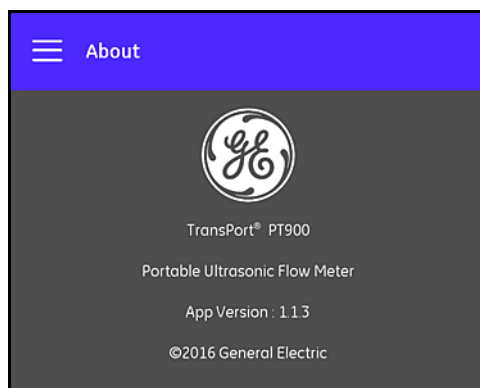


Figure 53: The About Screen

3.3.2 Installing or Updating the PT900 Android and iOS APP

Update your existing PT900 APP from one of the below options:

Android App

- **Google Play Store:** To obtain a newer version of the APP from Google Play Store, search for “*Transport PT900*” and install it. Google Play Store is the preferred method of installation because updates will automatically be loaded to your tablet with the latest version of the application.
- **QR Code or GE Website:** To obtain a newer version of the APP, scan the QR Code in *Figure 54* below.



Figure 54: QR Code

Alternatively, download the latest version of the APP from the GE website, go to the below URL and search for “TransPort PT900”
<https://www.industrial.ai/download-center>

- **SD Card:** To obtain a newer version of the APP from an SD card, plug the SD card directly into the *Tablet*. Then, select the APK file from the SD folder.

iOS App

- **Minimum iOS Device Requirements:** Device should have
 - BLE 4.0 and above
 - iOS version 11.0 and above
 - Capacity: 16GB and above
- **Apple App Store:** To obtain a newer version of the APP from Apple App Store, search for “*Transport PT900*” and install it. Apple App Store is the only method to install the iOS application and updates will automatically be loaded to your tablet with the latest version of the application.

3.3.3 Installing the Tablet APP from the SD Card (Applicable only to Android APP)

To install the APP, complete the following steps:

1. Open the “My Files” folder on the tablet screen and select the APP from the SD folder (see *Figure 55* below).

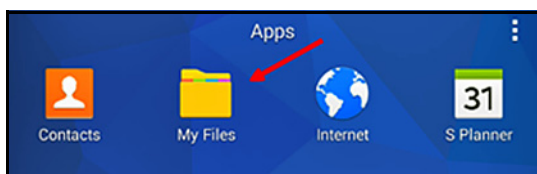


Figure 55: The “My Files” Folder

2. In the tablet settings, enable the security option to allow the installation of software from “Unknown sources” for this installation only (see *Figure 56* below).

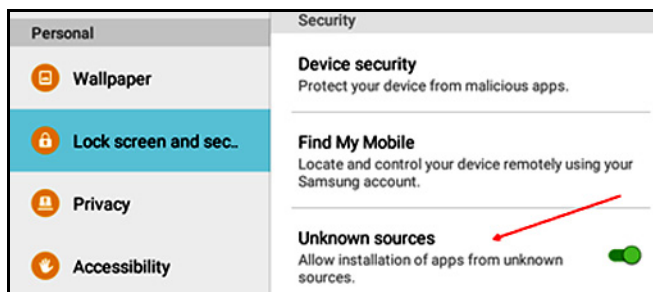


Figure 56: Security Settings

3.3.3 Installing the Tablet APP from the SD Card (cont.)

- Click on the APK file, and the *Android* operating system will verify the checksum and signature for the file. Depending on whether this is an initial installation or an update installation, you will see one of the screens shown in *Figure 57* below. Click **INSTALL** to begin the installation.

Note: *If the file signature is not verified, the APP will be treated by the Android operating system as an unrecognized APP.*

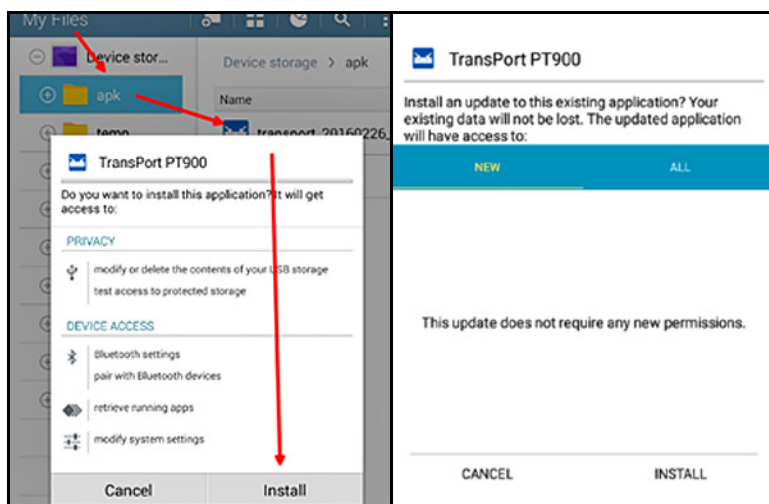


Figure 57: Initial (Left) and Update (Right) Installation Screens

3.4 Pairing the Tablet and the Transmitter

To set up the APP and pair with the PT900 transmitter, complete the following steps:

1. After the APP has been downloaded to your tablet, find the icon shown in *Figure 58* below on the tablet **APPS** and click on it to launch the APP.

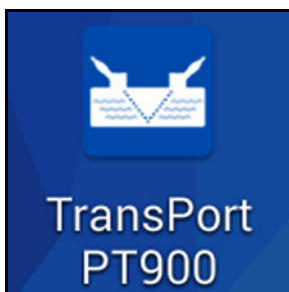


Figure 58: PT900 APP Icon

2. While the APP is loading, you should see the initialization screen shown in *Figure 59* below.

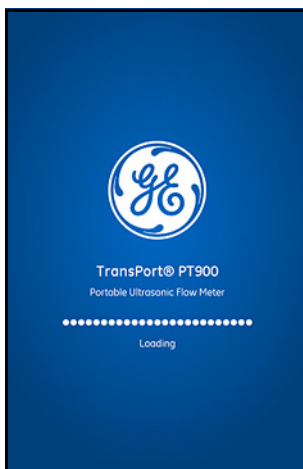


Figure 59: APP Loading Screen

3.4 Setting Up the PT900 APP (cont.)

- 3. At the screen shown in *Figure 60* below, select the desired language for the APP and click OK.

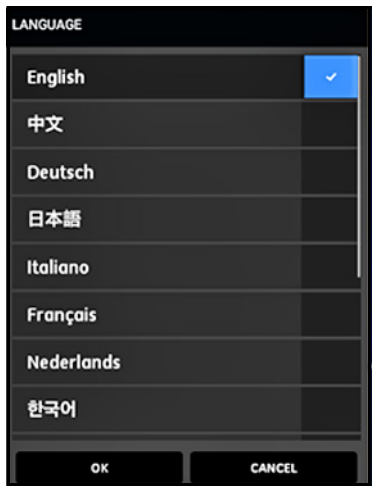


Figure 60: PT900 APP Language Options

- 4. At the *License Agreement* screen (see *Figure 61* below), read the agreement and then click **AGREE** to continue with the APP installation or click **CANCEL** to stop the APP installation.



Figure 61: PT900 APP License Agreement

3.4 Setting Up the PT900 APP (cont.)

5. At the *Registration* screen (see *Figure 62* below), click **OK** to register your PT900 or click **CANCEL** to skip the registration.

Note: *If you skip the registration, the screen will popup as a reminder the first five times you launch the APP and then it will never appear again.*

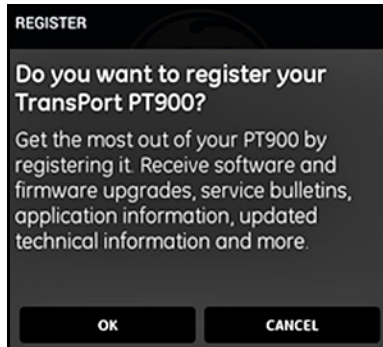


Figure 62: PT900 Registration

6. After the APP finishes loading, the default *Transmitter* list is displayed. During initial installation, this list is empty (see *Figure 63* below).

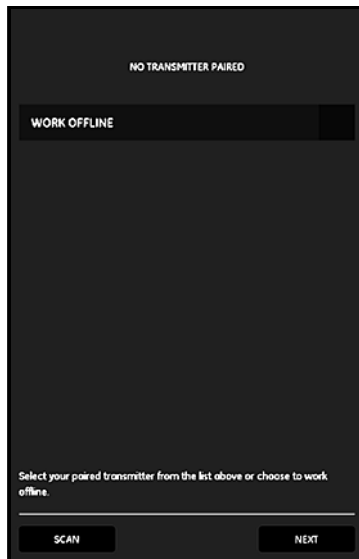


Figure 63: Initial Transmitter List

3.4 Setting Up the PT900 APP (cont.)

- 7. To connect to a new PT900 transmitter, click **SCAN**. Pairing steps are different for Android and iOS application. For Android, follow the below steps (8 & 9) and for iOS, follow the steps 10 & 11.

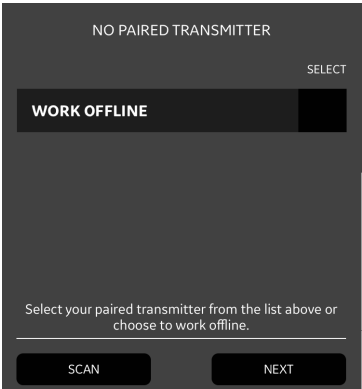


Figure 64: Scanning Transmitter

Note: Your PT900 transmitter is identified by the serial number on its label (see Figure 65 below).

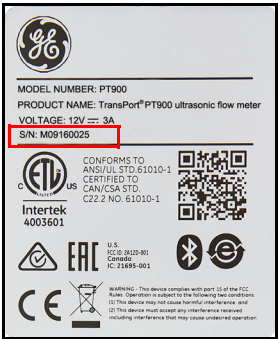


Figure 65: Transmitter Serial Number

8. In Android, APP will search for all available transmitters via Bluetooth. After the scan has been completed, any new transmitters which were found are listed in the **AVAILABLE DEVICES** section of the tablet screen (see red arrow in *Figure 66* below). Click on your transmitter to pair it with the tablet via Bluetooth.

Important: *Although Bluetooth is installed in many devices, the PT900 APP is designed to filter out all devices except those with names of the form PT900-Mxxxxxxx.*

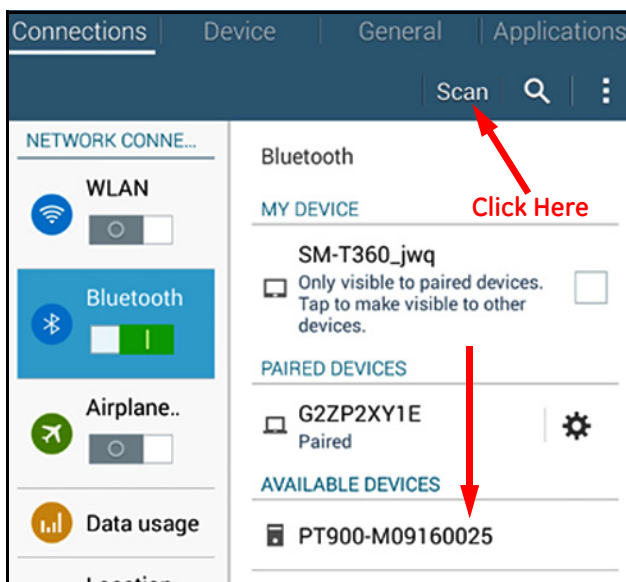


Figure 66: Available Devices List

9. During the pairing process, PT900 security features require the user to confirm the pairing (see *Figure 67* below). When the *Bluetooth pairing request* appears on the tablet (ignore the random passkey), click **OK** to continue. Then, confirm that the blue LED on the transmitter is flashing and click the transmitter power button.

Important: *The pairing is completed only after it is confirmed at both the tablet and the transmitter. Otherwise, the pairing will fail.*

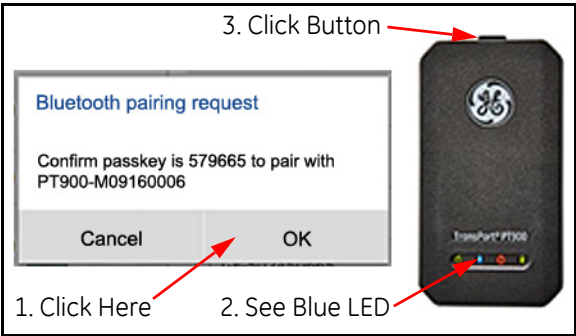


Figure 67: Confirm the Pairing

For iOS:

- 10. In iOS, APP will search for all available transmitters via Bluetooth. After the scan has been completed, any new transmitters which were found are listed in the AVAILABLE DEVICES section of the tablet screen. Click on your transmitter to pair it with the tablet via Bluetooth.

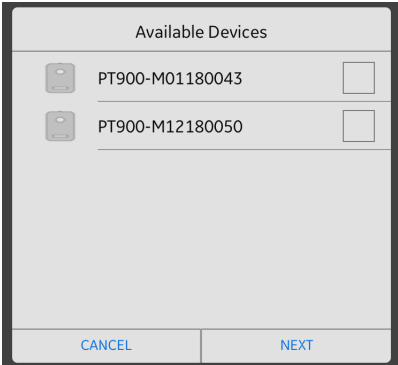


Figure 68: Available Devices List

- Note:** *In Android, if Bluetooth is turned off then app can turn on the Bluetooth programmatically but in iOS, there is no control over the Bluetooth to turn on from application side.*
- Note:** *If you try to pair iPhone with firmware below 1.2.1, then you may see a connection error popup. In such case after upgrading the firmware to 1.2.1 or above (supports iOS and android), turn the bluetooth off/on on your device settings to start the connection again.*

11. During the pairing process, PT900 security features require the user to confirm the pairing (see Figure 69 below). When the Bluetooth pairing request appears on the tablet, enter the passkey and click Pair. Then, confirm that the blue LED on the transmitter is flashing and click the transmitter power button within 10s. Passkey for this device is 843278.

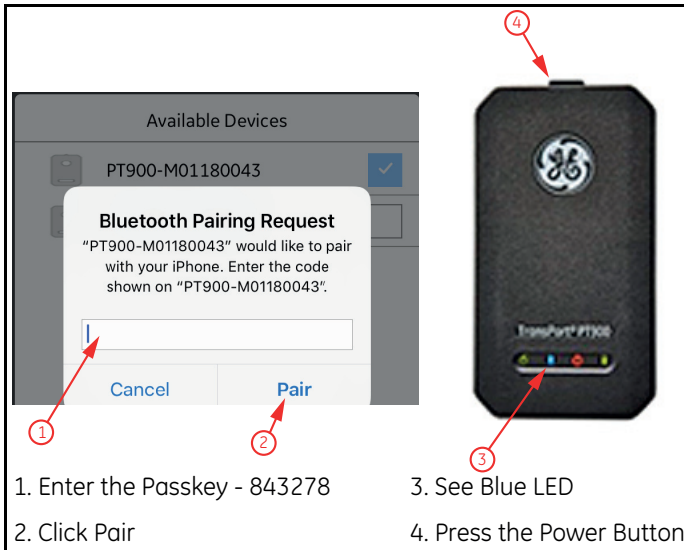


Figure 69: Confirm the Pairing

12. Click the **BACK** button on the tablet to return to the PT900 APP main menu. Then, select your PT900 transmitter in the **TRANSMITTERS PAIRED** list and click **NEXT** to open the *Main Menu*. For example, the **PT900-M09160025** transmitter is selected from the list in *Figure 70* below.

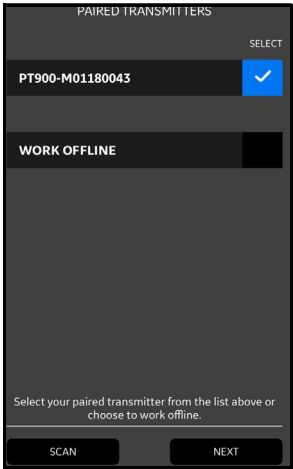


Figure 70: Paired Transmitters List

- Note:** *If desired, you may simulate the APP operation without connecting to the transmitter. To do so, click the **WORK OFFLINE** option in Figure 70 above.*
- Note:** *The transmitter can hold only a maximum of four paired devices at a time. When you try to pair more than four devices, then the first paired device will be automatically removed from the transmitter to allow the new device for pairing.*

13. In iOS, if the power button is not pressed within 10s, then the pairing process will fail at the transmitter end. Though it is not paired, this unpaired device will also be displayed in the transmitter paired list. But when you try to connect, below error pop-up will appear.

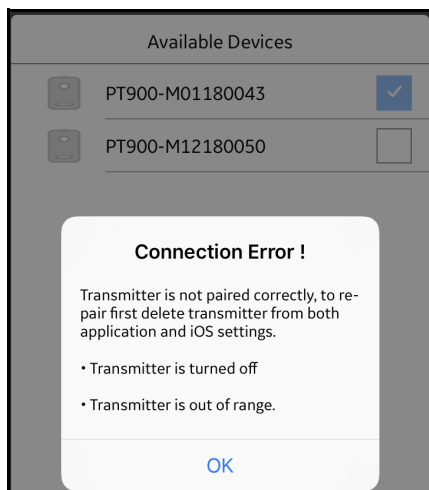


Figure 71: Connection Error

Important: *To pair this transmitter again, user needs to remove the device manually from PT900 APP and iPhone. To remove the device, refer to “Removing paired devices from PT900 APP” on page 58 and “Removing paired devices from iPhone/Tablet” on page 59.*

3.4.1 Removing paired devices from PT900 APP

1. Select the transmitter from the list that you want to remove and click **Edit** button in the top right of the below screen.

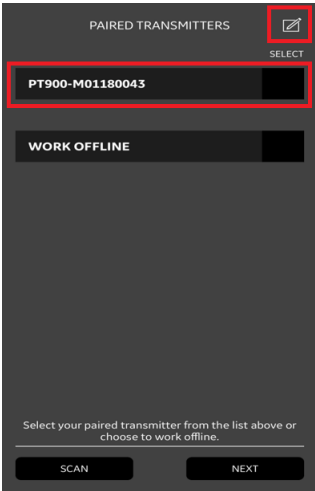


Figure 72: Paired Transmitter Screen

2. Below screen appears. Click **Delete** icon next to the transmitter name.

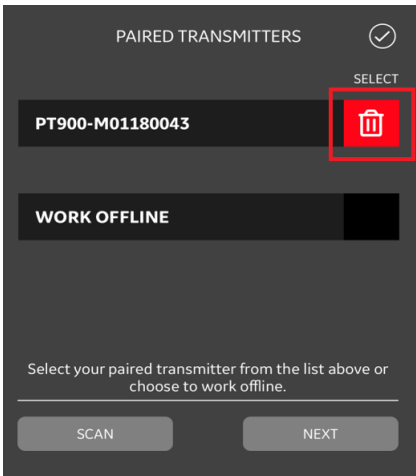


Figure 73: Delete icon

- Click **OK** on the pop-up that appears to confirm the deletion. Now the device will be removed from the APP list.

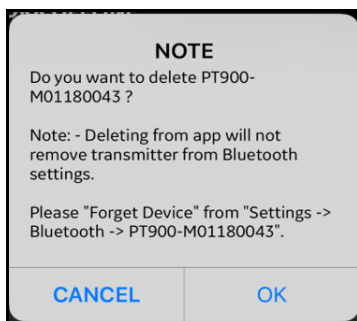


Figure 74: Pop-up Screen

3.4.2 Removing paired devices from iPhone/Tablet

- On iPhone/tablet Go to **Settings > Bluetooth**.
- Find the device that you want to remove and click ⓘ icon next to it.

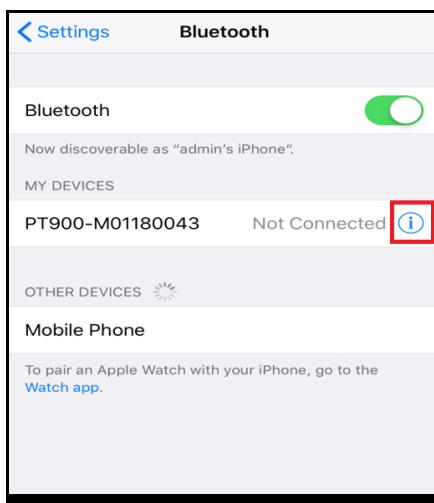


Figure 75: iPhone Bluetooth Settings Screen

3. Click **Forget This Device** on the below screen.

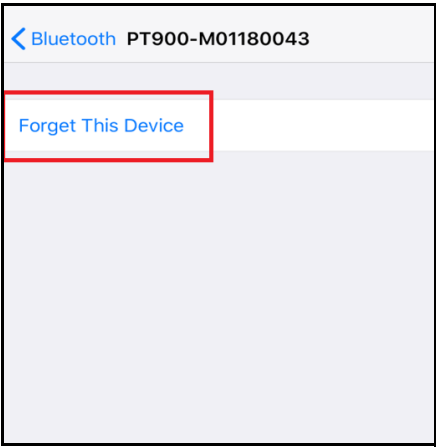


Figure 76: Bluetooth Settings Screen

4. Click **Forget Device** again on the below screen to confirm the deletion.
Now the device will be removed from the iPhone.

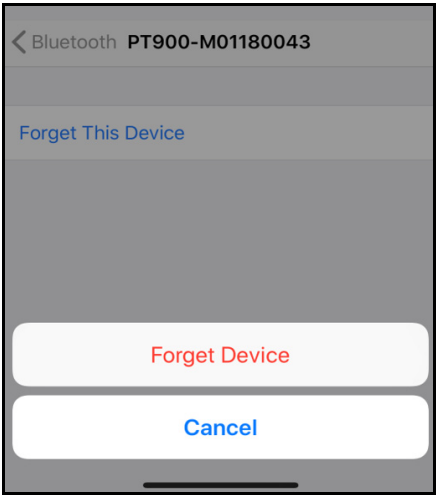


Figure 77: Confirm the Deletion

3.5 Using the APP Main Menu and the Slide Menu

3.5.1 The Main Menu

After successfully installing the APP on the tablet and pairing a PT900 transmitter with the tablet, the initial APP screen is the *Main Menu* shown in *Figure 78* below.

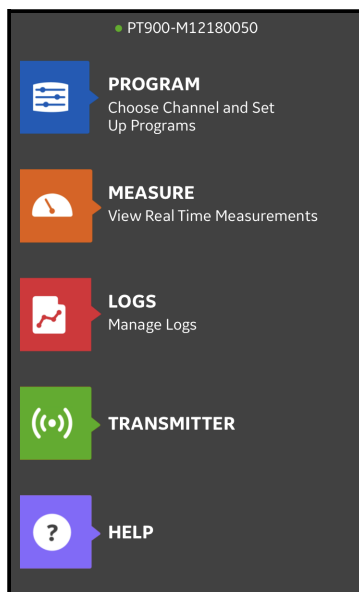


Figure 78: APP Main Menu Screen

The available options in the APP Main Menu are:

- **PROGRAM**, which is used for selecting and configuring a channel.
- **MEASURE**, which is used for viewing real time measurements, error reports and diagnostics information.
- **LOGS**, which is used for setting up log files and managing logs stored in the PT900 transmitter.
- **TRANSMITTER**, which is used get information about transmitter, performing calibrations, setting the error limits and saving the wave sample.
- **HELP**, which is used for accessing detailed information and instructions for your PT900.

3.5.2 The Slide Menu (Applicable only to Android)

In Android, as an alternative to the *Main Menu* discussed in the previous section, you may use the *Slide Menu* shown in *Figure 79* below.

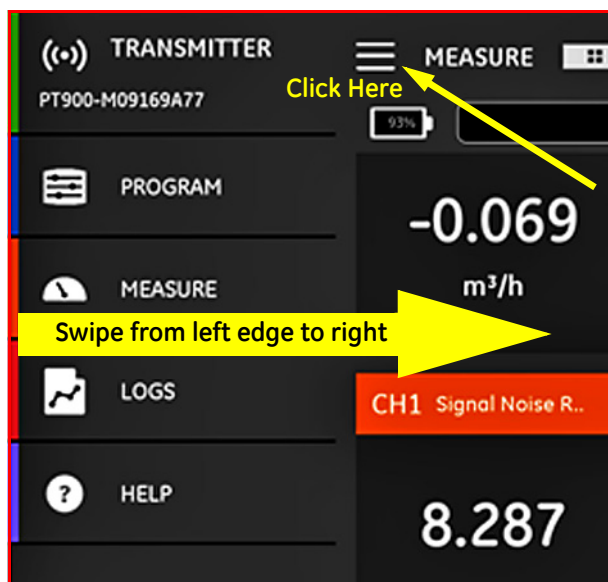


Figure 79: APP Slide Menu Screen

To access the *Slide Menu*, either click the  icon in the top left corner of the screen or swipe across the screen from the left edge to the right. The available options in the APP Slide Menu are:

- **PROGRAM**, which is used for selecting and configuring a channel.
- **MEASURE**, which is used for viewing real time measurements, error reports and diagnostics information.
- **LOGS**, which is used for setting up log files and managing logs stored in the PT900 transmitter.
- **HELP**, which is used for accessing detailed information and instructions for your PT900.

Note: *In iOS, App main menu will appear if you swipe left edge to right.*

Chapter 4. Programming

4.1 Configuring the Units of Measurement

The **UNITS OF MEASUREMENT** menu (see *Figure 80* below) allows the user to select the measurement units displayed by the PT900 in all of its screens.

Note: *Because the choice of Metric or English units is reflected in all other menu screens, this menu should be programmed first.*

UNITS OF MEASUREMENT

Select your units of measurement.

Metric ☒ English

Velocity: m/s

Density: kg/m³

Acceleration: m/s²

Temperature: °C

Custom Enthalpy: kJ/kg/°C

Energy: kWh

Power: kCal/s

Standard Volumetric: SL/s

Actual Volumetric: m³/h

Diameter: mm

Mass: kg/s

Totalizer: Totalizer-Actual V...

Batch Totalizer Time: s

OK CANCEL

Figure 80: The Units of Measurement Menu

4.1 Configuring the Units of Measurement (cont.)

From the APP main menu, click **Unit Options** under the **PROGRAM** menu. This will open the **UNITS OF MEASUREMENT** menu shown in *Figure 80 on page 63*.

To program the **UNITS OF MEASUREMENT**, complete the following steps:

1. Move the slide switch at the top of the menu to either **Metric** or **English** to select the desired PT900 global measurement units system.
2. Based on your selection above, the units for all of the PT900 measurement parameters will be automatically populated with default units.
 - a. Some of the parameters have only one units of measure choice available. The text boxes for these parameters are grayed out, and the default units cannot be changed.
 - b. Some of the parameters have multiple units of measure choices available. The text boxes for these parameters are active, and the default units can be changed by opening the drop-down list and selecting the desired units.
3. After you have completed your programming, click the **OK** button to save your choices or click the **CANCEL** button to discard the changes.

4.2 Configuring a Channel

Selecting the **PROGRAM>Channel** option on the APP screen (see *Figure 81* below) enables you to set up a channel for measuring flow rate. The PT900 supports up to two channels, channel **1** and channel **2**. They are programmed individually, and the programmed information can be saved in a **PRESETS** file.

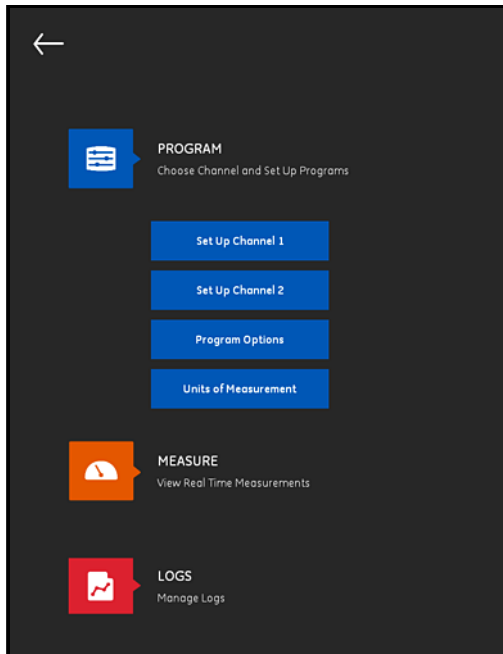


Figure 81: The Program Channel Menu

To completely configure a channel, the following menus must be programmed:

- **PIPE** (see “*Programming the PIPE Menu*” on page 67)
- **FLUID** (see “*Programming the FLUID Menu*” on page 70)
- **TRANSDUCERS** (see “*Programming the TRANSDUCERS Menu*” on page 73)
- **PLACEMENT** (see “*Programming the PLACEMENT Menu*” on page 78)

4.2 Configuring a Channel (cont.)

Using **Channel 1** as an example, refer to *Figure 82* below and complete the following steps:

1. Change the channel status from **Off** to **On**. This will not only activate the channel, but it will also activate the two programming buttons.
2. If the other channel has already been programmed, click the **COPY CH** button to copy all programming data from the other channel to the current channel. In this example, it will copy the *Channel 2* data into *Channel 1* to simplify the programming.
3. After the current channel has been programmed, click the **PRESETS** button to save the programming data to a file stored in the PT900 transmitter memory. These *site data files* may be uploaded to the APP via the USB link the next time the PT900 is installed at the same site.

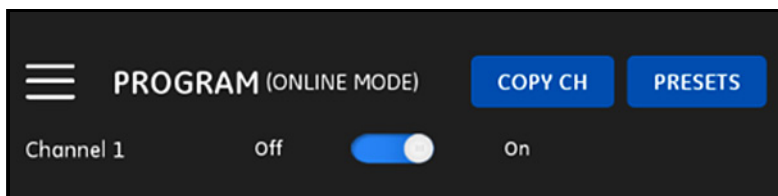


Figure 82: Channel 1 Programming (Android Screen)

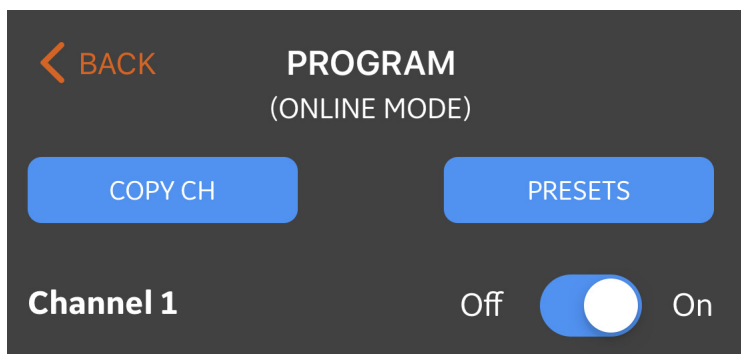


Figure 83: Channel 1 Programming (iOS Screen)

4.3 Programming the PIPE Menu

The **PIPE** menu allows the user to specify all pipe parameters that are required to ensure accurate ultrasonic flow rate measurements. An example of this menu is shown in *Figure 84* below. See the following sub-sections for the options available in programming the various pipe parameters.

Note: *The measurement units used for all pipe parameters in these menus depend on the choices made in the **UNITS OF MEASUREMENT** menu.*

The screenshot shows the 'PROGRAM (ONLINE MODE)' interface. At the top, there are buttons for 'COPY CH' and 'PRESETS'. Below these, a status bar shows 'Channel 1', 'Off', a toggle switch, and 'On'. The main menu has four tabs: 'PIPE', 'FLUID', 'TRANSDUCERS', and 'PLACEMENT'. The 'PIPE' tab is selected and highlighted in blue. The 'PIPE' menu contains the following parameters:

- PIPE MATERIAL:** Steel (Carbon) (dropdown menu)
- PIPE SOUND SPEED:** 3230.0 m/s (text input)
- PIPE STANDARD:** ANSI (dropdown menu)
- NOMINAL:** 1/8 (dropdown menu)
- SCHEDULE:** 40 (dropdown menu)
- OUTER DIAMETER:** 10.287 mm (text input)
- WALL THICKNESS:** 1.727 mm (text input)
- LINING:** Yes (dropdown menu)
- LINING MATERIAL:** Other (dropdown menu)
- LINING SOUND SPEED:** 2000.0 m/s (text input)
- LINING THICKNESS:** 0.0 mm (text input)

Figure 84: The PIPE Menu

4.3.1 Pipe Materials

From the drop-down list of pipe materials supported by the PT900 transmitter, select the pipe material for your application. For convenient reference, some of the available options are shown in *Table 3* below.

Table 3: Pipe Materials

Material	Description	Material	Description
Other	Any material	Glass (Pyrex)	Pyrex glass
Steel (Carbon)	Carbon steel	Glass (Flint)	Flint glass
Steel (Stainless)	Stainless steel	Glass (Crown)	Crown glass
Iron (Duct)	Ductile iron	Plastic (Nylon)	Nylon
Iron (Cast)	Cast iron	Plastic (Polye)	Polyethylene
Copper	Copper	Plastic (Polyp)	Polypropylene
Aluminum	Aluminum	Plastic (PVC)	Polyvinyl chloride
Brass	Brass	Plastic (Acryl)	Acrylic plastics
30% Nickel	30% Ni/Cu alloy	Plastic (Glass)	Glass reinforced plastic
10% Nickel	10% Ni/Cu alloy		

Important: *The pipe sound speed is automatically entered, based on the selected pipe material. If **OTHER** is selected for the pipe material, be sure to enter the correct sound speed for your specific pipe material.*

4.3.2 Pipe Dimensions

Be sure to enter the following information for your pipe:

- If the **PIPE MATERIAL** is any type of steel and the **PIPE STANDARD** is **ANSI**, select the **NOMINAL** size and the pipe **SCHEDULE** from the drop down list.

Note: *If the **PIPE MATERIAL** is not any type of steel, the above menu options are not available.*

- In the **OUTER DIAMETER** box, enter the nominal outside diameter of the pipe.
- In the **WALL THICKNESS** box, enter the wall thickness of the pipe.

4.3.3 Pipe Lining

If you entered **YES** in the **LINING** box, the **LINING MATERIAL**, **LINING SOUND SPEED** and **LINING THICKNESS** must be programmed to ensure accurate flow rate measurements. From the drop-down list of pipe linings supported by the PT900 transmitter, select the pipe lining for your application. For convenient reference, the list of available options is shown in *Table 4* below.

Table 4: Available Pipe Linings

Material	Description	Material	Description
Other	Any material	Mortar	Mortar
Tar Epoxy	Tar Epoxy	Rubber	Rubber
Pyrex Glass	Pyrex Glass	Teflon	Teflon
Asbestos Cement	Asbestos Cement		

Important: *The lining sound speed is automatically entered, based on the selected lining material. If **OTHER** is selected for the pipe lining, be sure to enter the correct sound speed for your specific pipe lining.*

Complete the lining programming by entering your **LINING THICKNESS**.

4.4 Programming the FLUID Menu

The **FLUID** menu allows the user to specify all the parameters of the fluid flowing through the pipe that are required to ensure accurate ultrasonic flow rate measurements. An example of this menu is shown in *Figure 85* below. See the following sub-sections for the options available in programming the various fluid parameters.

Note: *The measurement units used for all fluid parameters in these menus depend on the choices made in the **UNITS OF MEASUREMENT** menu.*

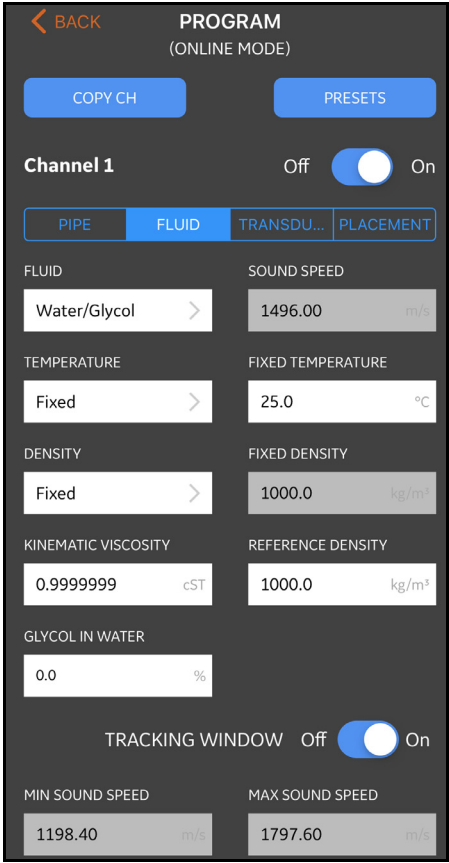


Figure 85: The FLUID Menu

4.4 Programming the FLUID Menu (cont.)

To program the **FLUID** menu, complete the following steps:

1. Select your **FLUID** from the drop-down list (see *Table 5* below) and enter the expected **TEMPERATURE** of the fluid during flow rate measurements.
2. If the selected **FLUID** is water or water-based, the **SOUND SPEED** is a constant which is automatically entered in the **SOUND SPEED** box.
3. If you selected **OTHER** as the **FLUID**, the automatic entry in the **SOUND SPEED** box must be changed to the correct value by user.
4. In the **DENSITY** section, open the drop-down list and select **Fixed** or **Active** depends on your system. If you choose Fixed, you will need to enter the desired value in the **FIXED DENSITY** section. If you choose Active, you will be able to enter upto 10 Temperature/Density data points for your system in a table on clicking **VIEW/EDIT TABLE** as shown below.

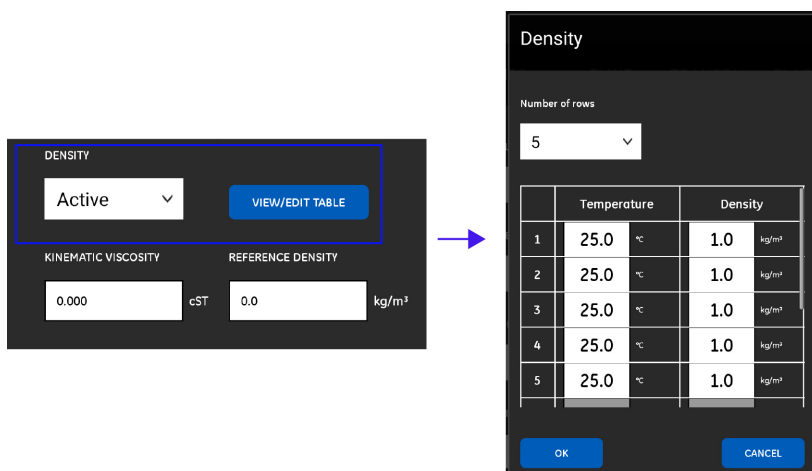


Figure 86: Fluid menu density options

5. The fluid **KINEMATIC VISCOSITY** (see GE document *916-119*) is used to calculate the *Reynolds Number*, which is then used calculate the *Reynolds Correction*.
6. In the **REFERENCE DENSITY** section, enter the value of reference density which is used to calculate mass for CH1 and Ch2.

4.4 Programming the FLUID Menu (cont.)

- 7. The **TRACKING WINDOW** is used to detect the receive signal when the user is unsure of the fluid sound speed. Set the **TRACKING WINDOW** to either **On** or **Off** (the default setting is **Off**).
- 8. If the **TRACKING WINDOW** is **On**, enter the values for the **MAX SOUND SPEED** and the **MIN SOUND SPEED** for the application.

The available **FLUID** types depends on the current setting for the **TRACKING WINDOW** (see *Table 5* below).

Table 5: Available Fluid Types

Tracking Window Off		Tracking Window On
Other	Lube Oil (X200)	Other
Water	Oil	Water
Water/Glycol	Methanol	Water/Glycol
Sea Water	Ethanol	Oil
Oil (22°C)	LN2 (-199°C)	
Crude Oil	Freon (R-12)	

4.5 Programming the TRANSDUCERS Menu

The **TRANSDUCERS** menu allows the user to specify all the parameters of the transducers that are required to ensure accurate ultrasonic flow rate measurements. An example of this menu is shown in *Figure 87* below. See the following sub-sections for the options available in programming the transducers.

Note: *The measurement units used for all transducer parameters in these menus depend on the choices made in the **UNITS OF MEASUREMENT** menu.*

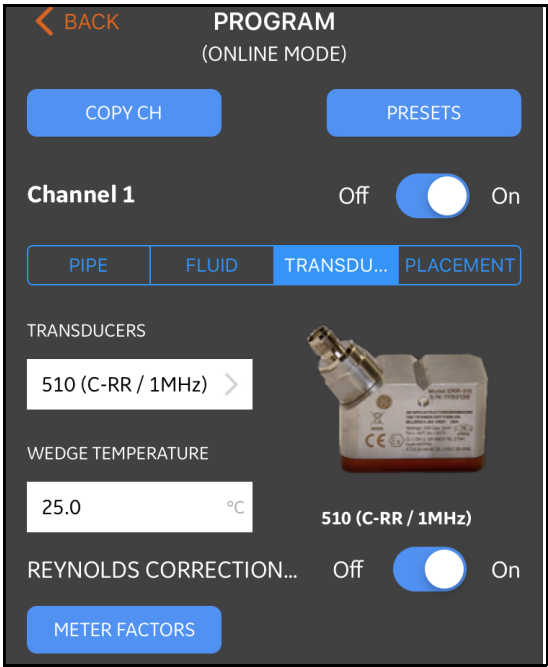


Figure 87: The TRANSDUCERS Menu

4.5.1 Programming the Transducer Parameters

To program your transducer parameters, refer to *Figure 87 on page 73* and complete the following steps:

1. On **TRANSDUCERS** section and select your transducer model from the drop down list.

Note: *The GE Transducer Installation Guide for your transducer model provides more detailed information on transducer mounting configurations.*

Table 6: Available Clamp-On Transducers

Transducer Number	Transducer Model Name
10	C-PT-N/0.5MHz
11	C-PT-N/2MHz
12	C-PT-H/0.5MHz
13	C-PT-H/1MHz
14	C-PT-M/2MHz
15	C-PT-H/0.5MHz
16	C-PT-H/1MHz
17	C-PT-H/2MHz
23*	CF-LP-H/4MHz
24*	CF-LP-N/4MHz
31	CF-WL/2MHz
401	C-RS/5MHz
402	C-RS/1MHz
403	C-RS/2MHz
407	UTXDR/2MHz
408	UTXDR/4MHz
505*	C-RR/0.5MHz
510*	C-RR/1MHz
520*	C-RR/2MHz
591*	C-RR/0.5MHz
592*	C-RR/1MHz
601	C-AT/0.5MHz
602	C-AT/1MHz
603	C-AT/2MHz
*the most common transducers used with the PT900	

4.5.1 Programming the Transducer Parameters (cont.)

2. If you select standard transducer from the drop down, you will need to enter only the **WEDGE TEMPERATURE** (see Figure 87). But if you select **other** as your transducer model, few additional parameters will appear on the screen (see Figure 88) and you must edit this data with the correct specific information.

The screenshot shows the 'PROGRAM (ONLINE MODE)' interface. At the top, there are 'COPY CH' and 'PRESETS' buttons. Below them is 'Channel 1' with an 'Off' toggle switch. A row of tabs includes 'PIPE', 'FLUID', 'TRANSDU...', and 'PLACEMENT'. Under 'TRANSDUCERS', a dropdown menu shows 'Other'. To the right is an image of a transducer labeled 'Other'. Below this, several parameters are displayed in input fields: 'WEDGE TEMPERATURE' (25.0 °C), 'WEDGE SOUND SPEED' (2476.25 m/s), 'WEDGE ANGLE' (42.0 °), 'TW' (17.30 us), and 'FREQUENCY' (1 MHz). At the bottom, there is a 'REYNOLDS CORRECTION...' toggle switch (set to 'Off') and a 'METER FACTORS' button.

Figure 88: Transducer Menu parameters

- a. **WEDGE TEMPERATURE:** This parameter must be entered manually for all transducers. It should be the average of the ambient temperature and the process temperature.
- b. **WEDGE SOUND SPEED:** This parameter is entered automatically by the PT900 for all **Standard** transducers, but it must be edited with the correct value provided by GE for **Other** transducers.

4.5.1 Programming the Transducer Parameters (cont.)

- c. **WEDGE ANGLE:** This parameter is entered automatically by the PT900 for all **Standard** transducers, but it must be edited with the correct value provided by GE for **Other** transducers.
- d. The **TW** parameter is the time the transducer signal spends traveling through the transducer and the transducer cable. Enter the value provided by GE with your transducer.
- e. Open the **FREQUENCY** drop-down list and select the frequency at which your transducer is designed to operate.

4.5.2 Setting the Reynolds Correction Factor

The **REYNOLDS CORRECTION FACTOR** can be set to either **On** or **Off** (see *Figure 87 on page 73*). This factor corrects the fluid velocity measured across a diametrical path so that it more accurately represents the average fluid velocity across the entire cross-sectional area of the pipe. The **REYNOLDS CORRECTION FACTOR** should be turned **On** for all clamp-on measurements.

4.5.3 Programming the Meter Factor

To program the **METER FACTOR**, refer to *Figure 87 on page 73* and complete the following steps:

1. Click on the **METER FACTOR** button to open the menu shown in *Figure 89* below.

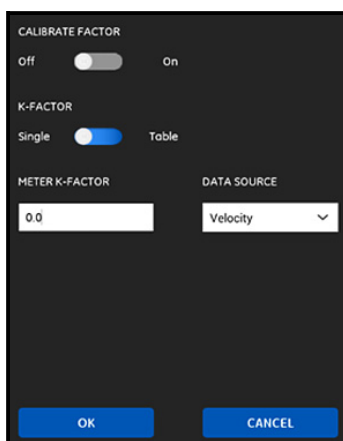


Figure 89: The Calibrate Factor Menu

4.5.3 Programming the Meter Factor (cont.)

2. The **CALIBRATE FACTOR** is used to calibrate or adjust the flow rate readings of the PT900 to correspond with another flow rate reference. Use the slide switch to set it to **On** or **Off**, as desired.
3. Use the slide switch to set the **K-FACTOR** to either **Single** or **Table**. The, proceed to the appropriate step below:
 - **SINGLE:** A single multiplier is applied to all PT900 measurements. Generally, if the **Reynolds Correction Factor** is **On**, the **K-FACTOR** should be set to 1.00. Otherwise, the typical range is 0.5 to 2.00.
 - **TABLE (CALIBRATE FACTOR = On):** A table is displayed (see *Figure 90* below) which allows the user to enter multiple **K-FACTORS** for data points from several different sources or flow variables. These points define a *calibration curve* for the PT900.

Number of rows

6 ▼

	DATA SOURCE		K-FACTOR
1	0.0	m/s	1.0
2	0.0	m/s	1.0
3	0.0	m/s	1.0
4	0.0	m/s	1.0
5	0.0	m/s	1.0
6	0.0	m/s	1.0

OK CANCEL

Figure 90: K-Factor Table

4.6 Programming the PLACEMENT Menu

The **PLACEMENT** menu allows the user to configure the mounting method of the transducers, based on the programmed information in the **TRANSDUCERS** menu (see “*Programming the TRANSDUCERS Menu*” on page 73).

4.6.1 Viewing the Traverse Configuration

For **CLAMP-ON** transducers, one of the six possible **TRAVERSE** configurations shown in *Figure 91* below is displayed, as appropriate for your programmed transducer information. Typically, a two-traverse installation is used.

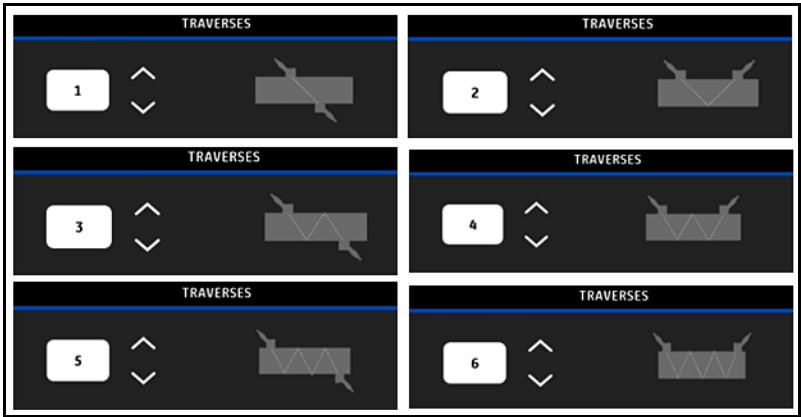


Figure 91: Clamp-On Traverse Configurations

For **WETTED** transducers, the values for the following parameters are listed, as calculated from your programmed transducer information:

- **PATH LENGTH**
- **AXIAL LENGTH**

4.6.2 Viewing the Transducer Spacing

The **TRANSDUCER SPACING** screen (see *Figure 92* below) shows the value calculated by the PT900 for the correct distance between the upstream and downstream transducers, based on your programmed transducer data. This value should be used when installing your transducer clamping fixture on the pipe.

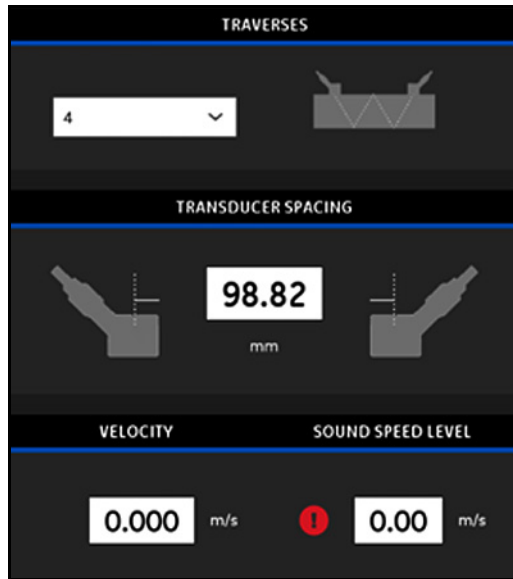


Figure 92: Transducer Spacing Value

4.6.2a Custom Transducer Spacing

If your transducers were installed with a spacing different from the value calculated by the APP, refer to *Figure 93* below and input the actual spacing as follows:

Note: *Be sure that, if the installed spacing you input is larger than the calculated value, it is not more than 10% above the calculated value.*

1. Enter your actual transducer spacing in the units specified by your system **UNITS** setting.
2. Click the **OK** button to accept the new value.

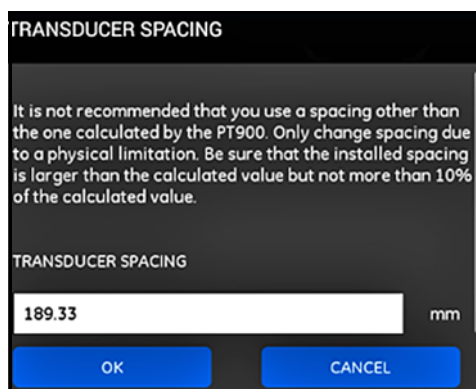



Figure 93: Custom Transducer Spacing

4.6.2b Zero Flow Validation

Important: *You must make sure that the fluid in your pipe is not flowing before proceeding.*

After the flow in the pipeline is verified to be static, refer to *Figure 94* below and calibrate the zero flow setting by completing the following steps:

1. Click the **VELOCITY** input control.
2. Click the **ZERO FLOW** button, and then click the **OK** button.
3. If the displayed velocity value is not zero, record the displayed velocity.
4. Enter the recorded velocity value from the previous step in the **MINIMUM FLOW CUTOFF** box and click the **OK** button.

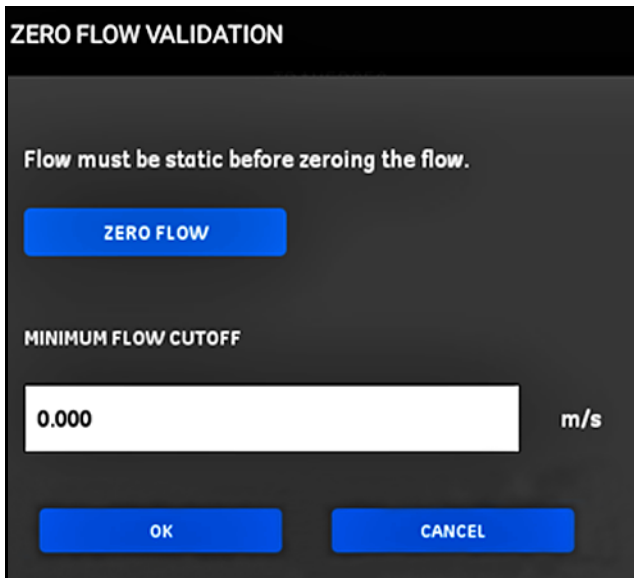

ZERO FLOW VALIDATION

Flow must be static before zeroing the flow.

ZERO FLOW

MINIMUM FLOW CUTOFF

0.000 m/s


OK **CANCEL**

Figure 94: Zero Flow Validation

4.6.2c Sound Speed Validation

When the speed of sound in your fluid does not equal published values, refer to *Figure 95* below and set the **SOUND SPEED LEVEL** by completing the following steps:

1. Click the **SOUND SPEED LEVEL** input control.
2. Enter your actual sound speed in the units specified by your system **UNITS** setting.
3. Click the **OK** button to accept the new value.

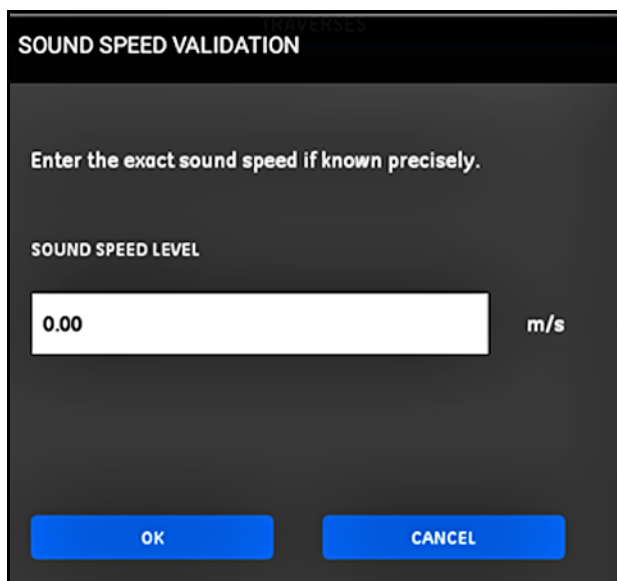

SOUND SPEED VALIDATION

Enter the exact sound speed if known precisely.

SOUND SPEED LEVEL

0.00 m/s

OK **CANCEL**

Figure 95: Sound Speed Validation

Important: *You have now completed the programming of the **PIPE**, **FLUID**, **TRANSDUCER** and **PLACEMENT** menus. Click on the **GO TO MEASURE** button to change to the measurement display or click the **LOG DATA** button to begin logging data.*

4.7 Configuring the Program Options

Note: *The programming instructions in this section are only required if you will be using any of the options listed below.*

From the **APP** main menu, click the **Program Options** sub-menu under the **PROGRAM** menu, as highlighted in *Figure 96* below. This will open the **Program Options** menu shown in *Figure 97* on page 84.

The **Program Options** menu includes the following tabs:

- **ENERGY** (see page 85)
- **INPUTS** (see page 87)
- **OUTPUTS** (see page 88)
- **USER FUNCTIONS** (see page 93)

Proceed to the appropriate section for programming instructions.

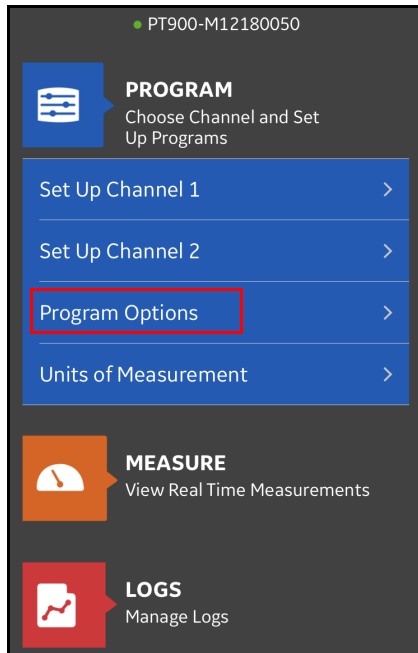


Figure 96: The PROGRAM Menu

4.7 Configuring the Program Options (cont.)

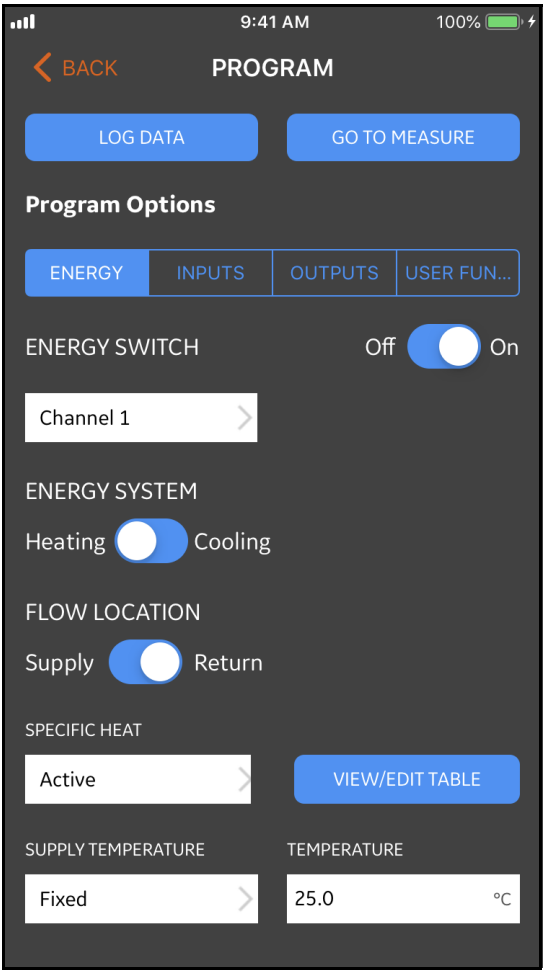


Figure 97: The Program Options Menu

4.7.1 Programming the ENERGY Tab

The first tab in the **Program Options** menu is **ENERGY** (see *Figure 97 on page 84*). The **ENERGY** tab enables the user to calculate the energy of a system based on the temperature at a supply point, the temperature at a return point and the flow of the fluid through the system. To program the energy tab, complete the following steps:

1. Move the **ENERGY SWITCH** to either **Off** or **On**. If you set it to **Off**, the **ENERGY** option is disabled and no additional programming is required in this section. If the **ENERGY SWITCH** is set to **On**, proceed to the next step.
2. In the **ENERGY CHANNEL** section, open the drop-down list and select either **CH1** or **CH2**.
3. In the **ENERGY SYSTEM** section, move the switch to either **Heating** or **Cooling**, based on your system type.
4. In the **FLOW LOCATION** section, move the switch to either **Supply** or **Return**, based on your desired flow measurement point. If you choose **Supply**, **RETURN TEMPERATURE** section will be displayed and if you choose **Return**, **SUPPLY TEMPERATURE** section will be displayed.

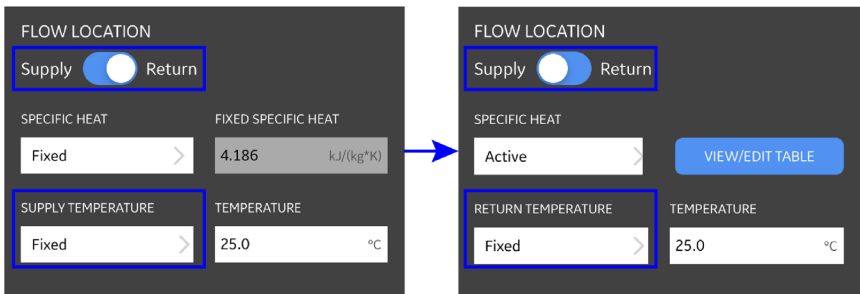


Figure 98: Flow Location selection

5. In the **SUPPLY TEMPERATURE** section, open the drop-down list and select **Fixed** or **Analog Input 1** or **Analog Input 2** as the type of supply for your system. If you choose **Fixed**, you will need to enter the desired value in the **TEMPERATURE** section.
6. In the **RETURN TEMPERATURE** section, open the drop-down list and select **Fixed** or **Analog Input 1** or **Analog Input 2** as the type of supply for your system. If you choose **Fixed**, you will need to enter the desired value in the **TEMPERATURE** section.

4.7.1 Programming the ENERGY Tab (cont.)

- 7. In the **SPECIFIC HEAT** section, open the drop-down list and select **Fixed** or **Active** as the type of supply for your system. If you choose **Fixed**, you will need to enter the desired value in the **FIXED SPECIFIC HEAT** section. If you choose **Active**, you will be able to enter upto 10 Temperature/SPECIFIC HEAT data points for your system in a table on clicking **VIEW/EDIT TABLE** as shown below.

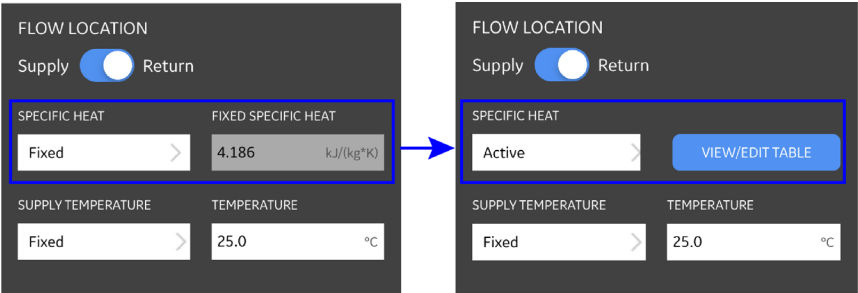


Figure 99: Specific Heat Selection

Cancel

VIEW/EDIT TABLE

Done

Number of rows

1

TEMPERATURE

SPECIFIC HEAT

25.0 °C

4.186 kJ/(kg*K)

25.0 °C

4.186 kJ/(kg*K)

25.0 °C

4.186 kJ/(kg*K)

25.0 °C

4.186 kJ/(kg*K)

25.0 °C

4.186 kJ/(kg*K)

25.0 °C

4.186 kJ/(kg*K)

Figure 100: Temperature/Specific heat table

4.7.2 Programming the INPUTS Tab

The **INPUTS** tab (see *Figure 101* below) enables the user to specify the parameters for the *energy supply temperature*, the *energy return temperature* and the *fixed temperature*, based on your previous programming choices in the **ENERGY** tab.

The screenshot shows a dark-themed interface for the 'PROGRAM' menu. At the top, there's a 'PROGRAM' header with a hamburger menu icon and 'Program Options' below it. A navigation bar contains four tabs: 'ENERGY', 'INPUTS' (which is highlighted with a blue underline), 'OUTPUTS', and 'USER FUNCTIONS'. Below the tabs, the 'ANALOG INPUTS A' section is visible. It has a 'FUNCTION' dropdown menu currently set to 'Off'. Below this are two input fields: 'ZERO' and 'SPAN', both containing the value '0.0'. Further down is the 'ANALOG INPUTS B' section. Its 'FUNCTION' dropdown is set to 'Return Temp'. It also has 'ZERO' and 'SPAN' input fields, both containing '0.0'.

Figure 101: The Inputs Menu

To configure **ANALOG INPUTS A**, proceed as follows:

1. If either the **SUPPLY TEMPERATURE** or the **RETURN TEMPERATURE** has been set to **ACTIVE INPUT A** in the **ENERGY** tab, this will be the default value shown in the **FUNCTION** box. Enter the correct **ZERO** and **SPAN** values in the appropriate boxes.
2. If neither the **SUPPLY TEMPERATURE** nor the **RETURN TEMPERATURE** has been set to **ACTIVE INPUT A** in the **ENERGY** tab, **Off** is the default value shown in the **FUNCTION** box. No further action is required, unless the user chooses to change the default entry via the drop-down list. Only then would **ZERO** and **SPAN** values be required.

4.7.2 Programming the INPUTS Tab (cont.)

3. If **General Purpose** is chosen in the **FUNCTION** box, enter the correct **ZERO** and **SPAN** values in the appropriate boxes.

Program **ANALOG INPUTS B** using the same steps described for **ANALOG INPUTS A**.

4.7.3 Programming the OUTPUTS Tab

The **OUTPUTS** tab (see *Figure 102* below) enables the user to specify the **ANALOG OUTPUTS**, **DIGITAL OUTPUTS** and **MODBUS** parameters.

The screenshot shows the 'PROGRAM' menu with 'Program Options' selected. The 'OUTPUTS' tab is active, displaying three sections: 'ANALOG OUTPUTS', 'DIGITAL OUTPUTS', and 'MODBUS'.

ANALOG OUTPUTS

- MEASUREMENT:** CH1
- DATA SOURCE:** Amp Disc Up
- ZERO:** 0.0
- SPAN:** 0.0
- ERROR HANDLING:** Low

DIGITAL OUTPUTS

- FUNCTION:** Pulse
- MEASUREMENT:** AVE
- DATA SOURCE:** Inv Net Tot
- PULSE VALUE:** 0.0
- PULSE WIDTH:** 0 ms
- ERROR HANDLING:** Hold

MODBUS

- ADDRESS:** 0
- BAUD RATE:** 9600
- BITS PARITY:** 8 None
- STOP BITS:** 1 Bit

Figure 102: The Outputs Menu

4.7.3a Analog Outputs

To program the **ANALOG OUTPUTS**, complete the following steps:

1. Open the drop-down list in the **MEASUREMENT** box, and select either **CH1** (Channel 1), **CH2** (Channel 2), **Average** (Average of CH1 and CH2) or **General** (**General Function List**) for the output.
2. Open the drop-down list in the **DATA SOURCE** box, and select one of the available data source options from *Table 7* below.

Table 7: Available Output Data Sources

Standard Variables		
Channel 1 & Channel 2	AVE (Average)	GEN (General)
Velocity	Velocity	AI 1 Current
Volumetric	Volumetric	AI 2 Current
Standard Volumetric	Standard Volumetric	AI 1 Value
Mass	Mass	AI 2 Value
Batch Forward Totalizer	Batch Forward Totalizer	Power
Batch Reverse Totalizer	Batch Reverse Totalizer	Forward Energy
Batch Net Totalizer	Batch Net Totalizer	Reverse Energy
Batch Totalizer Time	Batch Totalizer Time	User Func 1
Inventory Forward Totalizer	Inventory Forward Totalizer	User Func 2
Inventory Reverse Totalizer	Inventory Reverse Totalizer	User Func 3
Inventory Net Totalizer	Inventory Net Totalizer	User Func 4
Inventory Totalizer Time	Inventory Totalizer Time	User Func 5
Diagnostic Variables		
CH1 (Channel 1) & CH2 (Channel 2) Only		
Sound Speed	Angle in Fluid	Peak Percent Down
Reynolds K-Factor	Gain Up	Signal Dynamic
Multi K-Factor	Gain Down	Signal Noise Ratio Up
Delta T	Partial Compression Up	Signal Noise Ratio Down
Active Time Up	Partial Compression Down	Signal Quality Up
Active Time Down	Peak Up	Signal Quality Down
Amplitude Discreet Up	Peak Down	Transit Time Up
Amplitude Discreet Down	Peak Percent Up	Transit Time Down

4.7.3a Analog Outputs (cont.)

3. In the **ZERO** box, enter the value which corresponds to a **4 mA** output.
4. In the **SPAN** box, enter the value which corresponds to a **20 mA** output.
5. Open the drop-down list in the **ERROR HANDLING** box, and select how the **PT900** should handle an analog output fault condition. The options are:
 - **Low** (force the output to 3.6 mA)
 - **High** (force the output to 21 mA)
 - **Hold** (hold the current output value)
 - **Other** (force the output to a user-supplied value)

4.7.3b Digital Outputs

To program the **DIGITAL OUTPUTS**, complete the following steps:

1. Open the drop-down list in the **FUNCTION** box, and select either **Off**, **Pulse**, **Frequency**, **Alarm** or **Gate** for the type of digital output desired.
 - a. If **Off** was selected in the **FUNCTION** box, no additional programming is required for the **DIGITAL OUTPUTS**.
 - b. If **Pulse** was selected in the **FUNCTION** box, the meter outputs a square wave pulse for each unit of flow passing through the pipeline.
 - Open the drop-down list in the **MEASUREMENT** box, and select either **CH1** (Channel 1), **CH2** (Channel 2), **Average** (Average of CH1 and CH2) or **General (General Function List)** for the output.
 - Open the drop-down list in the **DATA SOURCE** box, and select one of the following data source options: **Batch Forward Totalizer**, **Batch Reverse Totalizer**, **Batch Net Totalizer**, **Inventory Forward Totalizer**, **Inventory Reverse Totalizer** or **Inventory Net Totalizer**.
 - Enter the **PULSE VALUE** and **PULSE WIDTH** values in the appropriate boxes. These values vary depending on the **DATA SOURCE** selection.
 - Open the drop-down list in the **ERROR HANDLING** box, and select either **Hold** (hold the current value) or **Stop** (stop the output).

4.7.3b Digital Outputs (cont.)

- c. If **Frequency** was selected in the **FUNCTION** box:
- Open the drop-down list in the **MEASUREMENT** box, and select either **CH1** (Channel 1), **CH2** (Channel 2), **Average** (Average of CH1 and CH2) or **General (General Function List)** for the output.
 - Open the drop-down list in the **DATA SOURCE** box, and select the desired data source (see *Table 7 on page 89*).
 - In the **BASE VALUE** and **FULL VALUE** boxes, enter the minimum and maximum values for the selected data source.
 - In the **FULL FREQUENCY** box, enter the data value which corresponds to the **FULL VALUE** frequency.
 - Open the drop-down list in the **ERROR HANDLING** box, and select either **Low** (force the output to 0 kHz), **High** (force the output to 10 kHz), **Hold** (hold the last good value) or **Other** (force the output to a user-defined value).
- d. If **Alarm** was selected in the **FUNCTION** box:
- Open the drop-down list in the **MEASUREMENT** box, and select either **CH1** (Channel 1), **CH2** (Channel 2), **Average** (Average of CH1 and CH2) or **General (General Function List)** for the output.
 - Open the drop-down list in the **DATA SOURCE** box, and select the desired data source (see *Table 7 on page 89*).
 - Open the drop-down list in the **ALARM STATE** box, and select either **Normal** (normally-open contacts) or **Fail-Safe** (normally-closed contacts).
 - Open the drop-down list in the **ALARM TYPE** box, and select either **Low** (alarm activates if a measurement is less than or equal to the programmed **ALARM VALUE**), **High** (alarm activates if a measurement is greater than or equal to the programmed **ALARM VALUE**) or **Fault** (alarm activates on system fault condition).
 - In the **ALARM VALUE** box, enter the desired alarm trip point.

4.7.3b Digital Outputs (cont.)

- e. If **Gate** was selected in the **FUNCTION** box, no additional programming is required.

Note: *Gate is used to synchronize the totalizer with the meter calibration system. The gate stops and starts the meter totalizer, so that the user can compare the totalizer value with the measured volume of water in a tank.*

4.7.3c Modbus Outputs

The PT900 transmitter supports Modbus digital communication. To program the **MODBUS OUTPUT**, enter values for the following parameters in the appropriate boxes:

- **ADDRESS** (Default value is 1)
- **BAUD RATE** (Default value is 115200)
- **BITS PARITY** (Default value is 8 None)
- **STOP BITS** (Default value is 1 Bit)

4.7.4 Programming the USER FUNCTIONS Tab

The **USER FUNCTIONS** tab (see *Figure 103* below) enables the user to program mathematical equations which perform custom calculations on meter measurements. For example, any standard meter parameter can be used to calculate a new custom parameter.

PROGRAM
Program Options

ENERGY INPUTS OUTPUTS **USER FUNCTIONS**

SET USER FUNCTION

FUNCTION: User Func 1 LABEL: label1

UNITS SYMBOL: sym1 DECIMAL: 1

CH1_AMPup+tbl1(CH1_AMPup)

OPERATOR:)

4 5 6 7 8 9
0 . 1 2 3
SELECT DELETE SAVE

USER TABLES

TABLE: Table 1 LABEL: table1

EDIT TABLE SAVE TABLE

LOG DATA GO TO MEASURE

Figure 103: The User Functions Menu

4.7.4 Programming the USER FUNCTIONS Tab (cont.)

To program the **USER FUNCTIONS**, complete the following steps:

1. Open the drop-down list in the **FUNCTION** box, and select the desired *function number* (**User Func 1** through **User Func 5**).
2. In the **LABEL** box, enter a name for the function. A good choice would be the measurement type (e.g., velocity, temperature, etc.).
3. In the **UNITS SYMBOL** box, enter the units of measure for the function (e.g., feet/sec, degrees F, etc.).
4. Open the drop-down list in the **DECIMAL** box, and select the desired number of decimal places for the function value (**0** to **4**).
5. Define the *User Function* by completing the following steps:
 - a. Open the drop-down list in the **OPERATOR** box, and select the desired mathematical operator (see *Table 8* below for the available options). These operators are used as building blocks to create your function.

Table 8: Available Mathematical Operators

+	-	*	/	^
(	)	E	MODE	exp
abs	inv	ln	log	sqrt
sin	cos	tan	asin	acos
atan	tbl1	tbl2	tbl3	tbl4

- b. Click the desired *mathematical operator* in the list.
- c. If your selection is a *mathematical function*, click the **MODE** operator in the table, and enter your desired *data source* and *channel*. Then, click the **SELECT** button to *confirm* your selections or click the **DELETE** button to *cancel* them.
- d. After you have completed defining your function from the available operators, click the **SAVE** button to save the user function to the PT900 memory.

4.7.4 Programming the USER FUNCTIONS Tab (cont.)

6. Define a *User Table* by completing the following steps:
 - a. Open the drop-down list in the **TABLE** box, and select a *table number* (**Table 1** through **Table 4**).
 - b. In the **LABEL** box, enter a *name* for the table.
 - c. Click the **EDIT TABLE** button to open a blank table, as shown in *Table 9* below. Then, enter your data in the table.

Table 9: User Table

USER TABLES		
Number of rows		10
	X	Y
1		
2		
3		
4		
5		
6		
7		
8		
9		
10		

OK
Cancel

- d. After you have completed the data entry in the table, click the **SAVE TABLE** button to save the user table to the PT900 memory.

Important: *You have now completed the programming of the **USER FUNCTIONS** menu. Click on the **GO TO MEASURE** button to change to the measurement display or click the **LOG DATA** button to begin logging data.*

[no content intended for this page]

Chapter 5. Measurements

5.1 Introduction

The PT900 is a transit-time ultrasonic flow meter. During signal processing, many different system parameters are measured or calculated. The PT900 APP provides the user a powerful tool for monitoring these parameters in real-time.

From the initial APP screen, click on the **MEASURE**  icon to display a screen similar to *Figure 104* below. If the system is **ONLINE**, all of the displayed values are real-time values, but if the system is **OFFLINE**, the displayed values are the last values obtained when the system was **ONLINE**.

Note: In iOS application, *HELP* button is available in the measure screen to access the help screen easily.(marked in red in below image)

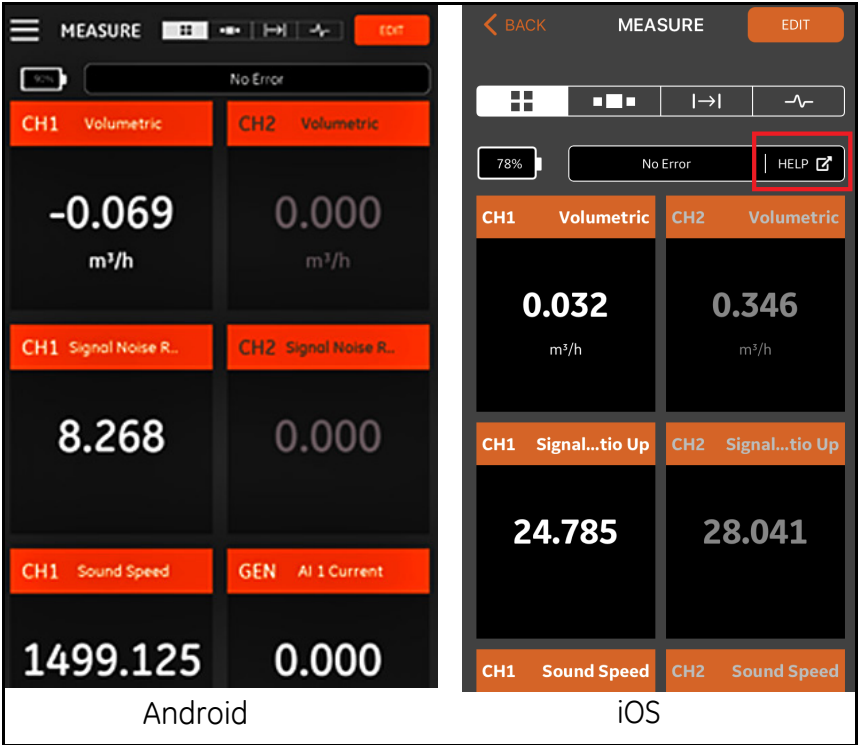


Figure 104: Typical Measurement Screen

5.2 Setting Up the Measurements for Display

The PT900 APP can display up to 10 different variables at the same time. To set up your display screen, click the **EDIT** button at the top right of the measurement screen to open the **SET UP MEASUREMENTS** menu, as shown in *Figure 105* below.

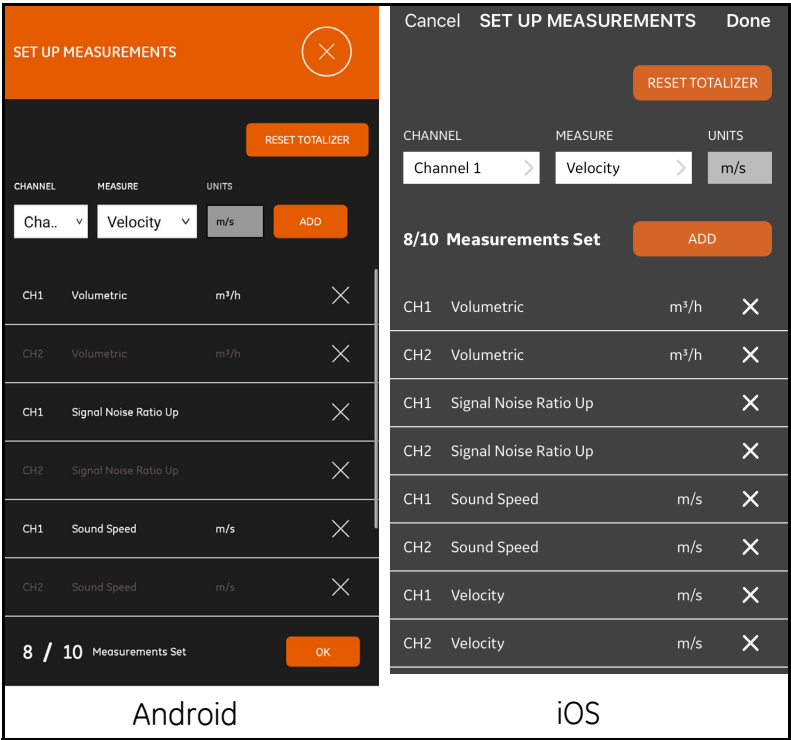


Figure 105: Set Up Measurements Menu

To set up your display measurements, complete the following steps:

1. Open the drop-down list in the **CHANNEL** box and select either **CH1**, **CH2**, **Average** or **General** as the channel to be displayed.
2. Open the drop-down list in the **MEASURE** box and select the desired measurement variable from the list (see *Table 10 on page 99* for the options).

5.2 Setting Up the Measurement Screen (cont.)

Table 10: Available Measurement Variables

Standard Variables		
Channel 1 & Channel 2	AVE (Average)	GEN (General)
Velocity	Velocity	AI 1 Current
Volumetric	Volumetric	AI 2 Current
Standard Volumetric	Standard Volumetric	AI 1 Value
Mass	Mass	AI 2 Value
Batch Forward Totalizer	Batch Forward Totalizer	Power
Batch Reverse Totalizer	Batch Reverse Totalizer	Forward Energy
Batch Net Totalizer	Batch Net Totalizer	Reverse Energy
Batch Totalizer Time	Batch Totalizer Time	User Func 1
Inventory Forward Totalizer	Inventory Forward Totalizer	User Func 2
Inventory Reverse Totalizer	Inventory Reverse Totalizer	User Func 3
Inventory Net Totalizer	Inventory Net Totalizer	User Func 4
Inventory Totalizer Time	Inventory Totalizer Time	User Func 5
Diagnostic Variables		
CH1 (Channel 1) & CH2 (Channel 2) Only		
Sound Speed	Angle in Fluid	Peak Percent Down
Reynolds K-Factor	Gain Up	Signal Dynamic
Multi K-Factor	Gain Down	Signal Noise Ratio Up
Delta T	Partial Compression Up	Signal Noise Ratio Down
Active Time Up	Partial Compression Down	Signal Quality Up
Active Time Down	Peak Up	Signal Quality Down
Amplitude Discreet Up	Peak Down	Transit Time Up
Amplitude Discreet Down	Peak Percent Up	Transit Time Down

- Note that the **UNITS** box is grayed out, as the units are determined by your choices in the **Units Options** menu (see “*Configuring the Units of Measurement*” on page 63).
- Click the **ADD** button to add your new measurement to the real-time measurement set.

5.2 Setting Up the Measurement Screen (cont.)

5. To delete a measurement from the measurement set, click the  button to the right of the desired measurement.
6. Note that the number of measurements currently in the list and the maximum allowed number of measurements (10) are displayed. If you already have 10 measurements listed, you must delete a measurement from the list before you can add a new measurement.
7. At any time, you may reset the batch totalizer to zero by clicking the **RESET TOTALIZER** button.
8. Click the **OK** button or **Done** button(iOS) to close the set up menu and return to the measurement display screen.

5.3 Viewing Measurements

In *Figure 106* below, note that **CH1** has been turned **On** and **CH2** has been turned **Off** in the **PROGRAM** menu. Also, no **AI** source is connected to the **General** channel, because the value is zero.

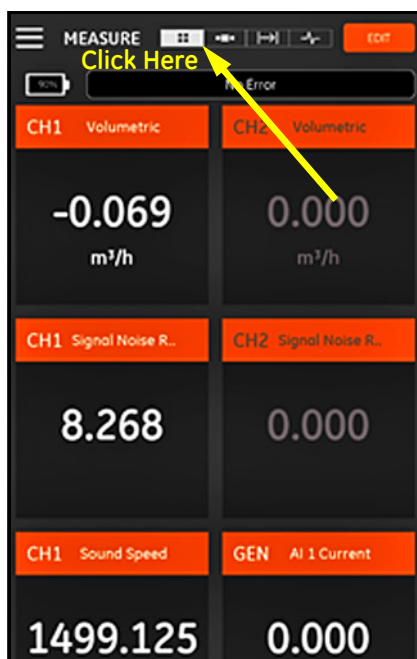


Figure 106: Multiple Measurement Screen

5.3 Viewing Measurements (cont.)

Clicking any measurement on the measurement screen will open a popup dialog box for changing the decimal format for that measurement (see *Figure 107* below).

1. Select the desired *decimal format* from the drop-down list.
2. Select the desired number of *decimal places* from the drop-down list.
3. Click **OK** to confirm the selections, or click **CANCEL** to discard the changes.



Figure 107: Setting the Decimal Format

5.3.1 Displaying Multiple Measurements

The default measurement screen is a *multi-measurement* format, which means that all measurements which have been set up are displayed on one page with scrolling capability. An indication of this display type is the highlighted  icon at the top of the screen (see *Figure 106 on page 100*). Note the following:

- You may click the **EDIT** button at the top right of the screen at any time to open the **SET UP MEASUREMENTS** menu.
- An *Error Status* box is located just above the measurement display section of the screen. If there are no system errors, **No Error** is displayed (see *Figure 106 on page 100*). However, if a system error does occur, the error information is displayed in this location with a flashing red background.

5.3.2 Displaying a Single Measurement

To change the screen to a one-measurement display (see *Figure 108* below), click the  icon. In this mode, one measurement is displayed at a time and you can switch between available measurements by swiping across the screen left or right.

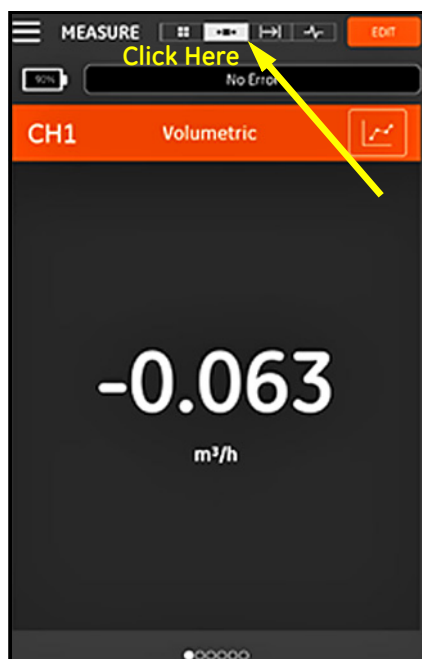


Figure 108: Single Measurement Screen

5.3.2 Displaying a Single Measurement (cont.)

Note the following:

- The default one-measurement display is the numeric value of the real-time measurement, as shown in *Figure 108 on page 102*.
- To switch the display to **GRAPH** mode, click the  icon at the top right of the screen. As shown in *Figure 109* below, the values of the measurement as a function of time are displayed as a graph.



Figure 109: Graph Measurement Screen

- To switch the display back to **NUMERIC** mode, click the  icon at the top right of the screen.

5.3.2 Displaying a Single Measurement (cont.)

- When in **GRAPH** mode, click the **SETTING** button just above the graph to open the **SET Y AXIS** menu shown in *Figure 110* below.

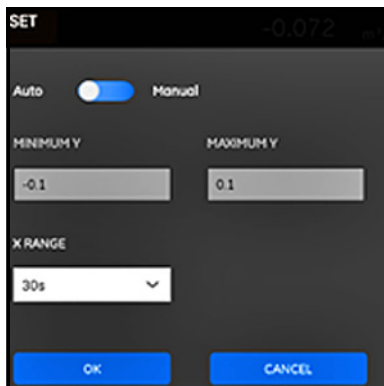


Figure 110: Graph Parameters Menu

To edit the parameters for the Y axis, complete the following steps:

1. Move the slide switch to **Manual**.
2. The **Min Y** and **Max Y** text boxes are now active. You may now enter your desired values in these text boxes.
3. After editing the values, click the **OK** button and the new values will take effect, or click the **CANCEL** button to keep the old values.

5.3.3 Displaying the Totalizer Screen

The *Batch Totalizer* is used for measuring the total volume of fluid which passes the measurement point over a period of time. This can be done automatically by using the external *Digital Output Gate* (see “*Digital Outputs*” on page 90) or it can be done manually.

For manual operation, refer to *Figure 111* below and proceed as follows:

1. From the measurement screen, click on the  icon at the top of the screen.
2. To start the batch totalizer, click the **START** button. Note that while the totalizer is running, the **START** button is replaced by a **STOP** button.
3. To stop the batch totalizer, click the **STOP** button. Note that when the totalizer is not running, the **STOP** button is replaced by a **START** button.
4. At any time, you may reset the batch totalizer to zero by clicking the **RESET** button. Note that this resets only the batch totalizer.

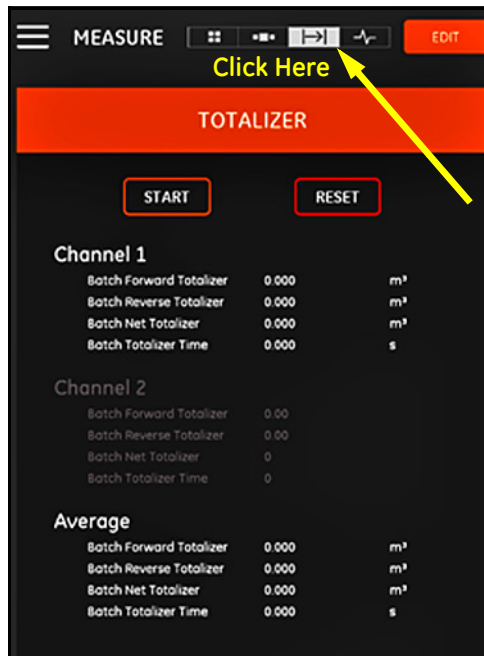


Figure 111: Totalizer Screen

5.3.4 Displaying the Diagnostics Parameters

During operation, the PT900 measures various system parameters for the purpose of analyzing the system performance. These system diagnostic parameters are listed in the **DIAGNOSTICS** measurement screen (see *Figure 112* below). To access this screen, click the  icon at the top of the measurement screen.

After you have finished viewing the diagnostic parameters, click the appropriate icon at the top of the screen to return to the measurement display.

Note: *In the screen below, Channel 1 is active and Channel 2 is inactive. Also, all the signal diagnostic parameters are within their normal range, as indicated by the green check marks to the right of each parameter.*

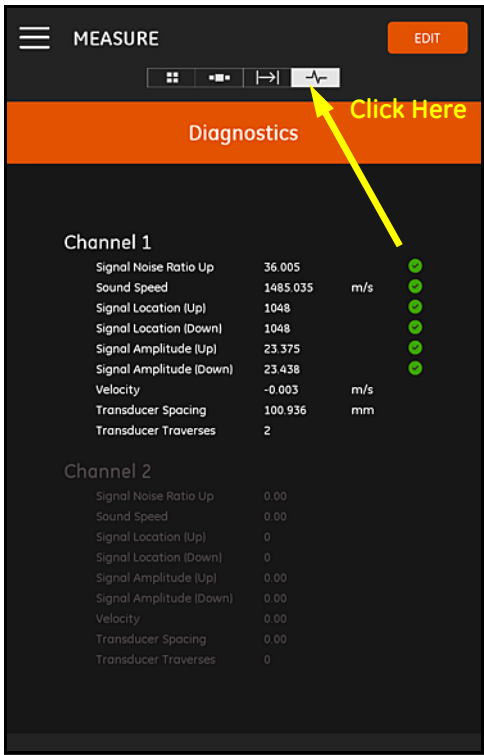


Figure 112: Diagnostics Measurement Screen

Chapter 6. Logging Data

6.1 Introduction

The PT900 transmitter supports an easy-to-use data logging function, which allows diagnostic and measurement data to be recorded in a log file. To create a log file, the following parameters must be specified:

- The following *Channels* are available for logging:
 - **CHANNEL 1** (34 available variables)
 - **CHANNEL 2** (34 available variables)
 - **Average CHANNEL** (12 available variables)
 - **General CHANNEL** (10 available variables)
- See *Table 10 on page 99* for a complete list of the measurement variables available for each of the above channels.
- The *start time and date*, *end time and date*, and the *time interval* must be specified for the log.
- The logged data file is recorded in .CSV format. The log files can be accessed via the PT900 USB port, and they can be opened with most common text editors.
- The time interval, the length of the logging run and the number of logs all affect the total amount of memory required to store all of your log files. The total memory usage and the remaining unused memory can be viewed in the **TRANSMITTER STORAGE** menu.

6.2 Adding a Log

The **LOG** function can be accessed from the APP main menu. When you enter the **LOG** function for the first time, you will see the message shown in *Figure 113* below.

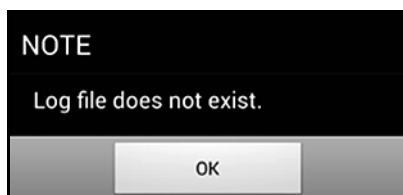


Figure 113: Initial Log Screen

Important: *Before creating a new log, be sure to synchronize the transmitter and the tablet time settings by clicking the **DATE & TIME** button in the **TRANSMITTER** menu (see Figure 118 on page 116).*

Just click the **OK** button to open the **ADD LOG** menu shown in *Figure 114* below.

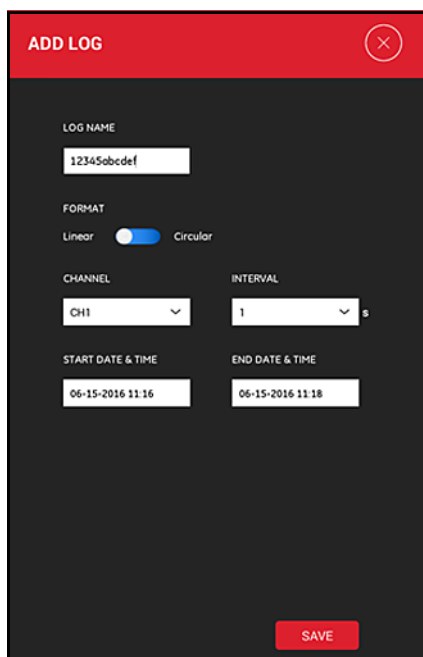


Figure 114: ADD LOG Menu

6.2 Adding a Log (cont.)

Program the new log parameters as shown in *Table 11* below:

Table 11: Programming the Log Parameters

Parameter	Entry Type	Description
LOG NAME:	Manual entry	11 characters maximum
FORMAT:	Slide switch	Linear: Record all values from start time to end time Circular: After 100 values are recorded, the oldest value is deleted before a new value can be added.
CHANNEL	Drop-down list	CH1, CH2, Average, General (see <i>Table 10 on page 99</i> for the available measurement variables).
INTERVAL:	Drop-down list	1-20 sec (the time between each pair of consecutive values).
START DATE & TIME:	Manual entry	When the log starts
END DATE & TIME:	Manual entry	When the log stops

Note the following:

- The PT900 transmitter will only start the log if the programmed **START DATE & TIME** arrives and the transmitter is powered **On** at that time.
- The programmed **END DATE & TIME** must occur after the programmed **START DATE & TIME**, or an error message is displayed.
- There is no defined limit for either the total number of logs or for the size of an individual log stored in the transmitter, but the total available amount of log storage memory is limited to the PT900 storage capacity.

6.3 Deleting, Stopping or Editing a Log

In the LOGS main menu (see *Figure 115* below), all existing logs and their current status are listed. Each listed log may be edited, stopped or deleted, depending on their current status.

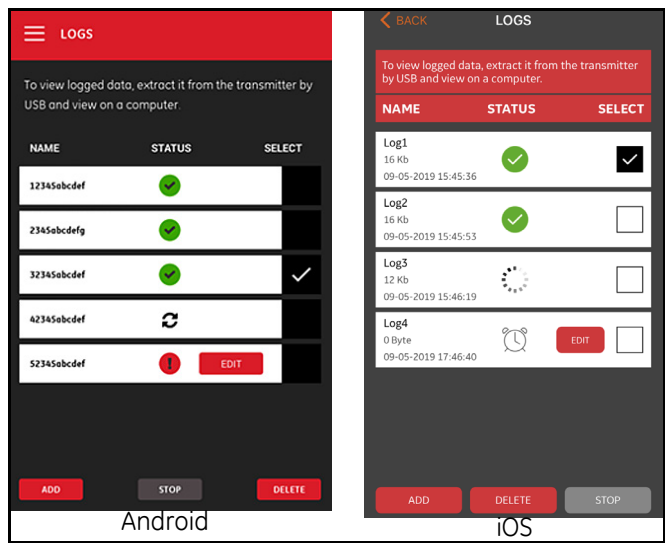


Figure 115: LOGS Main Menu

Each listed log has one of the following three status designations:

Table 12: Log Status

Status	Android Icon	iOS Icon	Explanation
Pending			This icon means the log is Pending , because the <i>start time</i> has not yet arrived. In this status, you can EDIT , DELETE but cannot STOP the log. STOP icon will be disabled in iOS for pending logs.
Stopped			This icon means the log is Stopped , because the <i>end time</i> has passed or the user has stopped it. In this status, you can only DELETE the log.
Running			This icon means the log is Running , because the <i>end time</i> has not yet arrived. In this status, you can only STOP the log prior to the end time.

6.3.1 Deleting a Log

To **DELETE** a **Pending** or **Stopped** log, complete the following steps:

1. On the **LOGS** main menu (see *Figure 115 on page 110*), click in the **SELECT** column to the right of the log you wish to delete.
2. Verify that the  icon is shown to the right of the log you wish to delete.
3. Click the **DELETE** button to delete the selected log.

6.3.1a Stopping a Log


To **STOP** a **Pending** or **Running** log, complete the following steps:

1. On the **LOGS** main menu (see *Figure 115 on page 110*), click in the **SELECT** column to the right of the log you wish to stop.
2. Verify that the  icon is shown to the right of the log you wish to stop.
3. Click the **STOP** button to stop the selected log.

6.3.2 Editing a Log

To **EDIT** a **Pending** log, complete the following steps:

1. On the **LOGS** main menu (see *Figure 115 on page 110*), click in the **SELECT** column to the right of the log you wish to edit.
2. Verify that the  icon is shown to the right of the log you wish to stop.
3. Click the **EDIT** button to open the EDIT LOG menu shown in *Figure 116* below.

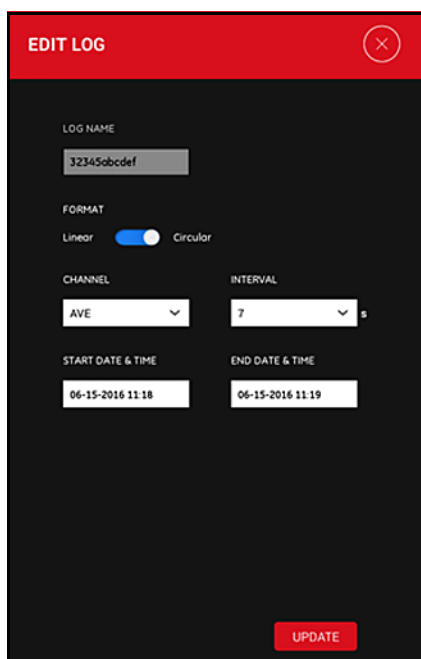

EDIT LOG

LOG NAME
32345abcdef

FORMAT
Linear ☒ Circular ☐

CHANNEL
AVE

INTERVAL
7 s

START DATE & TIME
06-15-2016 11:18

END DATE & TIME
06-15-2016 11:19

UPDATE

Figure 116: The EDIT LOG Menu

4. Edit any of the log parameters in the above menu using the same instructions given in “*Adding a Log*” on page 108.
5. After your edits are complete, click **UPDATE** button to save your changes.

6.3.3 Viewing a Log

The logged data is stored in the PT900 transmitter. This data can be accessed from a PC via a USB connection.

To view a log, complete the following steps:

1. Be sure the transmitter and tablet time settings are synchronized by setting the transmitter time in the **TRANSMITTER > DATE & TIME** menu (see *Figure 118 on page 116*).
2. Unplug the USB cable and plug it back in after the PT900 transmitter is powered On.
3. Unplug the USB cable and plug it back in after completing a log. You can then access the finished log on the PT900.

[no content intended for this page]

Chapter 7. Configuring the Transmitter

7.1 Introduction

To configure the PT900 transmitter, click the **TRANSMITTER** icon in the APP main menu (see *Figure 117* below).

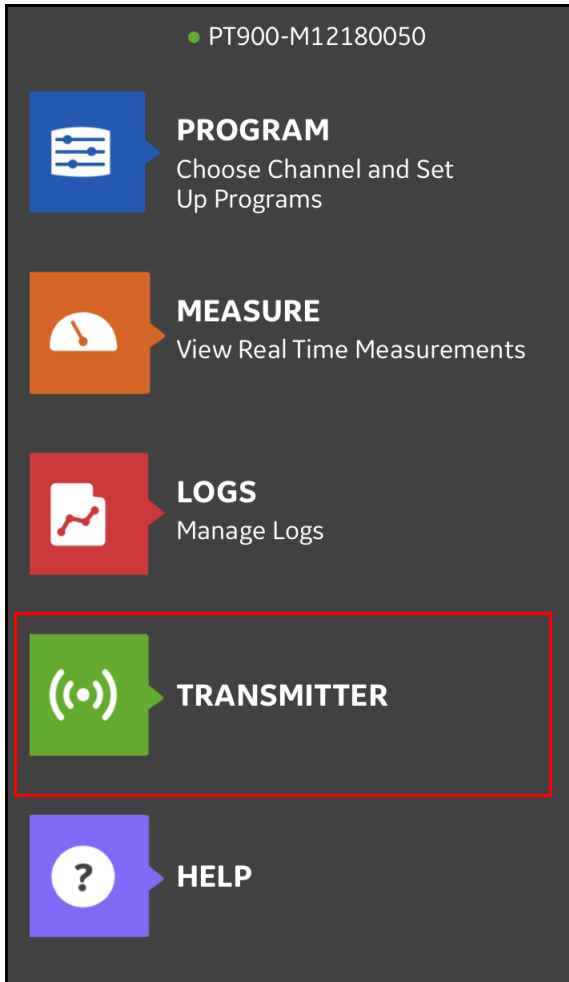


Figure 117: The Transmitter Menu

7.1 Introduction (cont.)

If a PT900 transmitter is **CONNECTED** to the tablet APP via *Bluetooth*, the **TRANSMITTER** menu shows device information about the PT900 transmitter, the battery and the memory usage. However, if the connection is **OFFLINE**, this information is unavailable. See examples of both possibilities in *Figure 118* below.

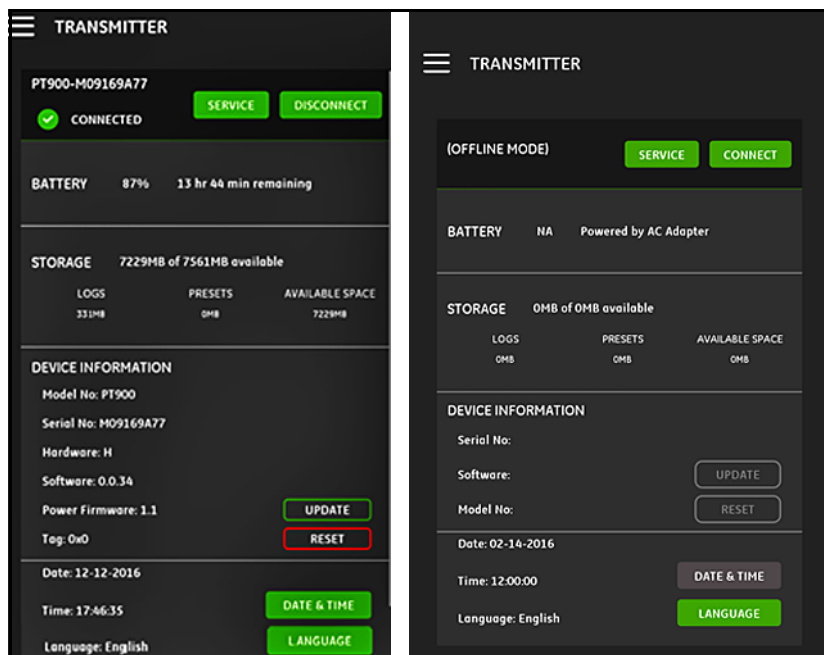


Figure 118: CONNECTED (Left) and OFFLINE (Right) Menus

The above menus include the following items:

- The **CONNECT/DISCONNECT** button is used to connect a transmitter which is currently **OFFLINE** or to **DISCONNECT** a transmitter which is currently **ONLINE**.
- The **SERVICE** button is used to configure transmitter functions.

7.1 Introduction (cont.)

- The **BATTERY** section shows the remaining battery time for an **ONLINE** transmitter (not available for an **OFFLINE** transmitter).
- The **STORAGE** section shows the current memory usage for **Logs** and **Presets** and the remaining unused embedded storage memory for an **ONLINE** transmitter (not available for an **OFFLINE** transmitter).
- The **DEVICE INFORMATION** section shows the **Serial Number**, **Software Version** and **Model Number** for an **ONLINE** transmitter (not available for an **OFFLINE** transmitter).

Note: *If a firmware update is needed, upload the new firmware file to the transmitter via the USB connection, then click the **UPDATE** button. The transmitter is unavailable during the update and it will automatically reboot when the update is complete. After the reboot, the transmitter will be **OFFLINE**.*

- The **RESET** button enables the user to reset the transmitter remotely (not available for an **OFFLINE** transmitter).

Note: *Resetting the transmitter erases all **PRESETS** and **LOGS**, but all factory calibrated data is kept. After the reset, the transmitter will be **OFFLINE**., and a warning message is displayed as a reminder.*

- The **DATE & TIME** button is used to set the transmitter's *Real Time Clock (RTC)*. This date and time are synchronized with tablet settings.
- The **LANGUAGE** button is used to select the language used by the tablet APP. The languages listed in *Table 13* below are supported:

Table 13: Supported APP Languages

• English	• Français	• Castellano
• 中文	• Nederlands	• Português
• Deutsch	• ? ? ?	• Español
• 日本語	• Svenska	• Türkçe
• Italiano	• Русский	• العربية

7.2 Updating the PT900 Transmitter Software

To update the PT900 transmitter software, complete the following steps:

1. Obtain the image file (`ipl-ifs-PT900_vx.x.xx_svnxxx.bin`) for the new PT900 software version.
2. Rename the new image file as **image.bin**.
3. Copy the new `image.bin` file to the PT900 from a PC, using a USB cable as shown in *Figure 119* below.

Note: *If an old `image.bin` file is already on the PT900, overwrite it.*



Figure 119: USB Cable Connected to the Transmitter

Note: *The `image.bin` file should be copied to the root directory of the PT900, as shown in *Figure 120* below.*

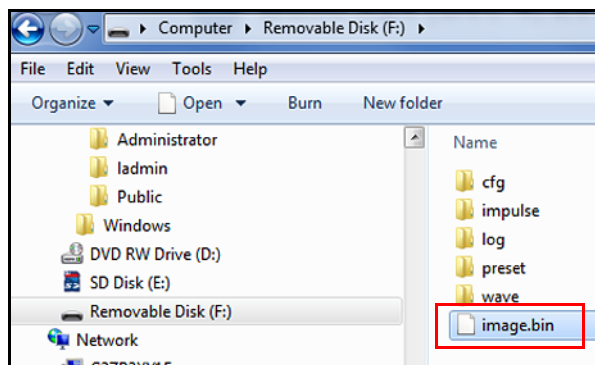


Figure 120: `Image.bin` File Location on PT900

7.2 Updating the PT900 Software (cont.)

4. In the APP TRANSMITTER menu, click the **UPDATE** button (see *Figure 121* below) to start the update.

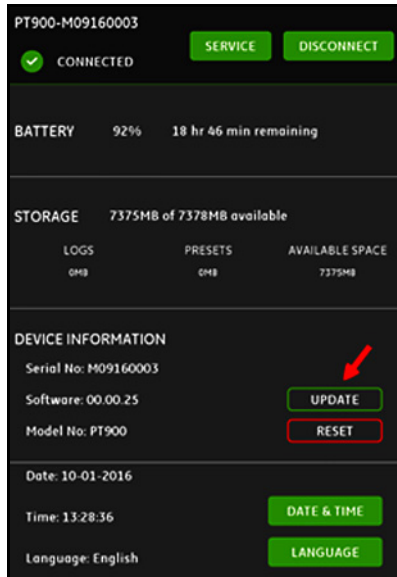


Figure 121: UPDATE Button in TRANSMITTER Menu

The system will check the validation of the new image file by checksum. If the check is **OK**, the *new* software will load in the next reboot. If the check is **NO**, the *original* software will load in the next reboot.

5. At the screen shown in *Figure 122* below, click the **OK** button to confirm the update and continue.

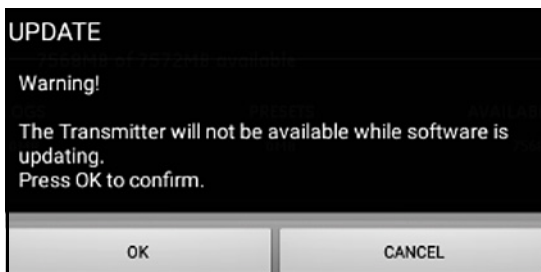


Figure 122: Update Confirmation Screen

7.2 Updating the PT900 Software (cont.)

The update will take about 30 seconds to complete, and the screen shown in *Figure 123* below will be displayed during the update.

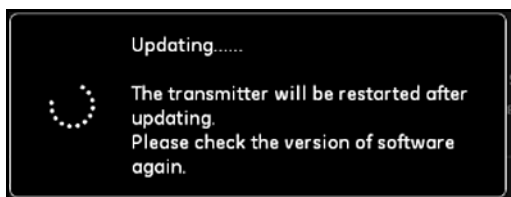


Figure 123: Update in Progress Screen

6. After the transmitter reboots, the message shown in *Figure 124* below will pop up. Click the **OK** button to reconnect the transmitter.

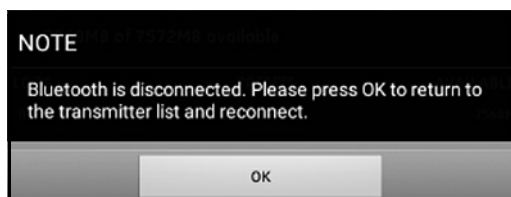


Figure 124: Transmitter Reconnection Screen

7. Go to the **TRANSMITTER** menu (see *Figure 118* on page 116) and verify that the device information is correct.

If you had any problems during the update, make sure that the following conditions were met:

- Make sure that the power is always **ON** during an update, and check that the battery capacity is > 20% or the AC power adapter is connected.
- Make sure that the transmitter is **NOT** in configure mode. It must be in either **IDLE** or normal measurement mode.
- If you want to reinstall your old system **Presets**, do not delete the preset directory on the PT900.
- If you want the original factory settings, click **RESET**.
- Sometimes, the new software will include a new version of the factory **Presets**. If so, the old **Presets** will automatically be overwritten by new ones during the update.

7.3 Programming the Transmitter SERVICE Menu

The transmitter **SERVICE** menu includes the following sub-menus:

- **CALIBRATION** (see page 121)
- **METER SETUP** (see page 124)
- **TESTING** (see page 127)
- **ERROR LIMITS** (see page 130)

7.3.1 Programming the CALIBRATION Menu

The **CALIBRATION** option (see Figure 125 below) is used to calibrate the transmitter's **ANALOG OUTPUT** and the **ANALOG INPUT**.

Important: *The **CALIBRATION** function only works if the transmitter is **ONLINE**.*

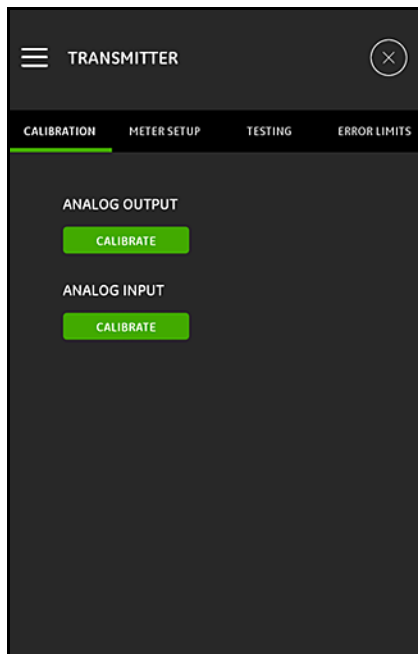


Figure 125: The Calibration Menu

7.3.1a Calibrating the ANALOG OUTPUT Option

To calibrate the transmitter **ANALOG OUTPUT**, refer to *Figure 126* below and complete the following steps:

1. Click the **CALIBRATE** button to open the **ANALOG OUTPUT CALIBRATION** menu.
2. Move the slide switch to the **4 mA** position.
3. In the **Actual 4 mA** text box, enter the output current actually measured with a digital ammeter at the transmitter's analog output.
4. Click the **ADJUST** button to perform the calibration or click the **CANCEL** button to discard the new value.
5. Move the slide switch to the **20 mA** position.
6. In the **Actual 20 mA** text box, enter the output current actually measured with a digital ammeter at the transmitter's analog output.
7. Click the **ADJUST** button to perform the calibration or click the **CANCEL** button to discard the new value.
8. Click the **RESET** button to reset both the 4mA and 20mA calibrations.

The figure displays two side-by-side screenshots of the 'ANALOG OUTPUT CALIBRATION' menu. The left screen is for the 4 mA calibration, showing a 'SET POINT' toggle switch set to '4 mA' and an 'ACTUAL 4 mA' input field with the value '4.0'. The right screen is for the 20 mA calibration, showing the 'SET POINT' toggle switch set to '20 mA' and an 'ACTUAL 20 mA' input field with the value '20.0'. Both screens feature 'ADJUST' and 'CANCEL' buttons at the bottom.

Figure 126: 4 mA (Left) and 20 mA (Right) Calibration Menus



WARNING! Transmitter remains in configure mode when the App is killed from calibration screen

7.3.1b Calibrating the ANALOG INPUT Option

To calibrate the transmitter **ANALOG INPUT**, refer to *Figure 127* below and complete the following steps:

1. Click the **CALIBRATE** button to open the **ANALOG INPUT CALIBRATION** menu.
2. Move the first slide switch to the **AI 1** position.
3. Connect a **4 mA calibrated current source** to the transmitter's analog input.
4. Move the next slide switch to the **4 mA** position.
5. In the **4 mA** text box, the input current measured by the PT900 transmitter is displayed (see **Before** screen below).
6. Click **ADJUST** to perform the calibration or click **CANCEL** to discard the displayed value. After clicking the **ADJUST** button, the current value displayed in the 4 mA text box should be much closer to 4 mA (see **After** screen below).
7. Repeat steps 2-6 to calibrate the **4 mA** and **20 mA** inputs for **AI 1** and **AI 2**.
8. Click the **RESET** button to reset all the analog input calibrations.

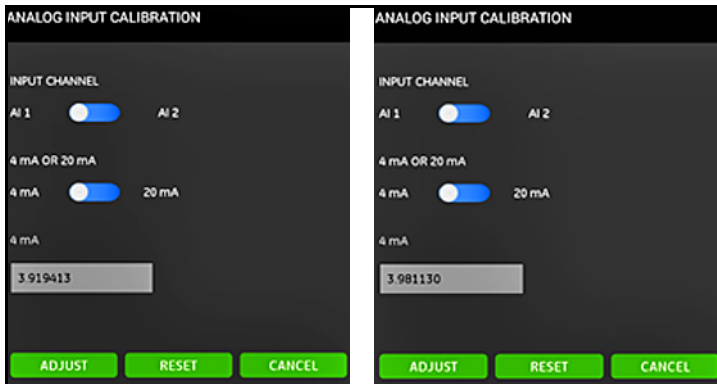


Figure 127: Before (Left) and After (Right) 4 mA Values

7.3.2 Programming the METER SETUP Menu

The **METER SETUP** option (see *Figure 128* below) is used to configure the following PT900 system parameters (see the following section for instructions):

- TOTALIZER
- RESPONSE TIME
- POWER SAVING MODE
- POWER SAVING TIME
- PEAK DETECTION METHOD
- PEAK THRESHOLDS

The screenshot shows the 'TRANSMITTER' interface with a menu bar at the top containing 'CALIBRATION', 'METER SETUP' (highlighted with a green underline), 'TESTING', and 'ERROR LIMITS'. Below the menu bar, the 'TOTALIZER' section includes a green 'RESET' button. The 'RESPONSE' dropdown is set to 'Custom', and the 'RESPONSE TIME' dropdown is set to '5s'. The 'POWER SAVING MODE' section features a toggle switch currently in the 'On' position. The 'MEASUREMENT TIME' dropdown is set to '5 min', and the 'SLEEP TIME' dropdown is set to '30 min'. The 'PEAK DETECT' dropdown is set to 'Threshold', and the 'THRESHOLD DETECT' dropdown is set to 'Auto'.

Figure 128: The METER SETUP Menu

7.3.2a Programming the **TOTALIZER** Option

The **TOTALIZER** option enables the user to reset the values of all batch and inventory totalizers (i.e., Forward Totalizer, Reverse Totalizer, Net Totalizer and Totalizer Time) in all channels to zero by clicking the **RESET** button.

The **RESPONSE** option enables the user to choose the time interval in seconds between any two measurements:

- If **Custom** is selected from the drop-down list, the following options are available: 1s, 2s, 5s, 10s, 30s, 60s, 100s, 200s, 300s or 500s.
- If **Fast** is selected from the drop-down list, the default time interval is used.

7.3.2b Programming the **POWER SAVING MODE** Option

The **POWER SAVING MODE** slide switch changes the PT900 transmitter into a power saving measurement mode. After turning the **POWER SAVING MODE** to **On**, the following parameters must be set:

- From the **MEASUREMENT TIME** drop down list, select one of the following options: 5min, 10min, 20min, 30min or 60min.
- From the **SLEEP TIME** drop down list, select one of the following options: 30min, 60min, 90min, 120min, 150min, 180min, 210min or 240min.

For example if the **MEASUREMENT TIME** is 5 min and the **SLEEP TIME** is 30 min, the PT900 transmitter would take measurements for 5 minutes and then sleep for 30 minutes, before repeating the cycle.

7.3.2c Programming the **PEAK DETECT** Option

From the drop-down list in the **PEAK DETECT** option, select the desired method for identifying the peak of the received signal. The following options are available:

- The **PEAK** method is no longer available.
- With the **THRESHOLD** method, the peak is identified as the point where the signal crosses a threshold that is a percentage of the maximum signal detected. This method is more reliable in marginal signal conditions.

7.3.2d Programming the **THRESHOLD** Option

If the **THRESHOLD** method is selected in the **PEAK DETECT** option, the **THRESHOLD DETECT** parameter must be configured. From the drop-down list, select one of the following options:

- With the **Auto** method, the threshold is detected automatically.
- With the **Manual** method, the minimum and maximum threshold percentage (0 to 100%) must be input. The **Peak Percentage** is also required.

7.3.2e Saving Your Settings

Important: *Be sure to click the **SAVE** button before leaving the **METER SETUP** menu, or all of your settings will be discarded.*

7.3.3 Programming the TESTING Menu

The **TESTING** menu (see *Figure 129* below) is used to ensure that the PT900 is performing properly. The following tests are included:

- **WATCHDOG METER**
- **WAVE SAMPLE CHANNEL**

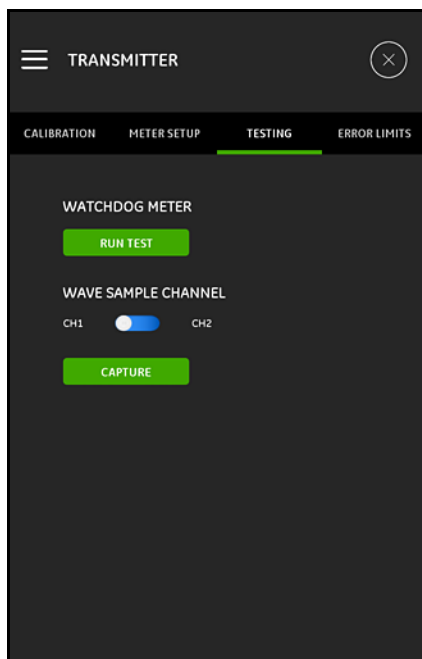


Figure 129: The TESTING Menu

7.3.3a Running the Watchdog Test

The PT900 transmitter includes a **Watchdog Timer Circuit**. This circuit automatically resets the transmitter. Proceed as follows:

1. Click the **RUN TEST** button in the **TESTING** menu (see *Figure 129 on page 127*).
2. A properly functioning PT900 restarts if the **Watchdog Test** is run, and a warning message similar to *Figure 130* below is displayed.

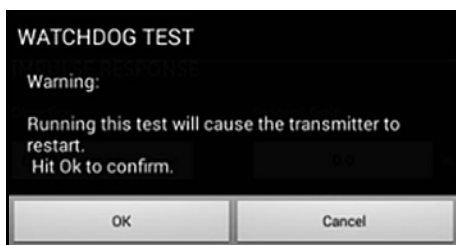


Figure 130: Watchdog Test Warning

3. Click the **OK** button to proceed with the test or click the **Cancel** button to abort the test.

Important: *The PT900 transmitter is disconnected from the tablet after the reset. You must reconnect them via Bluetooth before further use.*

7.3.3b Testing with the Wave Sample Channel

The **WAVE SAMPLE CHANNEL** test captures signals and displays them in a graph similar to *Figure 131* below. Click the **DOWNLOAD** button to save the screen capture to the <internal storage of tablet>/TransPort/ScreenShot folder.

Important: *Wave samples are only required for troubleshooting with GE's guidance.*

Note: *"If permission of photos is not available while saving the waveform and the user tries to change it from settings, the App will restart."*

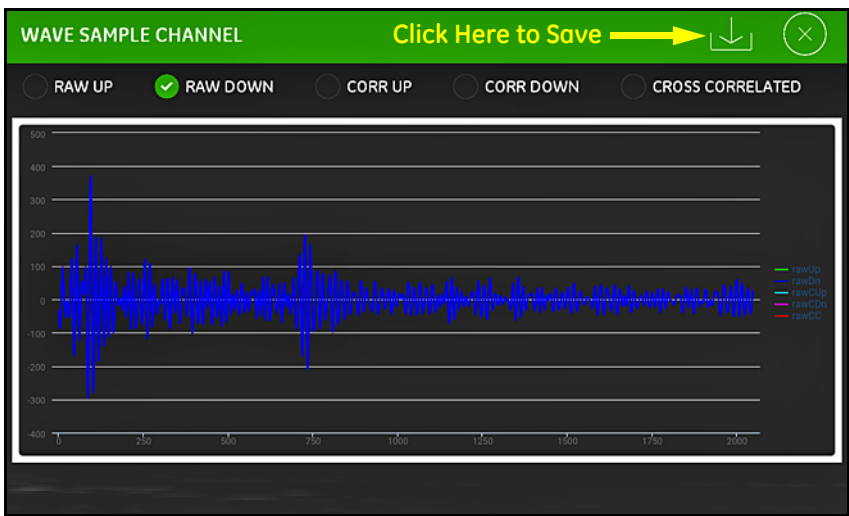


Figure 131: Wave Sample Channel Capture

7.3.4 Programming the ERROR LIMITS Menu

The **ERROR LIMITS** menu (see *Figure 132* below) enables the user to set limits for an incoming signal. When the signal falls outside these programmed limits, an error indication is displayed on the **MEASUREMENT** screen.

The screenshot shows the 'ERROR LIMITS' menu within the 'TRANSMITTER' application. The menu is titled 'TRANSMITTER' at the top, with a hamburger menu icon on the left and a close icon on the right. Below the title bar, there are four tabs: 'CALIBRATION', 'METER SETUP', 'TESTING', and 'ERROR LIMITS', with the latter being the active tab. The main content area is divided into several sections, each with a title and input fields:

- VELOCITY**: Contains two input fields, 'MIN LIMIT' and 'MAX LIMIT'. The 'MIN LIMIT' field is set to '-12.0' and the 'MAX LIMIT' field is set to '12.0'. Both fields have a unit of 'm/s' to their right.
- AMPLITUDE**: Contains two input fields, 'MIN LIMIT' and 'MAX LIMIT'. The 'MIN LIMIT' field is set to '14.0' and the 'MAX LIMIT' field is set to '30.0'.
- SOUND SPEED (+/-)**: Contains a single input field set to '20.0' with a unit of '%' to its right.
- ACCELERATION**: Contains a single input field set to '15.0' with a unit of 'm/s²' to its right.
- COMPRESSION RATIO**: Contains a single input field set to '1.05'.
- SOS VARIATION RATE**: Contains a single input field set to '1.0' with a unit of 'm/s' to its right.

At the bottom of the menu, there is a green 'SAVE' button.

Figure 132: The ERROR LIMITS Menu

7.3.4 Programming the ERROR LIMITS Menu (cont.)

To program the **ERROR LIMITS** menu, complete the following steps:

1. In the **VELOCITY** section, enter the desired **MIN LIMIT** and **MAX LIMIT** values in the appropriate text boxes. If the measured velocity is outside these limits, the **E3: VELOCITY RANGE** message is displayed on the measurement screen.
2. In the **AMPLITUDE** section, enter the desired **MIN LIMIT** and **MAX LIMIT** values in the appropriate text boxes. If the amplitude discriminator measures a signal amplitude outside these limits, the **E5: AMPLITUDE ERROR** message is displayed on the measurement screen.
3. In the **SOUND SPEED [+/-]** section, enter the desired maximum percentage of variation allowed from the sound speed programmed in the **FLUID** menu (the default value is 20%). If the fluid sound speed exceeds the programmed nominal value by more than this percentage, the **E2: SOUND SPEED ERROR** message is displayed on the measurement screen.
4. In the **ACCELERATION** section, enter the desired upper limit value in the text box. If the measured velocity changes by more than this limit from one reading to the next, the **E6: CYCLE SKIP ERROR** message is displayed on the measurement screen.
5. In the **COMPRESSION RATIO** section, enter the desired upper limit value in the text box. If the ratio of the *correlation peak* value to the *secondary peak* value exceeds this limit, the **E4: SIGNAL QUALITY ERROR** message is displayed on the measurement screen.
6. In the **SIGNAL LOW LIMIT** section, enter the desired low limit value in the text box. If the **SNR** (Signal to Noise Rate) is less than this limit or the signal cannot be found when the flow is started, the **E1: LOW SIGNAL ERROR** message is displayed on the measurement screen.

7.3.4 Programming the ERROR LIMITS Menu (cont.)

7. There is an acceptable range for each of the parameters entered in this menu. If you enter a value outside of these limits a message similar to *Figure 133* below is displayed.

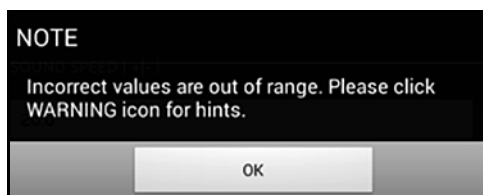


Figure 133: Out of Limits Message

Click the **OK** button to close the above message, then click the  icon on the **ERROR LIMITS** menu for help (see the example below).

SOUND SPEED VARIATION RATE incorrect value [0.0 to 10000.0 range]

Click the  button to the right of the help message. Then, enter a new value within the specified range.

8. Be sure to click the **SAVE** button before leaving the **ERROR LIMITS** menu, or all of your settings will be discarded.

Chapter 8. Error Codes and Troubleshooting

8.1 Error Codes

The bottom line of the *Tablet LCD* displays a single, top-priority *error message* during operation. This line, called the **Error Line** and it includes the following:

- **Error Header:** gives the **Error Pattern** and the **Error Number**
- **Error String:** gives detailed error information

8.1.1 Error Header

The possible *Error Headers* are listed in *Table 14* below.

Table 14: Error Headers

Error Channel	Error Header
Channel 1	CH1
Channel 2	CH2
Meter	No specified channel

8.1.2 Flow Errors

Flow Errors are errors which occur while taking flow measurements. These errors can be caused by disturbances in the fluid, such as excessive particles in the flow stream or extreme temperature gradients. The errors could also be caused by an empty pipe or issues with the fluid. Flow errors are typically not caused by a malfunction of the flow measurement device, but by an issue with the fluid itself.

8.1.2a E1: Low Signal

Problem: Poor ultrasonic signal strength or the signal exceeds the programmed limit.

Cause: SNR is less than the *Signal Low Limit* or the signal cannot be found. Poor signal strength may be caused by a defective cable, a fluid or pipe problem, a defective transducer or a transmitter problem. A signal that exceeds the programmed limits is probably caused by an improper user value.

Action: Check the components listed above. Also, check the programmed error limits value.

8.1.2b E2: Sound Speed Error

Problem: The sound speed exceeds the programmed limits.

Cause: This error may be caused by incorrect programming, poor flow conditions or poor transducer orientation.

Action: Correct the programming errors. Be sure to check the programmed Error Limits value.

8.1.2c E3: Velocity Range

Problem: The velocity exceeds the programmed limits.

Cause: This error may be caused by improper programming, poor flow conditions or excessive turbulence.

Action: Make sure the actual flow rate is within the programmed limits. Also, check the programmed Error Limits value. Correct any fluid, pipe and transducer problems.

8.1.2d E4: Signal Quality

Problem: The signal quality is outside the programmed limits.

Cause: The peak of the upstream or downstream correlation signals has fallen below the programmed correlation peak limit. This may also be caused by a fluid, pipe or electrical problem.

Action: Check for sources of electrical interference and verify the integrity of the tablet by temporarily using the PT900 on a test fluid/pipe that is known to be good. Check the transducers and relocate them, if necessary.

8.1.2e E5: Amplitude Error

Problem: The signal amplitude exceeds the programmed limits.

Cause: Solid or liquid particulates may be present in the fluid or pipe. Poor couplant used on the clamp-on transducers;

Action: Correct any fluid and pipe problems.

8.1.2f E6: Cycle Skip

Problem: The ACCELERATION exceeds the programmed limits.

Cause: This condition is usually caused by poor flow conditions or improper transducer alignment.

Action: Correct any fluid, pipe and transducer problems.

8.2 Diagnostics

8.2.1 Introduction

This section explains how to troubleshoot the PT900 if problems arise with the transmitter, the fluid, the pipe, or the transducers. Indications of a possible problem include:

- Display of an error message on the tablet screen
- Erratic flow readings
- Readings of doubtful accuracy (i.e., readings that are not consistent with readings from another flow measuring device connected to the same process).

If any of the above conditions occurs, proceed to the instructions in the following sections.

8.2.2 Fluid and Pipe Problems

If preliminary troubleshooting with the **Error Code** messages indicates a possible fluid or pipe problem, proceed with this section. Read the following sections carefully to determine if the problem is indeed related to the fluid or pipe. If the instructions in this section fail to resolve the problem, contact GE for assistance.

8.2.2a Fluid Problems

Most fluid-related problems result from a failure to observe the flow meter system installation instructions. Refer to Chapter 2, *Installation*, to correct any installation problems. If the physical installation of the system meets the recommended specifications, it is possible that the fluid itself may be preventing accurate flow rate measurements. The fluid being measured must meet the following requirements:

- *The fluid must be homogeneous, single-phase, relatively clean, and flowing steadily.*

Although a low level of entrained particles may have little effect on the operation of the PT900, excessive amounts of solid or gas particles will absorb or disperse the ultrasound signals. This interference with the ultrasound transmissions through the fluid will cause inaccurate flow rate measurements. In addition, temperature gradients in the fluid flow may result in erratic or inaccurate flow rate readings.

- *The fluid must not cavitate near the measurement point.*

Fluids with a high vapor pressure may cavitate near the measurement point. This causes problems resulting from gas bubbles in the fluid. Cavitation can usually be controlled through proper installation design.

- *The fluid must not excessively attenuate ultrasound signals.*

Some fluids, particularly those that are very viscous, readily absorb ultrasound energy. In such a case, an **Error Code** message will appear on the display screen to indicate that the ultrasonic signal strength is insufficient for reliable measurements.

- *The fluid sound speed must not vary excessively.*

The PT900 will tolerate relatively large changes in the fluid sound speed, as may be caused by variations in fluid composition and/or temperature. However, such changes must occur slowly. Rapid fluctuations in the fluid sound speed, to a value that is considerably different from that programmed into the PT900, will result in erratic or inaccurate flow rate readings. Refer to Chapter 4, *Programming*, and make sure that the appropriate sound speed is programmed into the meter.

8.2.2b Pipe Problems

Pipe-related problems may result either from a failure to observe the installation instructions in Chapter 2, *Installation*, or from improper programming of the meter. By far, the most common pipe problems are the following:

- *The collection of material at the transducer locations.*

Accumulated debris at the transducer locations will interfere with the transmission of the ultrasound signals. As a result, accurate flow rate measurements are not possible. Realignment of the transducers often cures such problems, and in some cases, wetted transducers must be used. Refer to Chapter 2, *Installation*, for more details on proper installation practices.

- *Inaccurate pipe measurements.*

The accuracy of the flow rate measurements is no better than the accuracy of the programmed pipe dimensions. Measure the pipe wall thickness and diameter with the same accuracy desired in the flow rate readings. Also, check the pipe for dents, eccentricity, weld deformity, straightness and other factors that may cause inaccurate readings. Refer to Chapter 4, *Programming*, for instructions on entering the pipe data.

- *The inside of the pipe or pipe is not sufficiently clean.*

Excessive buildup of scale, rust or debris inside the pipe will interfere with flow measurements. Generally, a thin coating or a solid well-adhered build up on the pipe wall will not cause problems. Loose scale and thick coatings (such as tar or oil) will interfere with ultrasound transmission and may result in incorrect or unreliable flow rate measurements.

8.2.2c Transducer Problems

Ultrasonic transducers are rugged, reliable devices. However, they are subject to physical damage from mishandling and chemical attack. Contact GE for assistance if you cannot solve a transducer-related problem.

8.3 Diagnostic Parameters

If you suspect fluid, pipe, transducer or electrical problems with your PT900 system, the *diagnostic parameters* listed in *Table 15* below are available to help you troubleshoot the problem. To display these parameters, see “*Displaying the Diagnostics Parameters*” on page 106.

Table 15: Available Diagnostic Parameters

Parameter	Description	Good	Bad
Transit Time Up	Transit time of upstream signal	N/A	N/A
Transit Time Dn	Transit time of downstream signal	N/A	N/A
Delta T	Difference between upstream and downstream transit times	N/A	N/A
Signal Quality Up	Quality of upstream signal	≥1200	<400
Signal Quality Dn	Quality of downstream signal	≥1200	<400
Amplitude Discrete Up	Amplitude discriminator value of upstream transducer	19~29	<19 or >29
Amplitude Discrete Dn	Amplitude discriminator value of downstream transducer	19~29	<19 or >29
Signal Noise Rate Up	Signal to noise ratio of upstream signal	≥4	<4
Signal Noise Rate Dn	Signal to noise ratio of downstream signal	≥4	<4
Gain Up	Upstream gain in db	9~85	<9 or >85
Gain Dn	Downstream gain in db	9~85	<9 or >85
Peak Up	Peak value of upstream correlation signal	N/A	N/A
Peak Dn	Peak value of downstream correlation signal	N/A	N/A
Peak Percent Up	% of peak of upstream signal	N/A	N/A
Peak Percent Dn	% of peak of downstream signal	N/A	N/A

8.4 Getting Help

The **HELP** menu (see *Figure 134* below), which is available from the APP main menu, provides information for resolving problems and answering questions. The following sub-menus are included:

- **About** (see *page 140*)
- **Diagnostics** (see *page 141*)
- **Service** (see *page 142*)
- **Spare Parts** (see *page 143*)

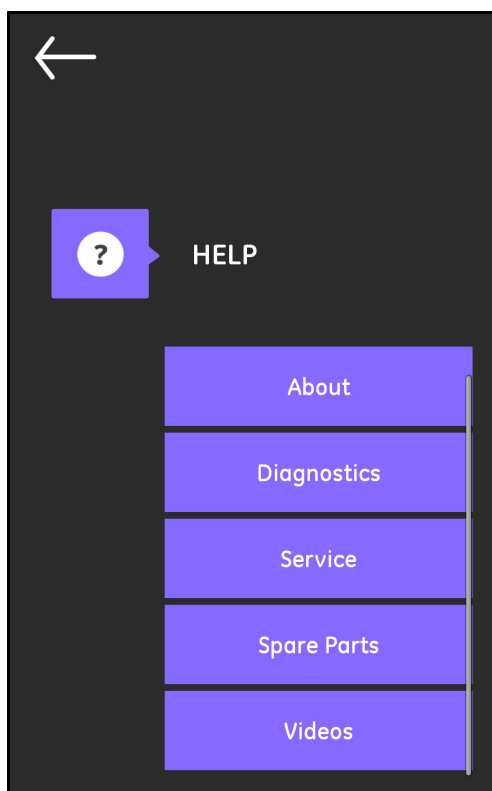


Figure 134: The HELP Menu

Important: *Please contact your GE sales representative at any time for help with any questions not answered in this manual.*

8.4.1 The About Screen

Click on the **About** option to open a screen similar to *Figure 135* below. This screen displays general information about the PT900 system. This information includes: model name, instrument type, software version, and the copyright year of the APP.

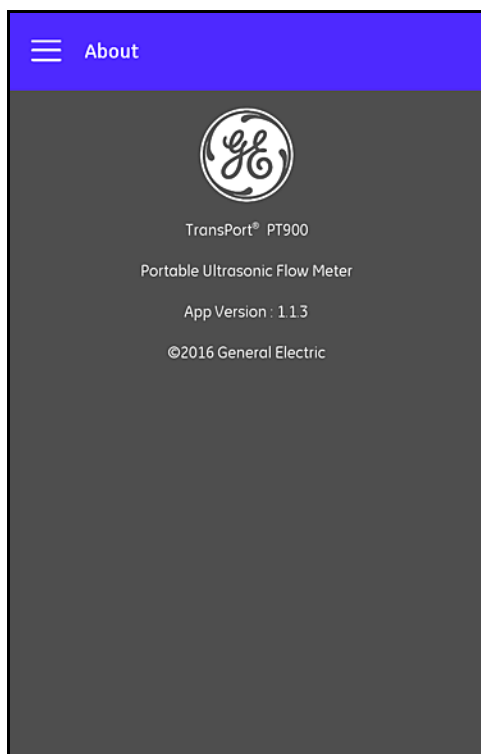


Figure 135: The About Screen

8.4.2 The Diagnostics Screen

Click on the **Diagnostics** option to open a screen similar to *Figure 136* below. This screen displays the possible flow errors that can be generated by the PT900 system, such as the *E1:Low Signal* error shown in the example below. Just click on any of the listed error codes to display a description of that error.

Note: See “Flow Errors” on page 133 for a complete description of the PT900 error codes.

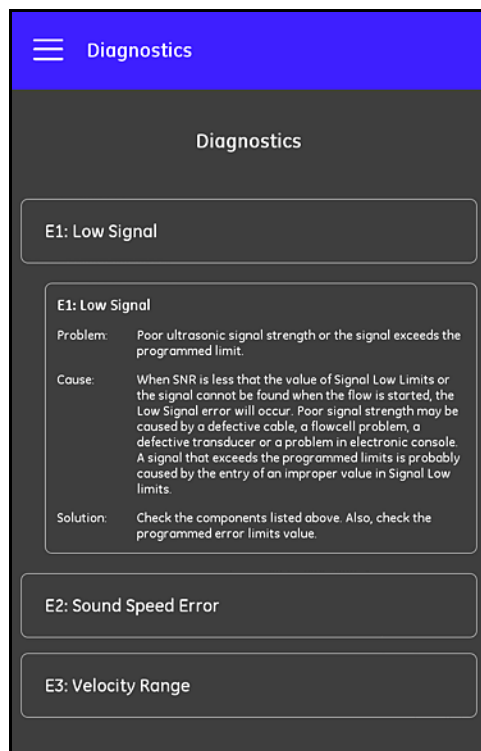


Figure 136: The Diagnostics Screen

8.4.3 The Service Screen

Click on the **Service** option to open a screen similar to *Figure 137* below. This screen provides links to the many services provided by GE for the PT900.

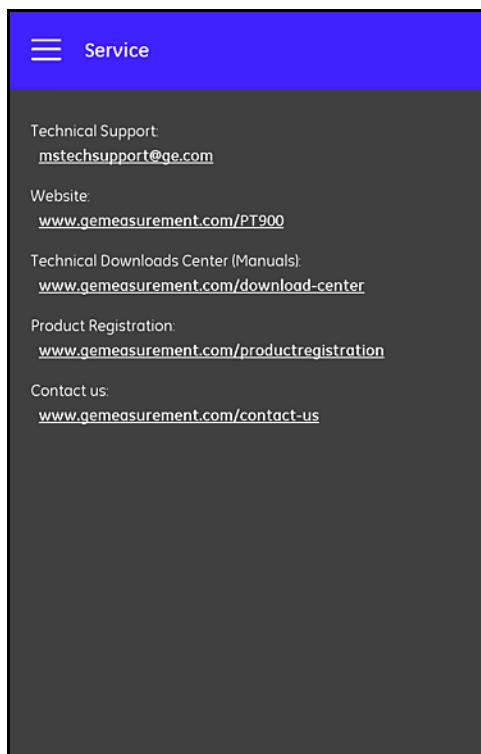


Figure 137: The Service Screen

8.4.4 The Spare Parts Screen

Click on the **Spare Parts** option to open a screen similar to *Figure 138* below. This screen lists the spare parts available from GE for the PT900 system. Just click on any of the listed parts to display a description of that part.

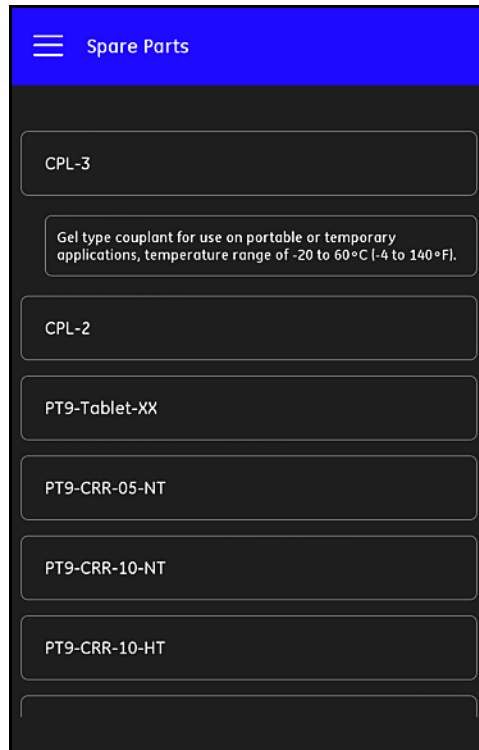


Figure 138: The Spare Parts Screen

8.5 Help Topics List

The following is a complete list of the available help topics:

1. What type of tablet may I use with the PT900 Applications?
2. Where can I get the PT900 application?
3. To update to the latest version of the PT900 APP, do I need to update both my APP and PT900 firmware?
4. I cannot connect to the PT900 transmitter with my tablet. What am I doing wrong?
5. Can someone connect to the PT900 transmitter with Bluetooth without the PT900 APP and damage my transmitter?
6. Can I work **OFFLINE** and save my settings before connecting to a transmitter?
7. How many **PRESETs** can the meter save?
8. Can I connect to more than one PT900 transmitter at a time with my APP?
9. How do I determine the material of my pipe?
10. How do I determine the **SNSP** of my pipe?
11. How do I determine the outer diameter of my pipe?
12. How do I determine the wall thickness of my pipe?
13. What is a pipe lining and how do I know if my pipe has a lining?
14. Do I need to turn on tracking windows? If yes, when do I turn on tracking windows?
15. If I do not know the fluid, what do I use for a sound speed?
16. How do I determine the **Kinematic Viscosity** of my fluid?
17. What is the difference between a wetted transducer and a clamp-on transducer?
18. What transducer should I use for my pipe?
19. How do I determine the type of transducer that I have?

8.5 Help Topics List (cont.)

20. What is wedge temperature and what temperature should I use?
21. What is **Reynolds Correction Factor** and should it be programmed **On** or **Off**?
22. What is **Calibration Factor** and should it be programmed **On** or **Off**?
23. What is traverse?
24. How many traverses should I use to install my transducers?
25. What is **Transducer Spacing** and how do I measure it?
26. What is signal level?
27. What is an acceptable value for signal level?
28. The meter is giving me a sound speed level. How do I know if the value is good or not?
29. What is the difference between a batch total and an inventory total?
30. What is **Standard Volumetric**?
31. What are the **Diagnostics** and what do they mean?
32. Do the diagnostic values update if the meter is showing an error code?
33. What are the **Error Codes**, what is the cause? How do you fix them?
34. Can you adjust the range in the graph?
35. What is the **Energy Switch** for?
36. What is the energy channel **AVG** for?
37. How do I know if my system is a heating or cooling system?
38. Does it make a difference if I put the flow measurement on the supply or return side?
39. What is **Enthalpy**?
40. How do I know if I should be using a default or custom enthalpy value?
41. What is **General Purpose** for the analog inputs?
42. What is a **User Function**?
43. What is a **User Table**?

8.6 The Quick-Start Guide

The *Quick Start Guide*, which can be found on your SD card, provides general instructions on using the flow meter and the APP. Start by watching the installation videos on GE web site at www.gemeasurement.com/transport and then complete the following steps:

1. Check the PT900 transmitter and the tablet before use.
2. Load the APP onto tablet from either the SD card or from our web site (see the link above).
3. Turn on the *transmitter* by holding down the *power button* for more than two seconds. The green power **LED** indicates that the power is **On**.
4. Open the PT900 APP on the **Tablet**.
5. Connect the APP to the transmitter via *Bluetooth* communication.
6. Select the desired **Measurement Units** option and program the meter with correct pipe, fluid, transducer and placement information.
7. Install the transducers onto the pipe with the **Spacing** information calculated by the APP.
8. Set the tablet display to the desired values and to view the flow rate.
9. Continue with other operations, as described elsewhere in this manual.

Chapter 9. Communication

9.1 Modbus Communication

In general, the PT900 flow meter follows the standard Modbus communications protocol defined by the reference **MODBUS APPLICATION PROTOCOL SPECIFICATION V1.1b**. This specification is available at www.modbus.org. With this reference as a guide, the user may use any Modbus master to communicate with the flow meter.

Two limitations of this implementation are:

- The PT900 supports only four of the standard function codes. These are *Read Holding Registers (0x03)*, *Read Input Registers (0x04)*, *Write Multiple Registers (0x10)* and *Read File Record (0x14)*.
- The flow meter needs a *15 ms gap* between Modbus requests. The prime objective of the flow meter is to measure flow rate and drive the output, so the Modbus server has a low priority.

9.2 Modbus Register Map

Table 16 below lists the complete Modbus register map for the PT900.

Table 16: Modbus Register Map

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
100	100	256	User	Product Short Tag	RW	CHAR * 16
	108	264	User	Product Long Tag	RW	CHAR * 32
	118	280	User	eAI1Label	RW	CHAR * 16
	120	288	User	eAI2Label	RW	CHAR * 16
	128	296	User	eLogName	RW	CHAR * 16
	130	304	User	Product Electronical serial number	RW	CHAR * 16
	138	312	User	Product fixture serial number	RW	CHAR * 16
	140	320	User	Product transducer1 serial number	RW	CHAR * 16
	148	328	User	Product transducer2 serial number	RW	CHAR * 16
	150	336	User	Product transducer3 serial number	RW	CHAR * 16
	158	344	User	Product transducer4 serial number	RW	CHAR * 16
300	300	768	RO	Main Hardware version	RO	CHAR * 8
	304	772	RO	Option Hardware version	RO	CHAR * 8
	308	776	RO	Main Software version	RO	CHAR * 8
500	500	1280	User	Global Unit group 1 for Actual Volumetric	RW	INT32
	502	1282	User	Global Unit group 2 for Day	RW	INT32

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
	504	1284	User	Global Unit group 3 for dB	RW	INT32
	506	1286	User	Global Unit group 4 for Density	RW	INT32
	508	1288	User	Global Unit group 5 for Diamention	RW	INT32
	50A	1290	User	Global Unit group 6 for Hz	RW	INT32
	50C	1292	User	Global Unit group 7 for Viscosity	RW	INT32
	50E	1294	User	Global Unit group 8 for mA	RW	INT32
	510	1296	User	Global Unit group 9 for Mass	RW	INT32
	512	1298	User	Global Unit group 10 for Milli Second	RW	INT32
	514	1300	User	Global Unit group 11 for Nano Second	RW	INT32
	516	1302	User	Global Unit group 12 for Percent	RW	INT32
	518	1304	User	Global Unit group 13 for Second	RW	INT32
	51A	1306	User	Global Unit group 14 for Standard Volumetric	RW	INT32
	51C	1308	User	Global Unit group 15 for Therm	RW	INT32
	51E	1310	User	Global Unit group 16 for Totalizer time	RW	INT32
	520	1312	User	Global Unit group 17 for Totalizer	RW	INT32
	522	1314	User	Global Unit group 18 for Unitless	RW	INT32
	524	1316	User	Global Unit group 19 for Micro Second	RW	INT32
	526	1318	User	Global Unit group 20 for Velocity	RW	INT32
	528	1320	User	Global Unit group 21 for Accelaration	RW	INT32
	52A	1322	User	Global Unit group 22 for Energy	RW	INT32
	52C	1324	User	Global Unit group 22 for Energy	RW	INT32
	52E	1326	User	Global Unit for reserve 1	RW	INT32
	530	1328	User	Global Unit for reserve 2	RW	INT32
540	540	1344	Viewer	Batch request command	RW	INT32
	542	1346	User	inventory request command	RW	INT32
	544	1348	Viewer	system request password	RW	INT32
	546	1350	Viewer	system request command	RW	INT32
	548	1352	Viewer	system update command	RW	INT32
700	700	1792	RO	System Reported error	RO	INT32
	702	1794	RO	System Error Bitmap	RO	INT32
	704	1796	RO	System Startup error Bitmap	RO	INT32
	706	1798	RO	System Flow Ch1 error Bitmap	RO	INT32
	708	1800	RO	System Flow Ch2 error Bitmap	RO	INT32
	70A	1802	RO	System Device error Bitmap	RO	INT32
	70C	1804	RO	System Warning Bitmap	RO	INT32
720	720	1824	RO	System Power Status	RO	INT32
	722	1826	RO	battery status: charging, discharging	RO	INT32
	724	1828	RO	remaining battery capacity (%)	RO	INT32

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
	726	1830	RO	remaining battery life (minutes).	RO	INT32
	728	1832	RO	remaining time until Battery reaches full charge (minutes).	RO	INT32
	72A	1834	RO	the cell-pack's internal temperature (°C)	RO	INT32
	72C	1836	RO	the cell-pack voltage (mV)	RO	INT32
	72E	1838	RO	the current being supplied	RO	INT32
	730	1840	RO	eSystemRESV1	RO	INT32
	732	1842	RO	eSystemRESV1	RO	INT32
	734	1844	RO	eSystemRESV1	RO	INT32
C00	C00	3072	User	Analog Out Error Handling Value	RW	(IEEE 32 bit)
	C02	3074	User	Analog Out Test Value (Percent of Span)	RW	(IEEE 32 bit)
	C04	3076	User	Analog Out Zero Value	RW	(IEEE 32 bit)
	C06	3078	User	Analog Out Span Value	RW	(IEEE 32 bit)
	C08	3080	User	Analog Out Base Value	RW	(IEEE 32 bit)
	C0A	3082	User	Analog Out Full Value	RW	(IEEE 32 bit)
C40	C40	3136	User	Digital Out 1 Pulse Value	RW	(IEEE 32 bit)
	C42	3138	User	Digital Out 1 Frequency Base Value	RW	(IEEE 32 bit)
	C44	3140	User	Digital Out 1 Frequency Full Value	RW	(IEEE 32 bit)
	C46	3142	User	Digital Out 1 Alarm Value	RW	(IEEE 32 bit)
D00	D00	3328	User	Analog Out Mode	RW	INT32
	D02	3330	User	Analog Out Type	RW	INT32
	D04	3332	User	Digital Out 1 Mode	RW	INT32
	D06	3334	User	Digital Out 1 Type	RW	INT32
D20	D20	3360	User	Analog Out Measurement Type	RW	INT32
	D22	3362	User	Analog Out Error Handling	RW	INT32
D40	D40	3392	User	Digital Out 1 Pulse Measurement Type	RW	INT32
	D42	3394	User	Digital Out 1 Pulse Test Value	RW	INT32
	D44	3396	User	Digital Out 1 Pulse Error Handling	RW	INT32
	D46	3398	User	Digital Out 1 Pulse Time	RW	INT32
D60	D60	3424	User	Digital Out 1 Frequency Measurement Type	RW	INT32
	D62	3426	User	Digital Out 1 Test Frequency Value	RW	INT32
	D64	3428	User	Digital Out 1 Frequency Error Handling	RW	INT32
	D66	3430	User	Digital Out 1 Frequency Error Handling Value	RW	INT32
	D68	3432	User	Digital Out 1 Frequency Full Frequency	RW	INT32
D80	D80	3456	User	Digital Out 1 Alarm Measurement Type	RW	INT32
	D82	3458	User	Digital Out 1 Alarm Test Value	RW	INT32
	D84	3460	User	Digital Out 1 Alarm State	RW	INT32
	D86	3462	User	Digital Out 1 Alarm Type	RW	INT32

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
E00	E00	3584	RO	Analog Out Measurement Value	RO	(IEEE 32 bit)
	E02	3586	RO	Digital Out 1 Pulse Measurement Value	RO	(IEEE 32 bit)
	E04	3588	RO	Digital Out 1 Frequency Measurement Value	RO	(IEEE 32 bit)
	E06	3590	RO	Digital Out 1 Alarm Measurement Value	RO	(IEEE 32 bit)
1500	1500	5376	User	PC MODBUS baud rate	RW	INT32
	1502	5378	User	PC MODBUS parity	RW	INT32
	1504	5380	User	PC MODBUS stop bits	RW	INT32
	1506	5382	User	PC MODBUS meter addr	RW	INT32
1540	1540	5440	Viewer	Log control / status	RW	INT32
	1542	5442	Viewer	Log interval	RW	INT32
	1544	5444	Viewer	Logging time	RW	INT32
	1546	5446	Viewer	Number of variables to log	RW	INT32
	1548	5448	Viewer	eLogChannel	RW	INT32
	154A	5450	Viewer	eLogFormat	RW	INT32
	154C	5452	Viewer	eLogStartDate	RW	INT32
	154E	5454	Viewer	eLogEndtDate	RW	INT32
	1550	5456	Viewer	eLogStartTime	RW	INT32
	1552	5458	Viewer	eLogEndtTime	RW	INT32
1580	1580	5504	Viewer	variable address array	RW	INT32
15C0	15C0	5568	Viewer	Variable unit code array	RW	INT32
1740	1740	5952	RO	Number of records	RO	INT32
2000	2000	8192	User	channel 1 composite factor	RW	(IEEE 32 bit)
	2002	8194	User	channel 2 composite factor	RW	(IEEE 32 bit)
20C0	20C0	8384	User	Correlation peak low limit	RW	(IEEE 32 bit)
	20C2	8386	User	Acceleration Limit	RW	(IEEE 32 bit)
	20C4	8388	User	Velocity Low limit - Used for Volumetric low limit calculation	RW	(IEEE 32 bit)
	20C6		User	Velocity High limit - Used for Volumetric High limit calculation	RW	(IEEE 32 bit)
	20C8	8392	User	Amplitude discriminator min limit	RW	(IEEE 32 bit)
	20CA	8394	User	Amplitude discriminator max limit	RW	(IEEE 32 bit)
	20CC	8396	User	Soundspeed Plus minus limit	RW	(IEEE 32 bit)
	20CE	8398	User	signal low limit	RW	(IEEE 32 bit)
	20D0	8400	User	ePcr	RW	(IEEE 32 bit)
	20D2	8402	User	eSOSVariationRate	RW	(IEEE 32 bit)
	20D4	8404	Viewer	ePercentGain	RW	(IEEE 32 bit)
	20D6	8406	User	the maximum threshold	RW	(IEEE 32 bit)
	20D8	8408	User	the minimum threshold	RW	(IEEE 32 bit)

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
20E0	20E0	8416	User	Zero Cutoff	RW	(IEEE 32 bit)
	20E2	8418	User	DeltaT Offset	RW	(IEEE 32 bit)
	20E4	8420	User	the inputted threshold under manual mode	RW	(IEEE 32 bit)
2100	2100	8448	User	Enable Ch1	RW	INT32
	2102	8450	User	Enable Ch2	RW	INT32
	2104	8452	Viewer	eImpulseResponse	RW	INT32
	2106	8454	Viewer	eImpulseRespCmd	RW	INT32
	2108	8456	User	define how to find the peak of the correlation signal	RW	INT32
	210A	8458	User	define how to search the threshold	RW	INT32
21C0	21C0	8640	User	Response Time	RW	INT32
	21C2	8642	User	Response	RW	INT32
	21C4	8644	User	Sample Size	RW	INT32
2200	2200	8704	RO	Average Velocity	RO	(IEEE 32 bit)
	2202	8706	RO	Average Volumetric	RO	(IEEE 32 bit)
	2204	8708	RO	Average Standard Volumetric	RO	(IEEE 32 bit)
	2206	8710	RO	Average Mass Flow	RO	(IEEE 32 bit)
	2208	8712	RO	Average TransitTime	RO	(IEEE 32 bit)
2240	2240	8768	RO	Average Batch fwd totals	RO	(IEEE 32 bit)
	2242	8770	RO	Average Batch rev totals	RO	(IEEE 32 bit)
	2244	8772	RO	Average Batch net totals	RO	(IEEE 32 bit)
	2246	8774	RO	Average Batch totals time	RO	(IEEE 32 bit)
	2248	8776	RO	Average inventory fwd totals	RO	(IEEE 32 bit)
	224A	8778	RO	Average inventory rev totals	RO	(IEEE 32 bit)
	224C	8780	RO	Average inventory net totals	RO	(IEEE 32 bit)
	224E	8782	RO	Average inventory totals time	RO	(IEEE 32 bit)
2400	2400	9216	User	Ch1 Pipe Inner Diameter	RW	(IEEE 32 bit)
	2402	9218	User	Ch1 Pipe Outer Diameter	RW	(IEEE 32 bit)
	2404	9220	User	Ch1 Pipe Wall Thickness	RW	(IEEE 32 bit)
	2406	9222	User	Ch1 Pipe Soundspeed	RW	(IEEE 32 bit)
	2408	9224	User	Ch1 Lining Thickness	RW	(IEEE 32 bit)
	240A	9226	User	Ch1 Lining Soundspeed	RW	(IEEE 32 bit)
	240C	9228	User	Ch1 XDR wedge angle	RW	(IEEE 32 bit)
	240E	9230	User	Ch1 XDR wedge time	RW	(IEEE 32 bit)
	2410	9232	User	Ch1 Wedge Sound speed	RW	(IEEE 32 bit)
	2412	9234	User	Ch1 Fluid Sound speed	RW	(IEEE 32 bit)
	2414	9236	User	Ch1 Fluid Sound speed Min	RW	(IEEE 32 bit)
	2416	9238	User	Ch1 Fluid Sound speed Max	RW	(IEEE 32 bit)

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
	2418	9240	User	Ch1 Fluid Static Density	RW	(IEEE 32 bit)
	241A	9242	User	Ch1 Fluid Reference Density	RW	(IEEE 32 bit)
	241C	9244	User	Fluid Temperature	RW	(IEEE 32 bit)
	241E	9246	User	Ch1 XDR space	RW	(IEEE 32 bit)
	2420	9248	User	Ch1 Calibration Factor	RW	(IEEE 32 bit)
	2422	9250	User	Ch1 Kinematic Viscosity	RW	(IEEE 32 bit)
	2424	9252	User	Ch1 XDR Temperature	RW	(IEEE 32 bit)
	2426	9254	User	eCh1 Goycol	RW	(IEEE 32 bit)
2500	2500	9472	User	Ch1 Pipe Material	RW	INT32
	2502	9474	User	Ch1 Lining Material	RW	INT32
	2504	9476	User	Ch1 XDR Type	RW	INT32
	2506	9478	User	Ch1 XDR frequency	RW	INT32
	2508	9480	User	Ch1 XDR wedge type	RW	INT32
	250A	9482	User	Ch1 Fluid Type	RW	INT32
	250C	9484	User	Ch1 Lining existence	RW	INT32
	250E	9486	User	Ch1 Traverse number	RW	INT32
	2510	9488	User	Ch1 Couplant type	RW	INT32
2540	2540	9536	User	Ch1 Enable Reynolds Correction	RW	INT32
	2542	9538	User	Ch1 Enable Active MultiK	RW	INT32
	2544	9540	User	Ch1 MultiK Type	RW	INT32
	2546	9542	User	Ch1 MultiK Pairs	RW	INT32
	2548	9544	User	eCh1 Density	RW	INT32
	254A	9546	User	eCh1 DensityPairs	RW	INT32
2580	2580	9600	User	Ch1 Peak%	RW	INT32
	2582	9602	User	Ch1 Min Peak%	RW	INT32
	2584	9604	User	Ch1 Max Peak%	RW	INT32
	2586	9606	User	Ch1 Enable Tracking Windows	RW	INT32
2600	2600	9728	RO	Ch1 Velocity	RO	(IEEE 32 bit)
	2602	9730	RO	Ch1 Volumetric	RO	(IEEE 32 bit)
	2604	9732	RO	Ch1 Standard Volumetric	RO	(IEEE 32 bit)
	2606	9734	RO	Ch1 Mass Flow	RO	(IEEE 32 bit)
2640	2640	9792	RO	Ch1 Batch fwd totals	RO	(IEEE 32 bit)
	2642	9794	RO	Ch1 Batch rev totals	RO	(IEEE 32 bit)
	2644	9796	RO	Ch1 Batch net totals	RO	(IEEE 32 bit)
	2646	9798	RO	Ch1 Batch totals time	RO	(IEEE 32 bit)
	2648	9800	RO	Ch1 inventory fwd totals	RO	(IEEE 32 bit)
	264A	9802	RO	Ch1 inventory rev totals	RO	(IEEE 32 bit)
	264C	9804	RO	Ch1 inventory net totals	RO	(IEEE 32 bit)

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
	264E	9806	RO	Ch1 inventory totals time	RO	(IEEE 32 bit)
2680	2680	9856	RO	Ch1 Transit Time Up	RO	(IEEE 32 bit)
	2682	9858	RO	Ch1 Transit Time Dn	RO	(IEEE 32 bit)
	2684	9860	RO	Ch1 DeltaT	RO	(IEEE 32 bit)
	2686	9862	RO	Ch1 Up Signal Quality	RO	(IEEE 32 bit)
	2688	9864	RO	Ch1 Dn Signal Quality	RO	(IEEE 32 bit)
	268A	9866	RO	Ch1 Up Amp Disc	RO	(IEEE 32 bit)
	268C	9868	RO	Ch1 Dn Amp Disc	RO	(IEEE 32 bit)
	268E	9870	RO	Ch1 SNR on UP channel	RO	(IEEE 32 bit)
	2690	9872	RO	Ch1 SNR on DOWN channel	RO	(IEEE 32 bit)
	2692	9874	RO	Ch1 Time in buffer on Up channel	RO	(IEEE 32 bit)
	2694	9876	RO	Ch1 Time in buffer on Dn channel	RO	(IEEE 32 bit)
	2696	9878	RO	Ch1 Signal Gain Up	RO	(IEEE 32 bit)
	2698	9880	RO	Ch1 Signal Gain Down	RO	(IEEE 32 bit)
	269A	9882	RO	Ch1 Partial Corrolatooin Ratio Up	RO	(IEEE 32 bit)
	269C	9884	RO	Ch1 Partial Corrolatooin Ratio Dn	RO	(IEEE 32 bit)
26C0	26C0	9920	RO	Ch1 Sound Speed	RO	(IEEE 32 bit)
	26C2	9922	RO	Ch1 Current Reynolds Number	RO	(IEEE 32 bit)
	26C4	9924	RO	Ch1 Current Correction Factor	RO	(IEEE 32 bit)
	26C6	9926	RO	Ch1 Path Length P	RO	(IEEE 32 bit)
	26C8	9928	RO	Ch1 Axial Length L	RO	(IEEE 32 bit)
2700	2700	9984	RO	Ch1 Up +- Peak	RO	INT32
	2702	9986	RO	Ch1 Dn +- Peak	RO	INT32
	2704	9988	RO	Ch1 dynamic threshold on UP channel	RO	INT32
	2706	9990	RO	Ch1 dynamic threshold on DOWN channel	RO	INT32
2800	2800	10240	User	Ch2 Pipe Inner Diameter	RW	(IEEE 32 bit)
	2802	10242	User	Ch2 Pipe Outer Diameter	RW	(IEEE 32 bit)
	2804	10244	User	Ch2 Pipe Wall Thickness	RW	(IEEE 32 bit)
	2806	10246	User	Ch2 Pipe Soundspeed	RW	(IEEE 32 bit)
	2808	10248	User	Ch2 Lining Thickness	RW	(IEEE 32 bit)
	280A	10250	User	Ch2 Lining Soundspeed	RW	(IEEE 32 bit)
	280C	10252	User	Ch2 XDR wedge angle	RW	(IEEE 32 bit)
	280E	10254	User	Ch2 XDR wedge time	RW	(IEEE 32 bit)
	2810	10256	User	Ch2 Wedge Sound speed	RW	(IEEE 32 bit)
	2812	10258	User	Ch2 Fluid Sound speed	RW	(IEEE 32 bit)
	2814	10260	User	Ch2 Fluid Sound speed Min	RW	(IEEE 32 bit)
	2816	10262	User	Ch2 Fluid Sound speed Max	RW	(IEEE 32 bit)
	2818	10264	User	Ch2 Fluid Static Density	RW	(IEEE 32 bit)

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
	281A	10266	User	Ch2 Fluid Reference Density	RW	(IEEE 32 bit)
	281C	10268	User	Ch2 Fluid Temperature	RW	(IEEE 32 bit)
	281E	10270	User	Ch2 XDR space	RW	(IEEE 32 bit)
	2820	10272	User	Ch2 Calibration Factor	RW	(IEEE 32 bit)
	2822	10274	User	Ch2 Kinematic Viscosity	RW	(IEEE 32 bit)
	2824	10276	User	Ch2 XDR Temperature	RW	(IEEE 32 bit)
	2826	10278	User	eCh2 Goycol	RW	(IEEE 32 bit)
2900	2900	10496	User	Ch2 Pipe Material	RW	INT32
	2902	10498	User	Ch2 Lining Material	RW	INT32
	2904	10500	User	Ch2 XDR Type	RW	INT32
	2906	10502	User	Ch2 XDR frequency	RW	INT32
	2908	10504	User	Ch2 XDR wedge type	RW	INT32
	290A	10506	User	Ch2 Fluid Type	RW	INT32
	290C	10508	User	Ch2 Lining existence	RW	INT32
	290E	10510	User	Ch2 Traverse number	RW	INT32
	2910	10512	User	Ch2 Couplant type	RW	INT32
2940	2940	10560	User	Ch2 Enable Reynolds Correction	RW	INT32
	2942	10562	User	Ch2 Enable Active MultiK	RW	INT32
	2944	10564	User	Ch2 MultiK Type	RW	INT32
	2946	10566	User	Ch2 MultiK Pairs	RW	INT32
	2948	10568	User	eCh2 Density	RW	INT32
	294A	10570	User	eCh2 DensityPairs	RW	INT32
2980	2980	10624	User	Ch2 Peak%	RW	INT32
	2982	10626	User	Ch2 Min Peak%	RW	INT32
	2984	10628	User	Ch2 Max Peak%	RW	INT32
	2986	10630	User	Ch2 Enable Tracking Windows	RW	INT32
2A00	2A00	10752	RO	Ch2 Velocity	RO	(IEEE 32 bit)
	2A02	10754	RO	Ch2 Volumetric	RO	(IEEE 32 bit)
	2A04	10756	RO	Ch2 Standard Volumetric	RO	(IEEE 32 bit)
	2A06	10758	RO	Ch2 Mass Flow	RO	(IEEE 32 bit)
2A40	2A40	10816	RO	Ch2 Batch fwd totals	RO	(IEEE 32 bit)
	2A42	10818	RO	Ch2 Batch rev totals	RO	(IEEE 32 bit)
	2A44	10820	RO	Ch2 Batch net totals	RO	(IEEE 32 bit)
	2A46	10822	RO	Ch2 Batch totals time	RO	(IEEE 32 bit)
	2A48	10824	RO	Ch2 inventory fwd totals	RO	(IEEE 32 bit)
	2A4A	10826	RO	Ch2 inventory rev totals	RO	(IEEE 32 bit)
	2A4C	10828	RO	Ch2 inventory net totals	RO	(IEEE 32 bit)
	2A4E	10830	RO	Ch2 inventory totals time	RO	(IEEE 32 bit)

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
2A80	2A80	10880	RO	Ch2 Transit Time Up	RO	(IEEE 32 bit)
	2A82	10882	RO	Ch2 Transit Time Dn	RO	(IEEE 32 bit)
	2A84	10884	RO	Ch2 DeltaT	RO	(IEEE 32 bit)
	2A86	10886	RO	Ch2 Up Signal Quality	RO	(IEEE 32 bit)
	2A88	10888	RO	Ch2 Dn Signal Quality	RO	(IEEE 32 bit)
	2A8A	10890	RO	Ch2 Up Amp Disc	RO	(IEEE 32 bit)
	2A8C	10892	RO	Ch2 Dn Amp Disc	RO	(IEEE 32 bit)
	2A8E	10894	RO	Ch2 SNR on UP channel	RO	(IEEE 32 bit)
	2A90	10896	RO	Ch2 SNR on DOWN channel	RO	(IEEE 32 bit)
	2A92	10898	RO	Ch2 Time in buffer on Up channel	RO	(IEEE 32 bit)
	2A94	10900	RO	Ch2 Time in buffer on Dn channel	RO	(IEEE 32 bit)
	2A96	10902	RO	Ch2 Signal Gain Up	RO	(IEEE 32 bit)
	2A98	10904	RO	Ch2 Signal Gain Down	RO	(IEEE 32 bit)
	2A9A	10906	RO	Ch2 Partial Corrolatooin Ratio Up	RO	(IEEE 32 bit)
	2A9C	10908	RO	Ch2 Partial Corrolatooin Ratio Dn	RO	(IEEE 32 bit)
2AC0	2AC0	10944	RO	Ch2 Sound Speed	RO	(IEEE 32 bit)
	2AC2	10946	RO	Ch2 Current Reynolds Number	RO	(IEEE 32 bit)
	2AC4	10948	RO	Ch2 Current Correction Factor	RO	(IEEE 32 bit)
	2AC6	10950	RO	Ch2 Path Length P	RO	(IEEE 32 bit)
	2AC8	10952	RO	Ch2 Axial Length L	RO	(IEEE 32 bit)
2B00	2B00	11008	RO	Ch2 Up +- Peak	RO	INT32
	2B02	11010	RO	Ch2 Dn +- Peak	RO	INT32
	2B04	11012	RO	Ch2 dynamic threshold on UP channel	RO	INT32
	2B06	11014	RO	Ch2 dynamic threshold on DOWN channel	RO	INT32
3000	3000	12288	User	eSupplyTempLow	RW	(IEEE 32 bit)
	3002	12290	User	eEnergyRRWRESV1	RW	(IEEE 32 bit)
	3004	12292	User	eReturnTempLow	RW	(IEEE 32 bit)
	3006	12294	User	eEnergyRRWRESV2	RW	(IEEE 32 bit)
	3008	12296	User	Analog Input 1 Base Value	RW	(IEEE 32 bit)
	300A	12298	User	Analog Input 1 Full Value	RW	(IEEE 32 bit)
	300C	12300	User	Analog Input 2 Base Value	RW	(IEEE 32 bit)
	300E	12302	User	Analog Input 2 Full Value	RW	(IEEE 32 bit)
	3010	12304	User	Analog Input 1 Zero Cali Value	RW	(IEEE 32 bit)
	3012	12306	User	Analog Input 1 Span Cali Value	RW	(IEEE 32 bit)
	3014	12308	User	Analog Input 2 Zero Cali Value	RW	(IEEE 32 bit)
	3016	12310	User	Analog Input 2 Span Cali Value	RW	(IEEE 32 bit)
3100	3100	12544	User	eEnergyEnable	RW	INT32
	3102	12546	User	eEnergySystem	RW	INT32

Table 16: Modbus Register Map (cont.)

	Register (in Hex)	Register (in Dec.)	Access Level	Description	RO/ RW	Format
	3104	12548	User	eFlowMeasure	RW	INT32
	3106	12550	User	eEnthalpyCalc	RW	INT32
	3108	12552	User	eSupplyTemp	RW	INT32
	310A	12554	User	eReturnTemp	RW	INT32
	310C	12556	User	eEnergyIRWRSEV1	RW	INT32
	310E	12558	User	eAI1Function	RW	INT32
	3110	12560	User	eEnergyIRWRSEV2	RW	INT32
	3112	12562	User	eAI1Function	RW	INT32
	3114	12564	User	eEnergyChannel	RW	INT32
	3116	12566	User	eEnergyPoint	RW	INT32
	3118	12568	User	eAI1KPairs	RW	INT32
	311A	12570	User	eAI1KPairs	RW	INT32
	311C	12572	User	eExtPwrEnable	RW	INT32
	311E	12574	User	enable power saving mode(long battery mode)	RW	INT32
	3120	12576	User	Measurement Time during power saving mode	RW	INT32
	3122	12578	User	Sleep Time during power saving mode	RW	INT32
3200	3200	12800	RO	eAI1Current	RO	(IEEE 32 bit)
	3202	12802	RO	eAI2Current	RO	(IEEE 32 bit)
	3204	12804	RO	eAI1Val	RO	(IEEE 32 bit)
	3206	12806	RO	eAI1Val	RO	(IEEE 32 bit)
	3208	12808	RO	eEnergy	RO	(IEEE 32 bit)
3300	3300	13056	RO	eAI1Sample	RO	INT32
	3302	13058	RO	eAI2Sample	RO	INT32

9.3 Bluetooth Communication

The PT900 system uses the *Bluetooth protocol* for communication between the transmitter and the tablet. To protect the security of the product and the user data, a proprietary protocol based on the common *Bluetooth 4.0* protocol was developed.

For details of the Bluetooth communication mode, refer to **Bluetooth Spec 4.0**.

Note: *The PT900 transmitter does not automatically relink to a previously paired tablet, and it does not automatically link to an unpaired tablet. You must use the tablet APP to initiate the pairing of an unpaired transmitter. However, the transmitter might still be paired with other tablets.*

Appendix A. Specifications

A.1 Operation and Performance

Fluid Types

Liquids: Acoustically conductive fluids, including most clean liquids, and many liquids with limited amounts of entrained solids or gas bubbles

Flow Measurement

Patented Correlation Transit-Time™ mode

Pipe Sizes

Standard: 0.5 to 24 in. (15 to 600 mm)

Optional: up to 300 in. (7500 mm) available upon request

Pipe Wall Thickness

up to 3 in. (76.2 mm)

Pipe Material

All metals and most plastics

Consult GE for concrete, composite materials and highly corroded or lined pipes.

Accuracy

±1% of reading (2in./50mm or greater pipe sizes)

±2% of reading (0.5in./15mm to <2in./50mm pipe sizes)

Installation assumes a fully developed symmetrical flow profile (typically 10 pipe diameters upstream and 5 pipe diameters downstream of straight pipe run). Final installation accuracy is a function of multiple factors including fluid, temperature range, pipe centricity among other factors.

Repeatability

±0.2% of reading

Range (Bidirectional)

0.1 to 40 ft/s (0.03 to 12.19 m/s)

Response Time

Up to 2 Hz

Measurement Parameters

Velocity, Volume, Mass, Energy, Total Flow

Channels

1 or 2 channels

A.2 PT900 Flow Transmitter

Enclosure

IP65 rating

Specifications

Weight: 3 lb (1.4 kg)

Size (h x w x md): 7.9 x 4.3 x 1.5 in. (200 x 109 x 38 mm)

Mounting: Soft strap around pipe or magnetic clamp

Analog Inputs

4-20 mA (qty 2)

Analog Output

4-20 mA (qty 1)

Digital Output

Pulse (Totalizer), Frequency, Alarm (qty 1)

Digital Communication

- Modbus via RS485 Port
- Bluetooth® Wireless
- Micro-USB Port

Battery

Type: Lithium Ion (high-energy, rechargeable)

Life (continuous operation): 18-20 hours

Life (power saver mode): >4 days

Charger: 100 to 240 VAC (50/60/Hz)

Charging Time: Up to 3 hours (from 0% to 100%)

Operating Temperature

Charge: 0 to 45°C (32 to 113°F)

Discharge: -20 to 55°C (-4 to 131°F)

Storage Temperature

-20 to 60°C (-4 to 140°F)

Electronics Classifications

- CE (EMC Directive) IEC 61326-1:2013, IEC 61326-2-3:2013, LVD 2006/95/EC, EN 61010-1 2010
- ANSI/UL STD. 61010-1, CAN/CSA STD. C22.2 NO. 61010-1
- WEEE Compliant (Directive 2012/19/EU)
- RoHS Compliant (Directive 2002/95/EC)

A.3 User Interface

Display

Requires a tablet with Android operating system (version 4.4 or greater), LCD capacitive touchscreen, 800 x 1280 resolution

Dimensions

- *7 in. Tablet:* 7.75 x 4.75 x 0.75 in. (196 x 120 x 19 mm) typical
- *8 in. Tablet:* 8.75 x 6.00 x 0.75 in. (222 x 152 x 19 mm) typical

Battery Life

>12 hours of continuous use typical (based on specific tablet)

Battery Charger

100 to 250 VAC, 50/60Hz

Operating Temperature

0 to 50°C (32 to 122°F)

Communication with Flow Transmitter

Bluetooth®

A.4 Software Application (PT900 APP)

Intuitive, Swipe Screen Interface

- Colorful, icon-driven design
- Tutorial-style programming
- Site parameter presets
- Multiple display options
- Extensive online help

Languages

English, Arabic, Chinese (Simplified), Dutch, French, German, Italian, Japanese, Korean, Portuguese, Russian, Spanish, Swedish, Turkish

Installing the PT900 APP

- File provided on SD card
- Free download from Google Play Store
- Free download from GE website (QR code available)

A.5 Clamp-On Transducers

Temperature Range*

Standard: -40 to 302°F (-40 to 150°C)

Optional: -328 to 752°F (-200 to 400°C)

**See individual transducer model specifications for exact temperature range*

Mounting

- New PT9 clamping fixture for pipes ≥ 2 in. (50 mm)
- CF-LP clamping fixture for 0.5 in. (15 mm) to 2 in. (50 mm) pipes

PT9 Transducer Cables

Standard Length: 25 ft (8 m)

Maximum Length: 100 ft (30 m)

Temperature Range: -40° to 302°F (-40° to 150°C)

A.6 Accessories

Cases

Standard: Soft nylon carry bag with strap and dedicated equipment dividers

Optional: Hard case with wheels and dedicated equipment compartments

Cables

Input and Output Cables: Analog and Digital

Cable Adapters: TNC to BNC or UTDR connectors

A.7 Options

Tablet

- Android operating system (version 4.4 or higher)
- Protective case

Energy Measurement Kit

The optional *Energy Measurement Kit* calculates energy flow rate and totalized energy.

- *Temperature Transmitter*: loop-powered, 4-wire PT1000 surface-mount RTDs, NIST-certified
- *Accuracy*: $\pm 0.12^{\circ}\text{C}$ ($\pm 0.22^{\circ}\text{F}$) of reading
- *Range*: 0 to 149°C (32 to 300°F) standard

GE PocketMike Thickness Gauge

- Compact stainless steel design, IP67
- Pivoting, high-contrast LCD display
- Easy operation via four keys
- Integrated, exchangeable 5 MHz probe
- Range from 1 to 250 mm (0.040 to 10 in.)
- Standard AA batteries

Spare Battery

Battery Pack: Lithium Ion, high-energy, rechargeable

Battery Charger: 100 to 240 VAC (50/60/Hz)

Cable Adapter

TNC to BNC or UTXDR connectors

A.8 Customer Cable Requirements for AIO/DIO Connections

- *Diameter range of Customer Cable for AIO/DIO connections*:
5 to 8 mm
- *Temperature range of customer cable for AIO and DIO connections*:
 14° to 131°F (-10° to 55°C)
- *Conductor cross section range according to CE and UL standards*:
20 to 28 AWG

[no content intended for this page]

B.2 Initial Settings

The values for the parameter settings immediately after initial installation of the meter and verification of proper operation should be entered in *Table 18* below.

Table 18: Initial System Parameter Settings

Parameter	Initial Value
Pipe OD	
Pipe ID	
Pipe Wall Thickness	
Pipe Material	
Pipe Sound speed	
Lining Thickness	
Lining Material	
Transducer ID	
Transducer Frequency	
Transducer Wedge Type	
Transducer Wedge Angle	
Transducer Wedge SOS	
Transducer TW	
Traverses	
Fluid Type	
Fluid SOS	
Fluid Minimum SOS	
Fluid Maximum SOS	
Fluid Temperature	
Transducer Spacing	

B.3 Initial Diagnostic Parameters

The values for the transducer signal diagnostic parameters immediately after initial installation of the meter and verification of proper operation should be entered in *Table 19* below. These initial values can then be compared to current values to help diagnose any future malfunction of the system.

Table 19: Initial Diagnostic Parameters

Parameter	Initial Value
Velocity	
Actual Volumetric	
Standardized Volumetric	
Fwd. Batch Totals	
Rev Batch Totals	
Net Batch Totals	
Batch Totalizer Time	
Fwd. Inventory Totals	
Rev Inventory Totals	
Net Inventory Totals	
Inventory Totalizer Time	
Mass Flow	
Sound Speed	
Reynolds Number	
Kfactor	
Transit Time Up	
Transit Time Dn	
DeltaT	
Up Signal Quality	
Signal Quality	
Amp Disc Up	
Dn Amp Disc Dn	
SNR Up	
SNR Dn	

Table 19: Initial Diagnostic Parameters (cont.)

Parameter	Initial Value
ActiveTW Up	
ActiveTW Dn	
Gain Up	
Gain Dn	
Error Status	
Reported Error	
Peak Up	
Peak Dn	
Peak % Up	
Peak % Dn	

A

About Screen	140
Adding a Log	108
Analog Inputs	
Calibrating	123
Configuring	87
Analog Inputs and Outputs, Connecting	37
Analog Outputs	
Available Data Sources	89, 99
Calibrating	122
Configuring	89
APP (PT900)	
Error Codes	133, 141
Getting from Google Play Store	46
Getting from SD Card	46
Installing	47
Installing or Updating	45
Languages	50, 117, 159
License Agreement	50
Main Menu Screen	61
Measurement Screen	97
Setting Up	49
Slide Menu Screen	62
Specifications	159
Version	45

B

Battery Pack	
Charging and Storing	39
Disposal	41
Installing	6
Maintenance	38
Remaining Time	117
Replacing	40
Specifications	158
Bluetooth	
Communication	38, 156
Pairing Confirmation	54

C

Cable Requirements	161
--------------------------	-----

Calibrate Factor	77
Calibrating	
Analog Inputs	123
Analog Outputs	122
Totalizer	125
CALIBRATION Menu	121
Carrier Case, Hard (with contents)	5
Charging the Battery Pack	39
Charging the Transmitter and Tablet	45
Clamp-On Fixture	
See Fixture	
Communication	
Bluetooth.	38, 156
Modbus	147
Couplant, Applying	18
D	
Data Records	
Initial Diagnostic Parameters	165
Initial Settings	164
Service Record	163
Data Sources, Analog Outputs	89, 99
Decimal Format, Display	101
Deleting a Log	111
Density Table	85
Device Information, Transmitter	116
Diagnostics	
Available Parameters	138
Displaying Parameters	106
Initial Parameter Values	165
Parameter Values	138
Troubleshooting Guide	135
Digital Output	
Configuring	90
Connecting	36
Dimensions, Pipe	68

Display	
Decimal Format	101
Diagnostic Parameters	106
Graphical Format	103
Measurement Screen, Typical	97
Multiple Measurements	101
Single Measurement	102
Totalizer Screen	105
Variables Available	99
Disposing of the Battery Pack	41
Document Number	i

E

Editing a Log	112
Electrical Connections	
Analog Inputs and Outputs	37
Digital Output	36
Energy Cables	37
Line Power	33
Requirements	33
Transducers	35
Transmitter Power	34
USB Cable	38
Energy Cables (Optional), Connecting	37
ENERGY Option, Programming	85
Enthalpy Calculation	85
Error Codes, PT900 APP	133, 141
ERROR LIMITS Menu	130
Errors, Flow	133, 141
Even-Traverse	
Installation (greater than 305 mm Spacing)	28
Installation (less than 305 mm Spacing)	21

F

FCC Rules/Industry Canada License	xii
Fixture	
Chain Installation	12
Mounting, PT9	9
Flow Errors	133

Fluid

Available Types	72
Density Table	85
Menu	70
Problems	136

G

Google Play Store, Getting PT900 APP	46
--	----

Graphical Display

Configuring	104
Viewing	103

H**HELP**

Menu	139
Topics List	144

I

Initial Settings Record	164
INPUTS Menu	87

K

K-Factor	77
Kinematic Viscosity	71
Korean KCC Warning	xiv

L

Label, Serial Number	33, 52
Languages, PT900 APP	50, 117, 159
LED Indicators, Transmitter	42
License Agreement, PT900 APP	50
Line Power, Connecting	33
Lining, Pipe	69
Links to Services	142

Logs	
Adding	108
Configuring	107
Deleting	111
Editing	112
Menu	110
Parameters	109
Stopping	111
Viewing	113

M

Main Menu Screen	61
Maintenance, Battery Pack	38
Materials, Pipe	68
Measurements	
Setting Up Screen	98
Typical Screen	97
Viewing Multiple	100
Menu	63
CALIBRATION	121
ERROR LIMITS	130
FLUID	70
HELP	139
INPUTS	87
LOGS	110
METER SETUP	124
OUTPUTS	88
PIPE	67
PLACEMENT	78
PROGRAM	65
Program Options	83
SERVICE	121
TESTING	127
TRANSDUCERS	73
TRANSMITTER	115
UNITS OF MEASUREMENT	63
USER FUNCTIONS	93
Meter Factor	76
METER SETUP Menu	124

Modbus	
Communication	147
Configuring Output	92
Register Map	147
Multiple Measurements, Displaying	101
O	
Odd-Traverse, Installation	22
Operators, User Functions	94
OUTPUTS Menu	88
P	
Pairing	
Confirmation	54
Initial Setup	52
Transmitter List	56
Parameters	
Logging	109
Transducers	74
Peak Detect, Programming	126
Pipe	
Dimensions	68
Lining	69
Materials	68
Menu	67
Problems	137
PLACEMENT Menu	78
Power Button, Transmitter	42
Power Saving Mode, Programming	125
Powering the Transmitter On and Off	41
Problems	
Fluid	136
Pipe	137
Transducer	138
Program Channel Menu	65
Program Options Menu	83

PT900	
Electrical Connections	33
Packed in Hard Carrier Case	5
Software, Updating	118
System Description	1
Typical Installation	8
Unpacking	4
PT900 Transmitter	
See Transmitter	
Publication Date	i
Q	
QR Code, Downloading New PT900 APP Version	46
Quick-Start Guide	146
R	
Register Map, Modbus	147
Registration, GE Product	x, 1, 51
Regulatory Compliance	xi, 158
Replacing the Battery Pack	40
Return Policy	178
Return Temperature	85
Reynolds Correction Factor	76
RoHS Compliance	xi
S	
Safety	
Auxiliary Equipment	ix
General Issues	viii
Personal Equipment	x
Saving Your Settings	126
SD Card	
Getting New PT900 APP	46
Quick-Start Guide	146
Service Links	142
SERVICE Menu	121
Service Programs	x
Service Record	163
Settings, Saving	126
Single Measurement, Displaying	102
Slide Menu Screen	62

Software, Transmitter.	118
Sound Speed	
Entering.	71
Validation	82
Spacing Calculation, Transducers	9
Spacing, Transducers	79
Spare Parts	143
Specifications	
Accessories	160
Battery Pack	158
Clamp-On Transducers	160
Flow Transmitter.	158
Operation and Performance	157
Options	161
Software Application (PT900 APP)	159
User Interface	159
Stopping a Log	111
Storing the Battery Pack	39
Supply Temperature.	85
Support	
Customer Support Centers	4
GE Services.	x
T	
Tablet	
Charging	45
Pairing to Transmitter.	49
Taiwan Warning Letter	xiv
Terms and Conditions	x
Test	
Watchdog	128
Wave Sample Channel	129
TESTING Menu.	127
Threshold, Programming	126
Totalizer	
Calibrating	125
Displaying.	105
Tracking Window	72
Transducer Holders, Checking.	16
Transducer Spacing, Custom	80

Transducers	
Couplant, Applying	18
Holders	16
Installing	17
Menu	73
Parameters	74
PLACEMENT Menu.	78
Problems	138
Spacing	79
Spacing Calculation.	9
Specifications	160
Transmitter Connections	35
Transmitter	
CALIBRATION Menu	121
Charging	45
Device Information	116
ERROR LIMITS Menu.	130
Label, Serial Number	33, 52
LED Indicators	42
Menu	115
METER SETUP Menu	124
Mounting Options	7
Pairing List	56
Pairing to Tablet	49, 52
Power Button.	42
Power Connection	34
Powering On and Off	41
SERVICE Menu	121
Software, Updating	118
Specifications	158
TESTING Menu	127
Transducer Connections	35
USB Port	38
Traverse Configuration.	78
Typographical Conventions	vii

U

Units of Measurement, Selecting	63
Unpacking the PT900.	4
USB Port, Using	38

USER FUNCTIONS Menu 93

User Functions Operators..... 94

User Interface

 Specifications 159

User Tables 95

V

Version, Checking PT900 APP 45

Viewing a Log 113

Viewing Measurements 100

W

Warranty..... x, 177

Watchdog Test 128

Wave Sample Channel Test..... 129

WEEE Compliance xi

Wireless Interface

 See Bluetooth

Z

Zero Flow Validation..... 81

Warranty

Each instrument manufactured by GE Sensing is warranted to be free from defects in material and workmanship. Liability under this warranty is limited to restoring the instrument to normal operation or replacing the instrument, at the sole discretion of GE Sensing. Fuses and batteries are specifically excluded from any liability. This warranty is effective from the date of delivery to the original purchaser. If GE Sensing determines that the equipment was defective, the warranty period is:

- One year from delivery for electronic or mechanical failures
- One year from delivery for sensor shelf life

If GE Sensing determines that the equipment was damaged by misuse, improper installation, the use of unauthorized replacement parts, or operating conditions outside the guidelines specified by GE Sensing, the repairs are not covered under this warranty.

The warranties set forth herein are exclusive and are in lieu of all other warranties whether statutory, express or implied (including warranties or merchantability and fitness for a particular purpose, and warranties arising from course of dealing or usage or trade).

Return Policy

If a GE Sensing instrument malfunctions within the warranty period, the following procedure must be completed:

1. Notify GE Sensing, giving full details of the problem, and provide the model number and serial number of the instrument. If the nature of the problem indicates the need for factory service, GE Sensing will issue a RETURN AUTHORIZATION NUMBER (RAN), and shipping instructions for the return of the instrument to a service center will be provided.
2. If GE Sensing instructs you to send your instrument to a service center, it must be shipped prepaid to the authorized repair station indicated in the shipping instructions.
3. Upon receipt, GE Sensing will evaluate the instrument to determine the cause of the malfunction.

Then, one of the following courses of action will then be taken:

- If the damage is covered under the terms of the warranty, the instrument will be repaired at no cost to the owner and returned.
- If GE Sensing determines that the damage is not covered under the terms of the warranty, or if the warranty has expired, an estimate for the cost of the repairs at standard rates will be provided. Upon receipt of the owner's approval to proceed, the instrument will be repaired and returned.

We,

GE Sensing
1100 Technology Park Drive
Billerica, MA 01821
U.S.A.

declare under our sole responsibility that the

TransPort® PT900 Ultrasonic Flow Meter

to which this declaration relates, is in conformity with the following standards:

- EN 61326-1: 2013, **Power supply:** Group 1, Class B, Table 1, Basic EM Environment
Flow meter: Group 1, Class A, Table A.1, Portable Test and Measurement
- EN 61326-2-3:2013
- EN 301 489-1 V1.9.2
- EN 301 489-17 V2.2.1
- EN 300 328 V1.9.1
- EN 62479: 2010
- EN 61010-1: 2010
- EN 60529:1991+A1:2000+A2:2013 IP65
- EN 62321: 2013

following the provisions of Directives 2014/30/EU (EMC), 2014/53/EU (RED), 2014/35/EU (LVD) and 2011/65/EU (RoHS).

13th March 2017
Issued



Mr. Chris Frail
Engineering Manager
GE Measurement Solutions
Billerica, MA U.S.A.



[no content intended for this page]

Customer Support Centers

U.S.A.

The Boston Center
1100 Technology Park Drive
Billerica, MA 01821

U.S.A.

Tel: 800 833 9438 (toll-free)

978 437 1000

E-mail: sensing@ge.com

Ireland

Sensing House
Shannon Free Zone East
Shannon, County Clare

Ireland

Tel: +35 361 470200

E-mail: gesensingsnnservices@ge.com

An ISO 9001:2008 Certified Company

www.gemeasurement.com/quality-certifications

www.gemeasurement.com

©2017 General Electric Company. All rights reserved.

Technical content subject to change without notice.