

DIGITAL READOUTS

D80

Operation Manual
(Version 1.0)

Instruction of Panel and keypad

1. System parameter setting

1.1 Axes parameter setting.

Selection of Linear Encoder or Rotary Encoder 2

Resolution Setting 2

Counting Direction Selection 2

Compensation Type Setting 2

1.2 DRO Setting

DRO Type Selection 3

Inch mode decimal point switch function 3

Language settings 3

Axes number setting 3

LOGO ON-OFF 3

Data Recovery of Zeroing ON/OFF 3

Brightness function 3

1.3 RPM Setting

Pulse setting of RPM 4

RPM ON-OFF 4

1.4 Axes value combination setting

Axes combination 4

1.5 Shortcut key setting 5

1.6 Factory Reset

ID Checking 5

Full zeroing 200 points SDM 5

Factory Reset 5

2. Basic Functions

2.1 Zeroing, Data Recovery 8

2.2 Display in Metric/British units 8

2.3 Input Coordinate 8


Instruction of Panel and keypad

2.4 1/2 Function	8
2.5 ABS/INC Way	8
2.6 Power Off Memory Function	9
2.7 Ref Ruler storage function	9
2.7.1 Find Zero Point of grating ruler (FIND.REF)	10
2.7.2 Find the Zero Point (FIND.OGR)	10
2.8 200 sets of auxiliary zero location	11
2.9 Linear Compensation	12
2.10 Non-linear Compensation	13
2.11 Calculator Function	16
2.12 Digital Filtering Function	16
2.13 Feed rate	17
3. Special Function	
3.1 PLD Function	19
3.2 PCD Function	24
3.3 Smooth R Function	27
3.4 Simple R Function	33
3.5 Rectangle Chambering Function	37
3.6 Toper Measuring Function	40
3.7 Radius/diameter Conversion Function	42
3.8 Vectoring	44
3.9 TOOL Storeroom	46
3.10 EDM Function	50
4. Appendix	
4.1 Specifications	58
4.2 Mechanical dimensions and Installation Drawing	58
4.3 Troubleshooting	59

1. System parameter setting

1. System parameter setting

1. System parameter setting








Select the  after turning on the DRO to enter the system parameter setting. The system parameter setting includes the axes parameter setting, DRO setting, RPM setting, Axes summing setting, shortcut key setting, factory reset setting.

1.1 Axes parameter setting.

This includes **FORM**—Encoder type selection (Linear stands for linear encoder, Rotary stands for the rotary encoder), **RES**—resolution setting (the resolution of linear encoder or rotary encoder setting), **DIR**—counting direction setting (0 stands for positive counting, 1 stands for negative counting), **COMP**—compensation type (Linear stands for linear compensation, Nonlinear stands for nonlinear compensation).

Note: The fixed resolution for linear encoder are 0.1 μ m, 0.2 μ m, 0.5 μ m, 1 μ m, 2 μ m, 2.5 μ m, 5 μ m, 10 μ m, 50 μ m. The resolution of rotary encoder supports as min. 10 lines, max. 999999 lines.






Step 1, Enter the axes setting:

Choose the  after entering the system parameter setting. Use the   to choose the **Axis Set**. Press **ENT** to enter the axes setting. Select the corresponding target to set by pressing the    . The parameter behind the X indicates the current parameter of X axes.






Axis Set	FORM	RES	DIR	COMP
X	Linear	5.0	0	Linear
Y	Rotary	1000	1	Nonlinear
Z	Linear	5.0	0	Linear
U	Linear	5.0	0	Linear

Buttons: DRO Set, RPM Set, + Set, Input, Factory reset, Set






Step 2 Encoder type selection (FORM):

After entering the encoder type selection, select the linear encoder (LINEAR) or rotary encoder (Rotary) by pressing the . After selecting well, press the     to proceed the setting of other parameter setting. Press **C** to save and return.

Step 3 Resolution setting of linear encoder (RES):

When the encoder type set as the linear encoder (Linear), the resolution can be set from the fixed 0.1 μ m, 0.2 μ m, 0.5 μ m, 1 μ m, 2 μ m, 2.5 μ m, 5 μ m, 10 μ m, 50 μ m. Which resolution need to be set should depend on the resolution of the linear encoder. Press  to set. After setting well, press     to proceed other parameter. Press **C** to save and return.







Step 4 Resolution setting of rotary encoder (RES):

When the encoder type set as the rotary encoder (Rotary), the resolution need to be set should depend on the corresponding rotary encoder's lines. For example, when the rotary encoder is 1000 lines, press  to input by using the number keys. After inputting, press **ENT** to save. And then press     to proceed other parameter setting. Press **C** to save and return.







Axes parameter setting

1. System parameter setting

Step 5, Counting direction setting(DIR)

The counting direction can be set as 0 or 1, 0 stands for the counting direction of the corresponding axes is positive. 1 stands for the counting direction of the corresponding axes is negative. Press  to set. After setting well, press     to proceed other parameter setting. Press  to save and return.










Step 6 Compensation setting (COMP)


The compensation can be set as linear compensation(Linear) or Nonlinear compensation(Nonlinear), Choose the option from the two types according to the need. Press  to set. After setting well, press     to proceed the other parameter setting. Press  to save and return.

1.2 DRO Setting

DRO setting includes machine mode selection(Milling, Lathe, Grinder, EDM), Language setting, decimals setting under inch mode (optional for 4 and 5), Axes number setting, Logo on/off, Data recovery of Zeroing on/off, Brightness setting.


Step 1, Entering the DRO setting:

Select the  to enter the system parameter setting. By pressing the   to choose the , then press the  to enter the axis number setting. Press the     to choose the setting target.

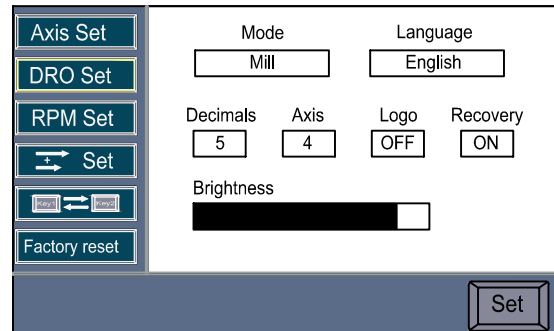


DRO Setting


Step 2, Machine mode setting (Mode):

D80 is available for 4 modes which are Milling, Lathe, Grinder, EDM. Users can choose the one which is suitable for the machine. Press  to proceed the setting.


Step 3 Language setting(Language):

There will be several languages preset, users can choose the suitable language for them. Press  to proceed the setting.


Step 4, Decimals setting under Inch mode(Decimals)

When the D80 is under Inch mode, the decimals are optional for 4 or 5, users can set according to their using habit. Press  to proceed the setting. The defaulted number is 5.

Step 5, Axes number setting(Axis):

The axes number of D80 are available for 5 as the maximum. User can set according to the real usage. For example, when the D80 is purchase with 4 axes, user can set the axes number to 1, 2, 3 or 4 axes to display. Press  to proceed the setting.


Step 6, Logo setting.

The Logo displayed on the DRO can be switched to on or off. Press  to proceed the setting.

Step 7, Data Recovery of Zeroing ON/OFF(Recovery):

When the data recovery of zeroing is in the statues of ON, press the zero button for the corresponding axes, the value will be cleared. Press the zero button of the


1. System parameter setting

corresponding axes again, the cleared value will be recovered. When this function is in the status of OFF, the value cannot be recovered if pressed the zero button for the corresponding axes. Press  to proceed the setting.

Step 8, Brightness setting (Brightness):

Entering the interface of brightness setting, Press  to proceed the setting.

Step 9, Exit the DRO setting.


When the parameter setting is done, press the  to return. The system will save those settings automatically.



1.3 RPM Setting

The rotational speed measurement function is available on the D80. There are two parameters can be set, one is the pulse number generated from the spindle which do one complete circle movement. The other is to turn on or turn off the RPM function (Switch).


Step 1, Entering the RPM setting interface.


Select the  to enter the system parameter setting, then choose the

 to enter the RPM setting.

Choose the setting target by press the  .


Step 2, Pulse number setting of RPM (Sensors):

RPM pulse number indicates the pulse number which generated from one complete circle movement of the spindle. This parameter should be set according to the number of magnet chips installed on the spindle. For example, there are 5 magnet chips on the spindle, therefore the pulse number here should be set as 5. Press the  to proceed the setting. The pulse number can be set as maximum as 200.

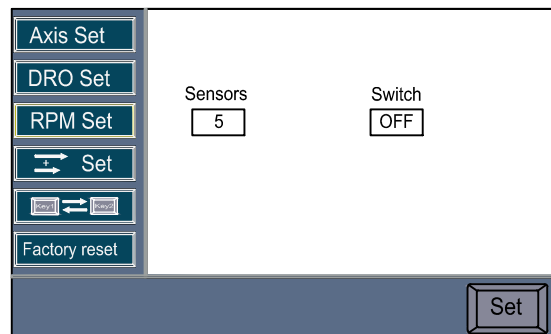


RPM Setting

Step 3, Switch on or off the RPM.

User can switch on or off the RPM function according to the machining need. Press the  to proceed the setting.




Step 4, Exit the RPM function.

When the parameter has been set well, press the  to return. The system will save the settings automatically.


1.4 Axes value combination setting.

User can combine any 2 axes value together.



Step 1, Entering the axes value combination setting.

Select the  to enter the setting. Choose the setting target by press the  .



Step 2, Example of X axes setting:

Take the combining of X and Y axes value as the demonstration. Enter the axes value combination to select the first widget, and then press  to set the X axes to be $X=X+Y$, after setting well, we need to activate of the axes value combination of X axes.


1. System parameter setting

Press  again to set the second widget to be ENABLE status. This setting applies to other axes setting for this function. After setting well, press  to return.

Step 3, Quick opening of Axes value combination function:

To do the quick opening of axes value combination of X axes, press  first, and then press  when the DRO is under the counting mode.

When the X axes has been set as OFF, this operation will be failure.

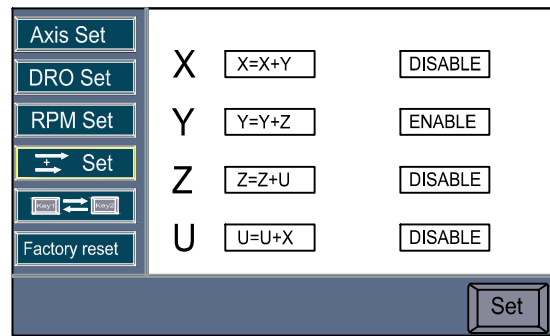






Axes value combination setting











1.5 Shortcut key setting.


When the DRO is under counting mode, the shortcut keys' position can be adjusted for the convenience of operating.

Step 1, Entering the shortcut key setting

Select the  to enter the system parameter setting, choose the  by pressing the  . Press the  to enter the shortcut key setting.

Step 2, Adjusting the position of the icon

Select the target which need to be adjusted by pressing    . Press  to confirm the target, and then adjust its position by pressing    . After setting well, press  to return.

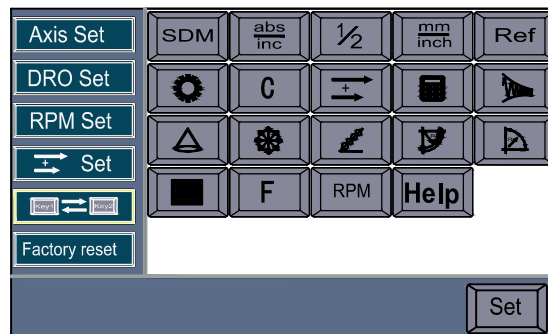






Shortcut key setting

Note: When the DRO is in the interface of shortcut key setting, the icons of the first line will be display on the first page in the counting mode. The icons of the second line will be display on the second page. The icons of third line will be display on the third page.

1.6 Factory Reset.


In factory reset, there are ID Checking, Clear 200 groups of SDM coordinates and factory reset.

Step 1, Enter the factory reset

Select the  to enter the system parameter setting, choose the  by pressing the  . And then press  to enter the factory reset.

Step 2, ID Checking



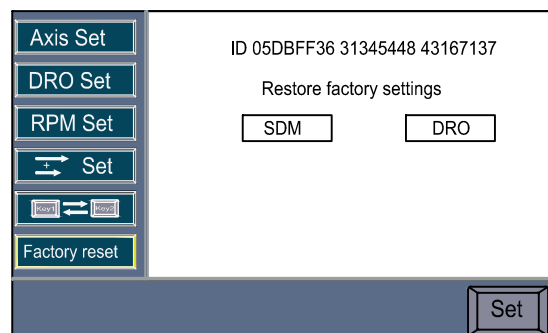

When entering the factory reset interface, there is ID of this DRO displaying with 24 decimals. Every DRO has only one corresponding ID.







Factory Reset

1. System parameter setting

Step 3, Clear the all SDM coordinates.

To clear the 200 groups of SDM coordinates, choose the SDM, press the  to enter the clear the all SDM coordinates. Press   to proceed the setting. Choose YES and press  to clear the all SDM coordinates. It may take around 1 minute to clear, please do not turn off the DRO during this process.

Step 4, DRO Factory Reset:

This setting is to clear all the data saved in the DRO. Choose DRO and press  to enter the factory reset interface. Press   to proceed the setting. Choose Yes and press  to confirm the factory reset. It may take around 1 minute, please do not turn off the DRO during this process.

2. Basic functions


2. Basic functions


2. Basic functions

2.1 Zeroing, data recovery

Function: Operator could zero the displayed coordinate at any position.

Example 1: Zero the displayed value of X axis at the current position.


Press  key to zero the displayed data of Y axis;


Press  key to zero the displayed data of Z axis;

Data recovery

Function: Recover the data which has been zeroed by mistake at any position.

Example 2: Realize the data recovery of X axis.

Press  key to recover the displayed data of Y axis;

Press  key to recover the displayed data of Z axis;

Note: If the data recovery has been switched off, the data is not able to be recovered. Please switch it on in the system parameter setting.

2.2 Display in Metric/British units


Function: Display the location size in Metric (mm) or British (inch) units.

Press  to do the conversion between INCH and MM.

2.3 Input coordinates

Function: Enable the operator to set the current position at any value.



Example 1: Set the position of the current X axis as 16.800 .

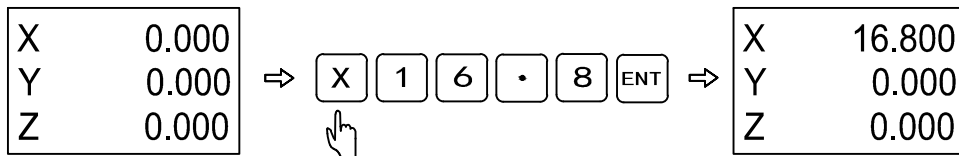



2.4 1/2 function

Function: DRO provides automatic centre find function which divides the current displayed position by 2 and sets the zero point at the centre of work piece.

1/2 Function for X axis

Press  once, and then press  to half the value.

1/2 Function for Y axis


Press  once, and then press  to half the value.

2.5 ABS/INC Coordinates

Function: DRO provides two sets of standard coordinate display value, namely ABS (absolute) and INC (relative) coordinates. The operator could store the reference zero point of work piece at ABS coordinate, and convert ABS coordinate to INC coordinate for machining. Zeroing at any position at INC coordinate won't affect the

2. Basic functions

length value relative to the reference zero point of work piece at ABS coordinate, which shall be stored during the whole machining process and could be checked whenever necessary.

We can switch the ABS and INC coordinate by pressing the  .


2.6 Power Off Memory Function

In case of sudden powering off during machining process, DRO provides data storage module which could store the coordinate and data before powering off. When DRO is powered on again, all the data before powering off will recover automatically.

2.7 Ruler storage function:

Function: In daily machining process, we often encounter such situations as power failure or machining couldn't be finished in one day. If losing the machining zero point, we have to retrieve the zero point of work piece which is troublesome. What's more serious is that there's always errors in retrieving the zero point of work piece by touching, which may cause errors to the parts machined afterwards. DRO provides ruler storage function. It stores the zero point of work piece by using the zero location of grating ruler, which enables the operator to find the zero point easily after power off without retrieving the zero point by touching.

Example: Take the X axis for example:

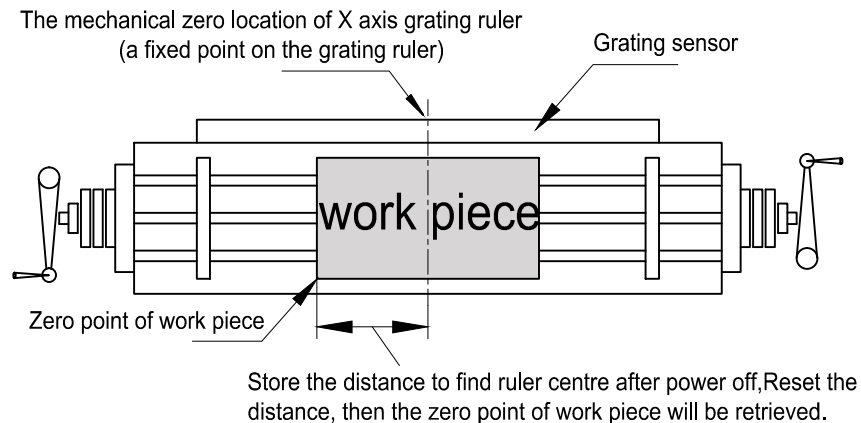






Note: The ruler storage function in our DRO is the most advanced and easiest to use in the DRO market. Each time the operator uses functions which may affect the zero point such as Zeroing, finding centre and inputting coordinate under ABS coordinate, DRO will store the distance between zero point of work piece and ruler centre. So the operator only need operate under the ABS coordinate to set the origin before either switching on the DRO or machining (the work piece hasn't been clamped onto the table). Through which the DRO will record the zero location of the ruler. Then DRO will deal with other storage processes without bothering the operator.

2. Basic functions

2.7.1 Ruler storage function (set the origin):



Function: When machining a complex work piece, its zero point couldn't lose under the cases of power off or failing to finish machining in one day. In this case we could set the origin under the ABS coordinate state of DRO to store the origin of the work piece into DRO. DRO will memorize the distance between the zero point of new work piece and ruler centre during all the operations of resetting the work piece's zero point under ABS coordinate such as Zeroing, finding centre and inputting coordinate so as to retrieve the work piece's zero point after power off or closing ruler.

Set the origin

Press  to enter the scale storage function. Select the target axes which need to be set by pressing  . Press  to enter the setting origin. Move the scale until find its origin, at this moment, the screen will display the success to remind. Press  to return.


Note: When the dot below the scale storage is solid, it indicates this origin of this axes has been set. When the dot is hollow, it indicates the origin of this axes has not been set.

Reference	X	0.000
X Y Z U	Y	0.000
• • • •	Z	0.000
	U	0.000

Interface of scale storage







2.7.2 Retrieve the work piece's origin:

Function: When machining a complex work piece, the zero point gets lost because of sudden power off. After the power is connected, we couldn't keep on machining until we retrieve the work piece's zero point. Note that we couldn't move the machine by this time. When DRO's self-checking finishes, press  key back to ABS coordinate (not necessary if DRO is already under ABS coordinate when switched on). By this time we need to record the data of X, Y and Z axis under the current ABS mode. Detailed operating steps are shown below.

Step 1: Record the data of X, Y and Z axis under ABS mode when DRO completes self-checking:

Example: If DRO completes switch-on self-checking under ABS mode
 X axis is 12.500 Y axis is 18.230 Z axis is 5.800 .

Mill	X	0.000
ABS	Y	0.000
MM	Z	0.000
OFF	U	0.000
T:OFF X-R		
RPM:1234		

Main interface

Note: DRO couldn't deal with the data of X, Y and Z axis automatically, so they need to be recorded to find the zero point.

2. Basic functions

Step 2: Enter REF function and select the function of retrieving the work piece's origin:
Find back the origin:

Press **Ref** to enter the scale storage function. Select the target axes which need to be set by pressing **←** **→**. Press **OGR** to enter the finding back the origin. Move the scale until find its origin, at this moment, the screen will display the success to remind. Press **C** to return. This operation also apply to find back the origin of Y, Z and U.

Note: Select REF for ruler storage function (find the grating ruler's zero location)
Select OGR for retrieving the work piece's coordinate origin (retrieve the work piece's coordinate origin)

Step 3: After searching the work piece's origins on X, Y and Z axis, turn the machine under ABS coordinate state. When the coordinates of X, Y and Z axis are the ABS coordinates recorded at power-on self-checking, this point is the one when machining stopped at last power off and we could go on machining the unfinished work piece.

Note: Retrieve the work piece's origin. The data couldn't be recovered until the origin is set before machining.

2.8 200 sets of auxiliary zero location:


Function:

Typical grating DRO only provides two groups of coordinates, namely ABS/INC. But in most of the daily machining occasions, operators always find it not enough, especially in die machining or small batch machining. The DRO provides 200 sets of auxiliary zero location (SDM) function to compensate for the shortage of the ABS/INC function. But SDM is not just a simple additional INC coordinate, it has the following difference compared to ABS/INC.



1. INC zero location is completely independent. Regardless of any change in ABS zero location, INC zero location will never change. But the zero location of SDM is relative to ABS, which means when ABS zero location changes, all the SDM zero locations shall change correspondingly.
2. The distance of SDM relative to ABS coordinate could be entered by keys directly, which is both fast and precise.

Applications of SDM in sub zero point:

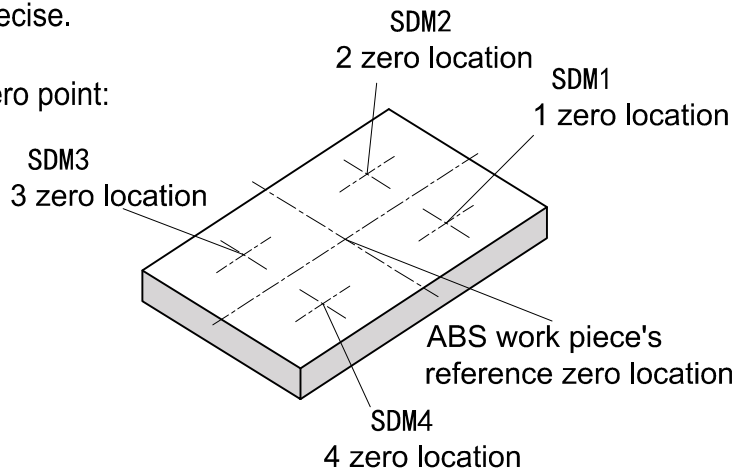Operators could set each sub zero location on the work piece in the SDM auxiliary zero location coordinates.




2. Basic functions



Press  key or  key to convert to SDM auxiliary zero location directly without returning to ABS coordinate.

Applications of SDM in small batch machining

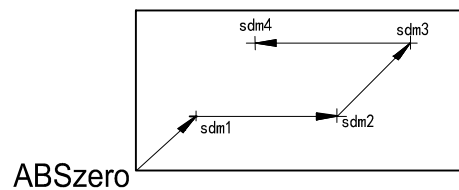SDM function could store batch of working point positions in SDM zero location. Operators could enter all the working points to the DRO at once. Alternatively, operators could also input the working points into SDM of DRO when machining the first work piece. Afterwards they only need to adjust the reference zero location of the subsequent work pieces in ABS coordinate. As the SDM zero locations correspond to these of ABS, all the working point shall recur by SDM zero locations.



Reference of work piece (0.000)

Input the required coordinate value under SDM state according to SDM or press  and  keys to turn to each SDM auxiliary zero location. Move the machine until each SDM coordinate displays 0, which is the position of each working point.

2.9 Linear compensation

Function: Linear error compensation function is used to correct the system errors of the grating ruler measurement system linearly.

Note: the calculation formula of correction coefficient is:

$$\text{Correction coefficient } S = (L - L1) / (L / 1000) \text{ mm/m}$$

L: Stands for the actual measured length (mm)

L1: Stands for the displayed value (mm) on the DRO

S: Stands for correction coefficient (mm/m) (+ indicating lengthening and – indicating shortening)

Compensation range: - 1.9 mm/m to + 1.9 mm/m

Example: The actual length of the machine's X axis table is 1000.000mm and the displayed value on the DRO is 999.880mm. The correction coefficient is calculated as follows:

$$S = (1000.000 - 999.880) / (1000.000 / 1000.000) = 0.120$$


Set the linear compensation coefficient according to the following operation (Note: Set the compensation method as linear compensation in the system parameter setting section firstly. The detailed operations are described in system parameter setting section.)

2. Basic functions

Step 1: Entering the linear compensation

Press **C** to enter the linear compensation. Select the X axes by pressing **←** **→**. After selecting well, press **ENT** to enter the linear compensation.

Note: When any axes need to be done the linear compensation. The corresponding compensation way in system parameter setting need to set as the linear compensation (linear).

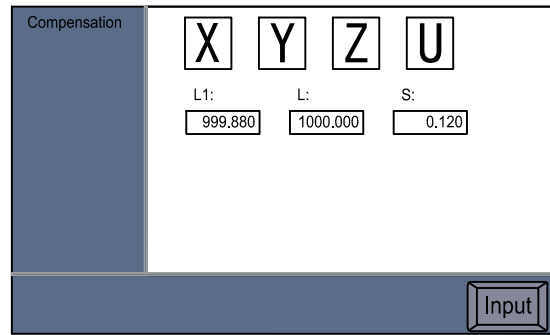

Linear compensation

Note: The linear compensation operation of Y axis or Z axis resembles that of X axis.

2.10 Non linear compensation

Function:


Non linear compensation enables the operator to input non linear error compensation value in the DRO by which way the DRO could compensate all kinds of errors of the machine. Non linear compensation function of DRO could improve the accuracy of the machine greatly if only the positions of the machine have a high repeatability. This function is particularly applicable to the machine tools which have a high requirement on accuracy, such as grinding machine, boring machine etc.

Operating principles:


Non linear compensation adopts a fixed position provided by the REF position in the grating ruler as the absolute zero point of the machine. CPU of the DRO will compensate the readings according to the input error list in the parameter setting section. The software of the DRO could provide non linear error compensation function on X, Y and Z axis. Each axis has a maximum compensation value of 40 points. Note that non linear and linear compensation couldn't be used simultaneously.

This DRO has two methods for non linear error compensation:

- 1、 Take the start point as the mechanical origin to make error compensation. (Figure 1)
- 2、 Take the first absolute zero point of the grating ruler as the mechanical origin to make error compensation. (Figure 2)

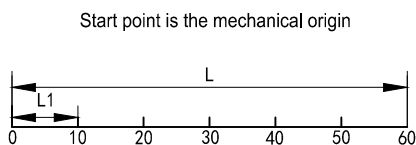

(Figure 1)

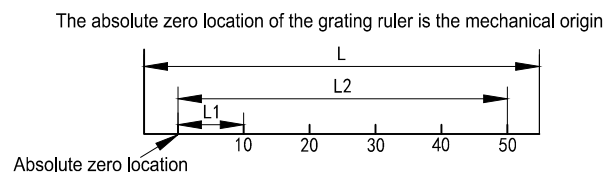

(Figure 2)

2. Basic functions

L: Measuring length of scale
 L1: Compensation part length
 NO: Compensation parts number
 Step: The effective compensation distance
 Mode: Compensation type

1. Parameters are set as follows:

(The operation method for X, Y and Z axis is the same).

Step 1: Set the compensation way to be nonlinear (nonlinear) in system parameter setting.

Step 2: Move the scale to one end and zero the value, then enter the absolute coordinate (ABS).

Step 3: Press **G** to enter the nonlinear compensation, select the X axes and press **ENT** to input the corresponding value.

Step 4: Select the NO by pressing **←** **→**, press **Input** to input the compensation parts. Press **ENT** to save after inputting well.

Step 5: Select the step by pressing **←** **→**. Press **Input** to input the length of every compensation part. Press **ENT** to save after inputting well.

Step 6: Select the starting point (Nonlinear compensation takes the zero point as the starting point. There are two types of zero point available. One is the Mode: LEFT which is the left end of the scale. The other is Mode: REF which is the mechanical zero point under ABS state. Choose the starting point, press **←** **→** to switch the mode, then press **Set** to choose the starting point type.)

Type A (Left), starting point is from the left end of scale, select the mode as the LEFT, and press **ENT** to confirm and enter the state to find the starting point. Move the corresponding scale to the most left end and press **X₀** to clear the value, it will automatically enter the compensation after clearing.

Type B (REF, mechanical zero point under ABS) Select the mode as the REF, press **ENT** to confirm and enter the state to find the zero point. Move the corresponding scale until find its zero point, it will automatically enter the compensation after finding the zero reference point.

L1: the current value of the corresponding scale.

L: the actual measuring length of the scale
 (=NO*Step)

NO: Compensation part number

Step: the length of each compensation part

Mode: starting point

Data: the current value of the corresponding scale

Compensation			
X	Y	Z	U
L1:	L:	NO:	
23.485	23.508	1.000	
Step:	Mode:		
23.485	REF		

Input

Non linear compensation

Compensation			
X	Y	Z	U
L1:	L:	NO:	
23.485	200.000	40	
Step:	Mode:	Data:	
5.000	REF	1.000	

Input

Non linear compensation

2. Basic functions

Step 7: Input the adjusted value part by part, and then press **[ENT]** to enter the next part.

Data: Display the current value of the corresponding axes. L: Adjusted value.

First we need to get the real measurement of the compensation part. This requires much more accuracy measuring tool such as block gauge or laser interferometer. After getting the real measurement, move the scale to the position which is the real measurement from the starting point, then press **[ENT]** to enter the setting of next part.

Note: When the data becomes to red, this indicates that the adjusted value is beyond allowed adjusted range. The adjusted value should not exceed 0.2%. If break out, then the compensation will become ineffective.

2、 Method of cancelling non linear compensation value:

Non linear compensation value could only be used to the DRO, grating ruler and machine when they are set together. When a grating ruler or DRO whose compensation value has been set on a certain machine is moved to another machine, this non linear compensation value is incorrect. In this case we should cancel or reset the non linear compensation value.

The method of cancelling is:

According to the non linear compensation set method indicated above, input the compensation part as 0 when prompted to initialize all the compensation parameters. At present all the compensation parameters set before will be invalid and the current compensation value is zero.

3、 Method of retrieving the mechanical origin

When it was power off during grating ruler movement or grating ruler moved without power on, we have to find the mechanical origin again before booting. Because when the machine is moved under power off, the origin of the machine coordinate couldn't match the value on the DRO. If we don't retrieve the mechanical origin, such dislocation will be brought into the subsequent user coordinate system, as the non linear compensation value is set based on wrong mechanical coordinate when calculating the user coordinate, which brings errors to display coordinate.

Set the mechanical origin as follows:

Enter non linear compensation after booting. When inputting compensation part number and compensation length, make no change and press **[ENT]** key directly to skip. Then we come to select the compensation start point, select Mode: REF (ABS zero location) . slide the X axis grating ruler to find the zero location until DRO gives out a sound. System has entered the compensation interface automatically then press **[C]** key to exit non linear compensation.

Note:


The work origin could only be retrieved when the start point of non linear compensation is set at the ABS zero location. If set the leftmost as the ABS zero location, the work origin couldn't be retrieved. At this time we have to reset the non linear compensation. The following method is recommended for setting non linear compensation: set the compensation start point as ABS zero location. The user searches the mechanical origin after each booting to guarantee the consistency of the mechanical origins.


2. Basic functions


2.11 Calculator Function

You may encounter with the situation that some numerical value needs to be calculated in working. The DRO has the built-in calculator function which includes the simple arithmetical operations such as addition, subtraction, multiplication and division and the calculation such as trigonometric function, anti-trigonometric function and square root, etc.



Introduction about the function keys:




 Calculation function key: Press this key to enter the calculation function. While, you could exit the calculation function by pressing this key.




 Calculate the square root.


 Anti-trigonometric function calculation: Press this key and then press the trigonometric function key to restore the trigonometric function.

   Trigonometric function key.

 Delete the input and delete the last calculation result;  can be used to delete the current digit.

 ,  and  Data axis transferring: you may transfer the calculated value to X axis, Y axis and Z axis.

Note: Press  to enter the calculator. The position of function keys can be changed by pressing  .

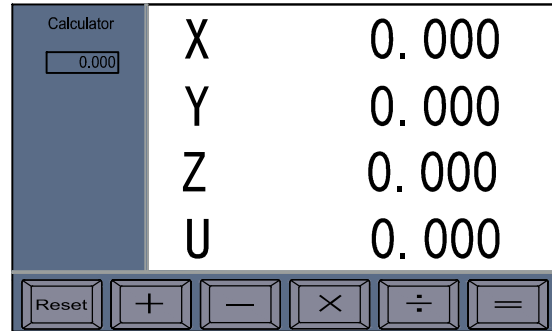

Calculator Function


2.12 Digital filtering function

Function introduction:


The vibration of the grinding machine in grinding process causes the display on the DRO changing repeatedly and fast, which leads to visual discomfort of operator. Special function of grinding machine in the DRO has digital filtering function known as "Debouncing function". During the vibration of the grinding machine, the function could prevent the DRO from changing fast to avoid visual confusion.


The operator could adopt digital filtering function according to the following procedures during grinding process.

Step 1: Press  to enter the digital filtering function.

If the DRO entered the digital filtering function, the  will appear on the left widget of the DRO.

2. Basic functions

Step 2: Press  again to exit the digital filtering function.

If the DRO exited from the digital filtering function, the  will disappear from the widget.

Note: The digital filtering function is only available under ABS, INC and SDM state. If other functions have been activated, then this function will be ineffective.

2.13 Feed rate

During the machining, the DRO enables the user to check any axes' feed rate (moving speed of the scale), the unit of the feed rate is mm/min

To check X axes feed rate, press  and then press .

To check Y axes feed rate, press  and then press .

To check Z axes feed rate, press  and then press .

To inactivate the feed rate, Press .

3. Special Function

PLD Function

3.1 PLD Function


3.1 PLD Function

(Applicable to the machine tools: milling machines and Electric Discharge Machines)


We have two ways to realize the PLD function.

Way 1: Length way (L-LEN, the distance from the starting hole center to the ending hole center)

Way 2: Step way (L-STEP, the distance between two adjacent holes)

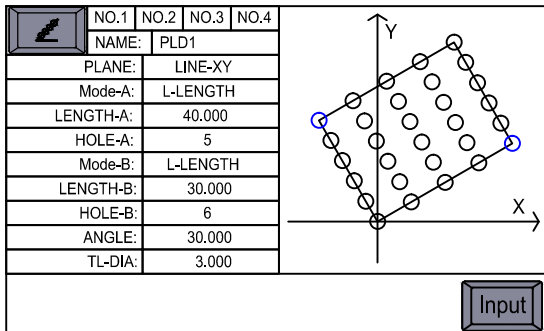

Array line holes machining

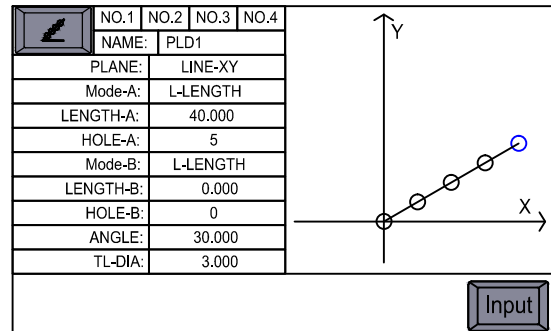

Oblique line holes machining

PLD input parameters:

L-LEN:NO.1-NO.4 In PLD function,we can set four groups of data.Every group has no interference with each other.

Name - - - No.1-No.4 the drawing name setting

PLANE -- Plane selection (XY YZ XZ)

Mode-A --- machining type L-STEP pitch-row length L-LENGTH oblique line overall length(The paramter of oblique line hole machining type)

LENGTH-A - length of oblique line.If choosing the L-STEP,this indicates the length between two holes.If choosing L-LENGTH,this indicates the overall length of the oblique line (The paramter of oblique line hole machining type)

HOLE-A-- number of holes(The paramter of oblique line hole machining type)

Mode-B --- machining type L-STEP pitch-row length L-LENGTH oblique line overall length(The paramter of array line hole machining type)

LENGTH-B - length of oblique line.If choosing the L-STEP,this indicates the length between two holes.If choosing L-LENGTH,this indicates the overall length of the oblique line (The paramter of array line hole machining type)

HOLE-B-- number of holes(The paramter of array line hole machining type)

ANGLE - oblique line angle (as shown in figure A)


TL-DIA - - - Diameter of tool (with purpose for reviewing of drawing.This parameter has no effect on real machining)

3.1 PLD Function

Example: as shown in the right figure

Figure A:


The angle refers to the position direction of the oblique line on the coordinate plane. The anti-clockwise direction is the positive direction, and the clockwise direction is the negative direction.

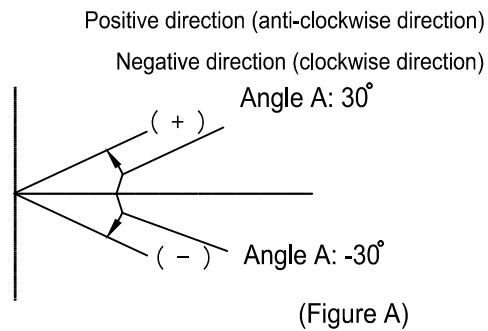

(Figure A)


Figure B:

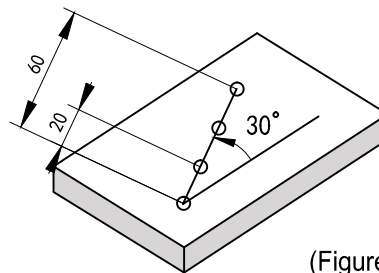


oblique line: 60mm
 oblique line angle: 30mm
 pitch-row: 20mm
 holes: 4













(Figure B)


Example 1: PLD machining



Step 1: Firstly, move the tool to the position of the starting hole. Press  to enter the PLD function.

Step 2: Choose the machining drawing No.1-No.4 By pressing   to choose, after choosing well, press  to enter the drawing name setting.

Step 3: Drawing name setting (NAME) Press  to set the drawing name, choose the letter by pressing    . Choose the digit by press the digit button, then press  to input. After setting well, press  to save.

Step 4: Select the machining plane (PLANE) Select the machining plane by pressing  . Press  to set the machining plane.


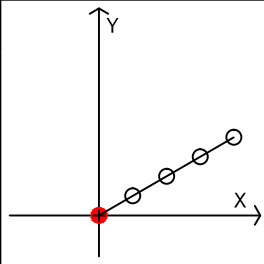
Step 5: The selection of PLD machining type (Mode-A): Press  to set the machining type, here we choose the length way.

Step 6: Input the length, set the length to be 40mm (LENGTH-A) Press  to enter the inputting mode. Press digits button to input. After inputting well, press  to save.

Step 7: Input the machining holes. Here we set the holes to be 5 (HOLE-A)

Step 8: Set the LENGTH-B and HOLE-B to be 0. Cause here we take the oblique line holes machining as the example, thus these two parameters for array line holes machining need to be set as 0.

Step 9: Input the angle. Here we set it as 30 degree (ANGLE)


	NAME: PLD1 HOLE: 1/1	
X	0.000	
Y	0.000	
Z	0.000	
U	0.000	

The state of oblique line hole machining



3.1 PLD Function

Step 10: Input the diameter of the tool. Here we set it to be 3mm(TL-DIA)


The parameter of tool's diameter has no effect on the real machining. It is only for the reviewing of the machining drawing.




Step 11: After setting well all those parameter. There will be a machining drawing displayed on the screen which is draw according to the parameter input. If it matches the real drawing, then press  to enter the machining state.








Step 12: Machining state




After entering the machining state, there will display the drawing name and current number of the machining hole. On the left, the screen will display the value of each axes. On the right, the screen will display the machining drawing, the red point indicates the current position of the tool. Press  to enter the machining of next hole. Move the axes until the corresponding value to be zero, this indicates the tool has reached the the position of the second hole. When moving the corresponding axes, the tool position (red point) will also change. After machining well, press  to return.


Example 1: The state of array line hole machining



Step 1: Firstly, move the tool to the position of the starting hole. Press  to enter the PLD function.

Step 2: Choose the machining drawing No.1-No.4 By pressing   to choose, after choosing well, press  to enter the drawing name setting.


Step 3: Drawing name setting (NAME) Press  to set the drawing name, choose the letter by pressing    . Choose the digit by press the digit button, then press  to input. After setting well, press  to save.



Step 4: Select the machining plane (PLANE) Select the machining plane by pressing  . Press  to set the machining plane.

Step 5: The selection of PLD machining type (Mode-A): Press  to set the machining type, here we choose the length way.

Step 6: Input the length, set the length to be 40mm (LENGTH-A) Press  to enter the inputting mode. Press digits button to input. After inputting well, press  to save.

Step 7: Input the machining holes. Here we set the holes to be 5 (HOLE-A)

Step 8: The selection of PLD machining type (Mode-B): Press  to set the machining type, here we choose the length way.


Step 9: Input the length, set the length to be 30mm (LENGTH-B) Press  to enter the inputting mode. Press digits button to input. After inputting well, press  to save.

Step 10: Input the machining holes. Here we set the holes to be 6 (HOLE-B)

Step 11: Input the angle. Here we set it as 30 degree (ANGLE)



Step 12: Input the diameter of the tool. Here we set it to be 3mm (TL-DIA)


The parameter of tool's diameter has no effect on the real machining. It is only for the reviewing of the machining drawing.

Step 13: After setting well all those parameter. There will be a machining drawing displayed on the screen which is draw according to the parameter input. If it matches the real drawing, then press  to enter the machining state.

3.1 PLD Function

Step 12: Machining state

After entering the machining state, there will display the drawing name and current number of the machining hole. On the left, the screen will display the value of each axes. On the right, the screen will display the machining drawing, the red point indicates the current position of the tool. Press  to enter the machining of next hole. Move the axes until the corresponding value to be zero, this indicates the tool has reached the position of the second hole. When moving the corresponding axes, the tool position (red point) will also change. After machining well, press  to return.

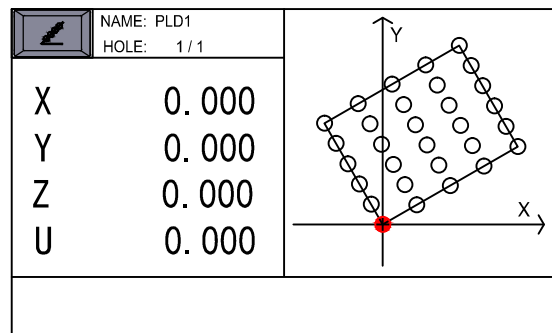

The state of array line hole machining


PCD Function

3.2 PCD Function

3.2: PCD Function

(Applicable to machine tools: milling machines and EDM)

This function is used for dividing the arc equally, such as the equally distributed holes on the drilling flange.

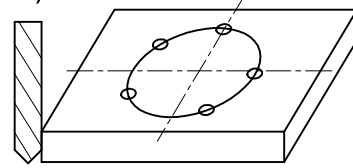

Function:

The DRO offers the tool positioning function of drilling equally divided holes on the circumference. Operators only need to input the relevant machining parameters according to the provided information, then the system will calculate the position coordinates of holes immediately and set the hole position to zero point (0.000, 0.000) temporarily. Operators only need to input the following six parameters.

L-LEN:NO.1-NO.4 In PCD function, we can set four groups of data. Every group has no interference with each other.

Name - - - - No.1-No.4 the drawing name setting

PLANE - - - Plane selection (XY YZ XZ)

CT-POS X - - Center of a circle X coordinates

CT-POS Y - - Center of a circle Y coordinates

Mode - - - - Machining model

DIA - - - - - arc diameter

ST-ANG - - - starting angle (angle of 1st hole position)

ED-ANG - - - ending angle (angle of the last hole position)

No HOLE - - - hole number

TL-DIA - - - - Diameter of tool (with purpose for reviewing of drawing. This parameter has no effect on real machining)

Mode specification: PCD is optional for 3 modes to be set.

Example: Here we drill holes on one workpiece with 3 modes. Select the machining plane as XY. Set the coordinate of center point to be X=0, Y=0, diameter of arc to be DIA=2mm, starting angle to be ST-ANG=30°, end angle to be ED-ANG=260°, number of holes to be HOLE=8.

	NO.1	NO.2	NO.3	NO.4
NAME:	PCD1			
PLANE:	LINE-XY			
CT-POS X:	0.000			
CT-POS Y:	0.000			
DIA:	2.000			
Mode :	360&ST_ANG			
ST-ANG:	30.000			
ED-ANG:	260.000			
HOLE:	8			
TL-DIA:	1.000			

Mode 1 Mode: 360&ST-ANG

Take the hole laid on the corresponding starting angle as the first hole, the DRO will automatically calculate the position of the 8 holes which are equally divided on the circumference.


Note: the end angle under this mode is meaningless.

Mode 1: Drawing reviewing.

3.2 PCD Function

Mode 2 Mode: ST-> EN-ANG


The DRO calculates the position of the 8 holes which are equally divided in the range which is from starting angle to the end angle.

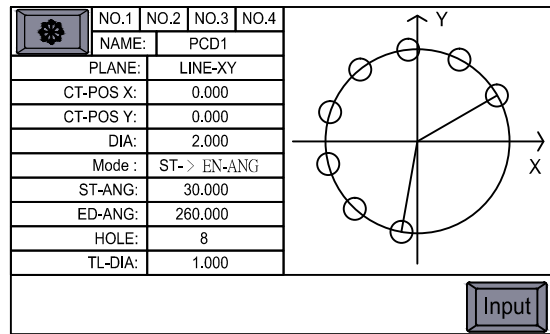

Mode 2:Drawing reviewing.

Mode 3 Mode: HOLE*(E-S)

Drill the holes with the same angle from each other.The angle between two holes is from the end angle (ED-ANG) to starting angle (ST-ANG).

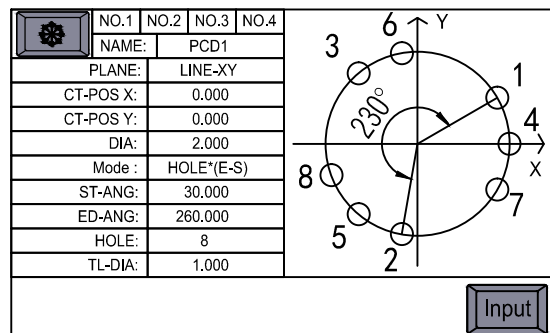

Mode 3:Drawing reviewing.

Step 1: Find the central position of the work piece, and Set the tool.Press the key to enter the PCD function.

Step 2:Choose the machining drawing No.1-No.4By pressing to choose, after choosing well,press to enter the drawing name setting.

Step 3:Drawing name setting (NAME)

Press to set the drawing name, choose the letter by pressing .

Choose the digit by press the digit button,then press to input.After setting well,press to save.


Step 4:Parameter setting

Select the parameter which need to be set by press .Press to set the corresponding parameter,and press to do the data inputting.

Step 5:Enter processing interface

After entering the machining state, there will display the drawing name and current number of the machining hole.On the left,the screen will display the value of each axes.On the right,the screen will display the machining drawing,the red point indicates the current position of the tool.Press

to enter the machining of next hole.Move the axes until the corresponding value to be zero,this indicates the tool has reached the the position of the second hole.When moving the corresponding axes,the tool position (red point) will also change.After machining well,press to return.

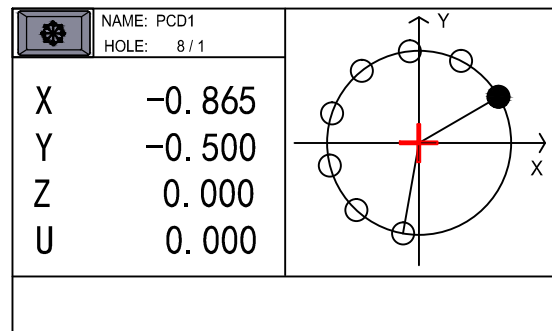

Machining state

Smooth R Function