

[SELECT]

- Enter sub modes
- >2 sec. = enter setup
- Setup: move

[MODE]

- TIME→ALTI→
BARO→COMP→
- Return to main mode
- Accept and exit setup
- >2 sec. = light



[QUICK]

- Quick view of logbook
- Setup: Decrease (-)

[ON OFF]


- In TIME mode Date→
Seconds→Dual Time→
- Setup: Increase (+)
- Start / Stop
- Compass ←→ Bearing tracking

OBSERVER POCKET GUIDE




SUUNTO

www.suunto.com

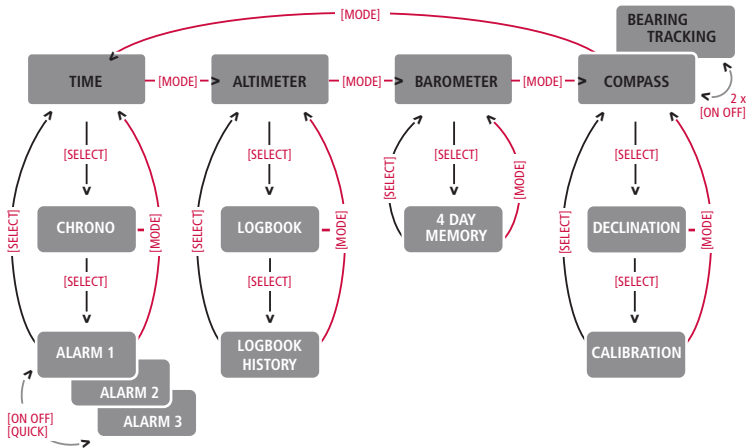

HOW TO DO

SET REFERENCE ALTITUDE

① Mode = ALTI ② [SELECT] > 2sek ③ [SELECT] ④ [QUICK] or [ON OFF] to change ⑤ [MODE] to return

CHANGE BETWEEN ALTIMETER / BAROMETER USE

① Mode = ALTI or BARO ② [SELECT] > 2sek ③ [QUICK] or [ON OFF] to change ④ [MODE] to return

CALIBRATE COMPASS ① Mode = COMP ② 2 x [SELECT] ③ [SELECT] > 2sek ④ [QUICK] ⑤ hold level, rotate 360° ⑥ repeat 4 and 5 if text PUSH – is displayed until text dOnE emerges ⑦ 2 x [MODE] to return