TT8870-352 Wireless Module User's Guide

Components

The TT8870-352 wireless module consists of the following components:

HHP Part Number	Part Name	Additional Part Information	Comments
80000382-US	PC Card 350	Cisco Aironet 350 Series, 2.4 Ghz	
500000882	Antenna, TT8870	Centurion Wireless Technologies, CAF 94627	Peak gain 1.5 dBi
500001823	TT8870-352 wireless module label		
500000XXX	TT8870-352 FCC label		

The TT8870-352 wireless module is primarily designed to use Cisco Aironet™ 350 Series with HHP Transaction Terminal product family, TT88XX.

FCC Information

Per FCC rules, it is not permissible to provide information to the end user on how to install and uninstall/remove the module.
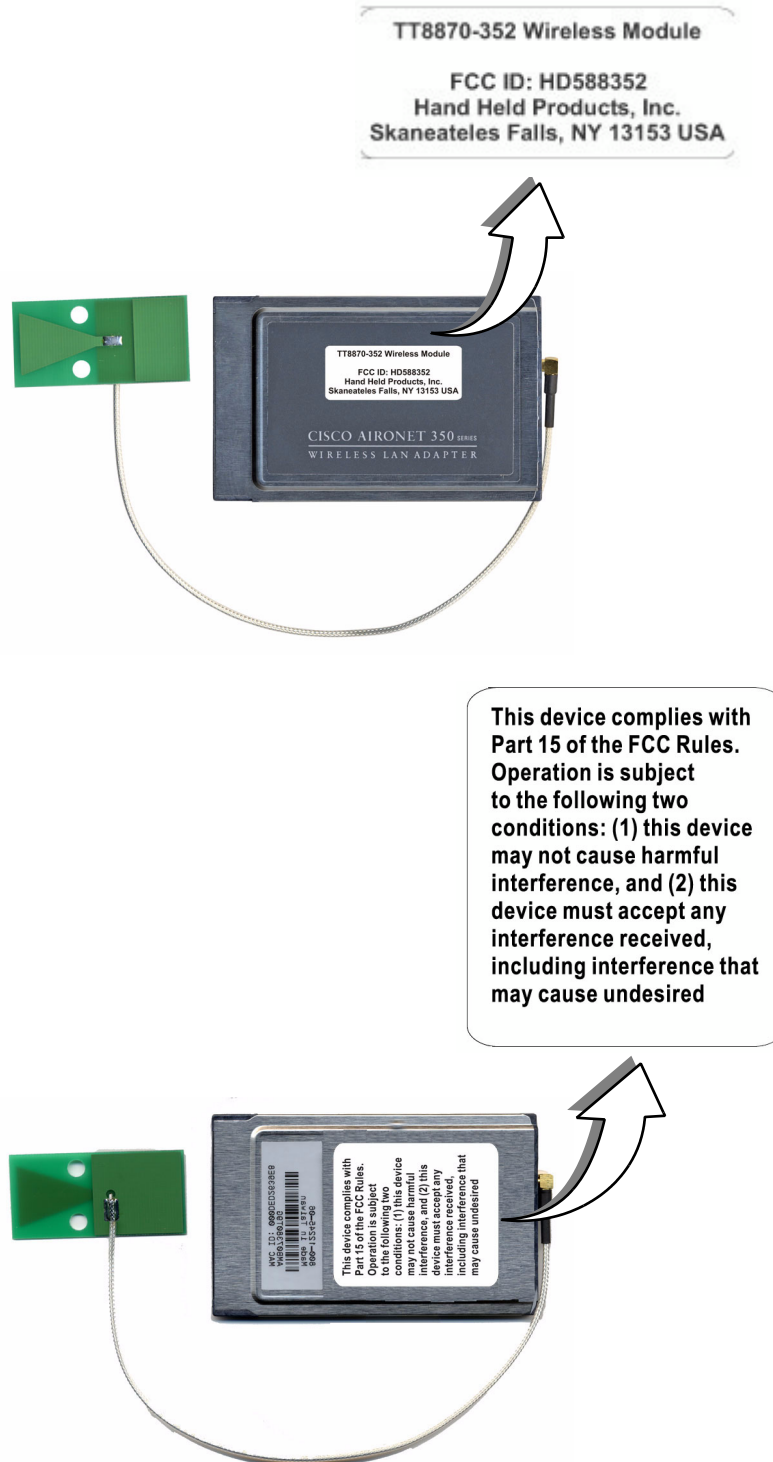
FCC Compliance Statement

This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions: 1) This device may not cause harmful interference, and 2) this device must accept any interference received, including interference that may cause undesired operation.

According to FCC 15.21, changes or modifications to the device not expressly approved by HHP (the party responsible for compliance) could void the user's authority to operate the equipment.

Caution: This device is classified as a mobile device according to FCC RF Exposure requirements. This device must be installed with no less than 20cm of separation between the device and operators.

FCC ID: HD588352

TT8870-352 Label Location

TT8870-352 Wireless Module

FCC ID: HD588352
Hand Held Products, Inc.
Skaneateles Falls, NY 13153 USA

TT8870-352 Wireless Module

FCC ID: HD588352
Hand Held Products, Inc.
Skaneateles Falls, NY 13153 USA

CISCO AIRONET 350 SERIES
WIRELESS LAN ADAPTER

This device complies with
Part 15 of the FCC Rules.
Operation is subject
to the following two
conditions: (1) this device
may not cause harmful
interference, and (2) this
device must accept any
interference received,
including interference that
may cause undesired

Wireless Module Operation

1. The wireless transmitter and antenna form the wireless module. These components of the module must remain the same.

2. Further instructions on the module are provided in the Cisco Aironet 350 Series User Guide.

Contact Information

If you need assistance installing or troubleshooting your wireless module, please call your Distributor or the nearest HHP technical support office listed below. You can also get help at our website at www.hhp.com.

North America/Canada:

HHP
700 Visions Drive
P.O. Box 208
Skaneateles Falls, NY 13153-0208

Telephone:	(315) 685-2476, Option 4 (8 a.m. to 6 p.m. EST)
or in the U.S.	(800) 782-4263
Fax number:	(315) 685-4960
E-mail:	*support@HHP.com*

Europe, Middle East, and Africa:

Telephone-European Ofc:	Int+31 (0) 40 29 01 600
U.K. Ofc:	Int+44 1925 240055
E-mail:	*euro_support@HHP.com*

Asia:

Telephone:	Int+852-2511-3050 *or* 2511-3132
E-mail:	*asia_support@HHP.com*

Latin America:

Telephone:	(239) 263-7600
E-mail:	*la_support@HHP.com*

Disclaimer

Hand Held Products, Inc. d/b/a HHP ("HHP") reserves the right to make changes in specifications and other information contained in this document without prior notice, and the reader should in all cases consult HHP to determine whether any such changes have been made. The information in this publication does not represent a commitment on the part of HHP.

HHP shall not be liable for technical or editorial errors or omissions contained herein; nor for incidental or consequential damages resulting from the furnishing, performance, or use of this material.

This document contains proprietary information which is protected by copyright. All rights are reserved. No part of this document may be photocopied, reproduced, or translated into another language without the prior written consent of HHP.

© 2001-2004 Hand Held Products, Inc. All rights reserved.

Web Address: www.HHP.com