

Choosing the Right EERAM VCAP Capacitor

Author: Robert Proctor
Microchip Technology Inc.

INTRODUCTION

This application note provides guidelines for both selecting and placing a VCAP capacitor (CVCAP) for the devices enumerated below (see [EERAM Part Numbers](#)).

EERAM Part Numbers

Device	
47C04	48L256
47L04	48L512
47C16	48L640
47L16	48LM01
47L64	

AUTOSTORE

This application note assumes the EERAM device will utilize the EERAM AutoStore function for automatic backup of the SRAM data to EEPROM on system power loss or system brown-out. The AutoStore function is optional on some devices. If used for any automatic EEPROM backups, then this application note applies.

To enable AutoStore on the 47X04 and 47X16 devices, set the ASE (AutoStore Enable) bit in the STATUS register to '1'. To enable AutoStore on the 48L640, 48L256, 48L512 and 48LM01 devices, set the ASDIS bit in the STATUS register to '0'. In the 47L64 device, AutoStore is always enabled.

Install a capacitor connected between the VCAP pin and ground, as seen in [Figure 1](#) (I²C) or [Figure 2](#) (SPI). The rest of this document discusses how to choose this capacitor. If the AutoStore is enabled and if the SRAM array has been modified, then the AutoStore function begins using the VCAP voltage as a temporary power source.

FIGURE 1: TYPICAL I²C APPLICATION



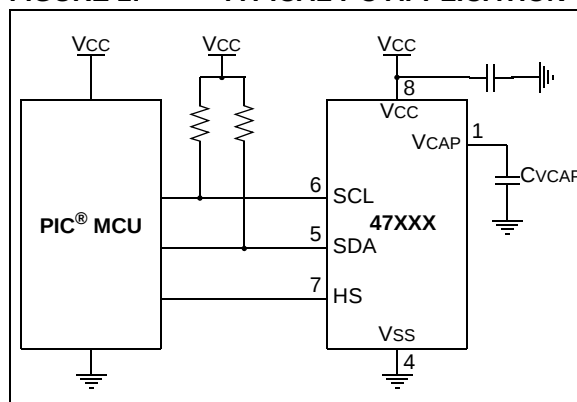


FIGURE 2: TYPICAL SPI APPLICATION

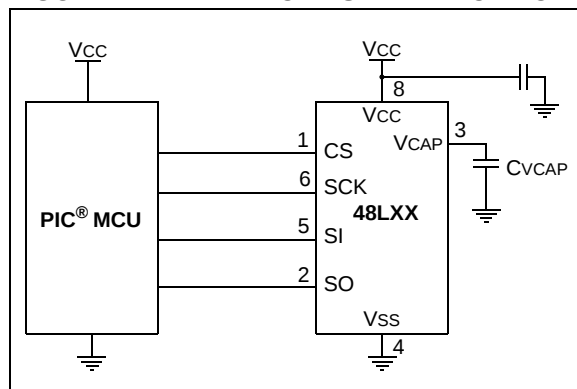

As seen in [Figure 3](#), after power is applied to the VCC pin, the voltage across the VCAP capacitor also rises. A switch inside the device connects the VCAP pin to the VCC pin on power-up. As the voltage at VCAP increases and passes the VTRIP level, the Recall function begins, powered by VCC, where the EEPROM data is copied into the SRAM array. The time for the recall is very brief, taking less than 10 ms. While the VCC voltage remains in the normal operating range, the internal switch stays on, keeping the VCAP voltage at VCC level.

FIGURE 3: AUTOSTORE VOLTAGES

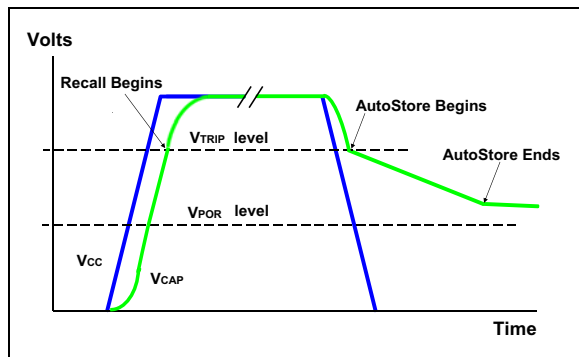

When power is removed and V_{CC} falls, V_{CAP} voltage will fall as well, but when the internal power rail falls below V_{TRIP} , the device automatically disconnects the switch between V_{CAP} and V_{CC} , and this allows the capacitor to provide the power, independent of V_{CC} , for the duration of the AutoStore.

V_{CAP} SELECTION

It is important to select a capacitor that will provide enough energy to finish the AutoStore operation without any loss of data. It also should not be too large as this may take longer to charge up when V_{CC} is applied and could increase cost. The capacitor needs to be rated for the voltage and temperature expected in the application, and it needs to be specified so that changes in capacity due to age, temperature or voltage do not prevent a successful AutoStore over the full lifetime of the application.

CAPACITY REQUIREMENTS

The data sheets show the required minimum capacitance values to be used for the various EERAM devices. The devices were characterized across the entire specified operating range using these minimum values to ensure they would work reliably. But, these values are for the actual capacitance available to the device, not the rated capacitance of any particular capacitor.

The rated value and the actual capacitance value of different types of capacitors can differ greatly.

TOLERANCE

Part-to-part variations can cause problems in any production line. For the AutoStore operation, choosing a capacitor that has too little capacitance because of component variation could mean loss of data. It is important that this be taken into account when choosing a capacitor to be sure the minimum capacitance is still available under all operating conditions.

CAPACITOR TYPES

Multilayer Ceramic Capacitors (MLCCs)

MLCCs have unique particularities that must be taken into account. Certain ceramic chemistries, which are associated with the temperature codes as Y5V or Z5U, can exhibit significant capacitance loss as a function of operating voltage, known as the "DC bias" effect.

For this reason, it is recommended to use ceramic capacitors that are rated at least twice the minimum recommended capacitance value, and with a voltage rating of at least 10V. These will help to ensure that the ceramic capacitor is able to supply the power needed during the AutoStore operation.

Tantalum Capacitors

These capacitors offer the benefit of capacitance density, stability with temperature and little problem of aging. The tantalum capacitor works well with the EERAM device over the 100,000 (minimum) SRAM to EERAM back-up cycles and is the recommended choice for the EERAM V_{CAP} . Since tantalum capacitor supply has been a concern in the past, we also recommend to reserve space in the footprint for an equivalent ceramic capacitor.

Aluminum Electrolytic Capacitors

While there are no aluminum capacitors listed in [Table 1](#), primarily because of their height, an aluminum capacitor can be used with EERAM. These capacitors are low-cost but often have broad tolerance ranges and loss of capacitance due to aging. If this type is chosen, be sure that the minimum capacitance at the worst-case of tolerance and temperature over time is still enough to meet the minimum capacitance requirements.

OTHER CAPACITOR SPECIFICATIONS

Voltage Rating

As long as the voltage rating of the capacitor is above the absolute maximum voltage rating of the EERAM, then the voltage itself should not be a limiting factor. However, as found in the [Multilayer Ceramic Capacitors \(MLCCs\)](#), it can be beneficial to select capacitors with more than two times the expected applied voltage. A minimum capacitor voltage rating of 10V is recommended.

PCB Placement

The placement of the VCAP capacitor relative to the EERAM device is not critical, but as a good practice it should be kept close. The internal circuit in the EERAM uses a comparator to determine when to connect and disconnect the internal switches; it is not particularly sensitive, but it is still possible that significant external inductance in series with the VCAP could allow unexpected behavior. A distance of an inch (25 mm) or less is recommended. A standard 0.1 μF bypass capacitor is still required at the VCC pin, as close as possible, for reliable logic operation.

Cost

When evaluating BOM costs, discrepancies between expectation and reality can occur. One might expect that for a given type, voltage and package, a larger value capacitor would be more expensive than a lower value one. This is not always the case, as rarer parts will be more expensive.

For example, between the values of 10 μF and 22 μF , it is possible to find 15 μF or 18 μF capacitors, but these values may cost more than either of the other two more popular sizes. Since the EERAM can well tolerate a little more capacitance, it might be a better choice to select the lower-priced capacitor in the larger size. The selections in [Table 1](#) were made on consideration of popularity (low cost) and dimensions.

CONCLUSION

When paired-up with appropriately sized capacitors, the EERAM device provides reliable and cost-effective data storage even when data is updated often and when power is lost suddenly and without warning. Choosing the right AutoStore capacitor means balancing physical characteristics to match the operating environment, while still providing enough energy storage to allow a complete and reliable store.

In this application note we have provided a list of acceptable capacitor sizes by EERAM device. The user can select one of the suggested capacitor types or choose a capacitor type that meets the minimum and maximum EERAM VCAP specifications over temperature and time.

TABLE 1: RECOMMENDED VCAP CAPACITORS VALUES

EERAM Device	Minimum Specified Capacitance	Recommended Nominal Capacitance (10 VDC minimum rated)	Recommended Tantalum Capacitor	Recommended Ceramic Capacitor
47C04	3.5 μF	4.7 μF	4.7 μF	10 μF
47C16	5 μF	6.8 μF	6.8 μF	22 μF
47L04	5 μF	6.8 μF	6.8 μF	22 μF
47L16	8 μF	10 μF	10 μF	33 μF
47L64	22 μF	33 μF	33 μF	47 μF
48L640	22 μF	33 μF	33 μF	47 μF
48L256	47 μF	68 μF	68 μF	100 μF
48L512	47 μF	68 μF	68 μF	100 μF
48LM01	47 μF	68 μF	68 μF	100 μF

APPENDIX A: REVISION HISTORY

Revision A (August 2016)

Initial release of this document.

Revision B (April 2018)

Updated overall content to make the application note more understandable.

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949 ==

Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, AVR, AVR logo, AVR Freaks, BeaconThings, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, Helder, JukeBlox, KEELOQ, KEELOQ logo, Kleer, LANCheck, LINK MD, maXStylus, maXTouch, MediaLB, megaAVR, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, Prochip Designer, QTouch, RightTouch, SAM-BA, SpyNIC, SST, SST Logo, SuperFlash, tinyAVR, UNI/O, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, EtherSynch, Hyper Speed Control, HyperLight Load, IntelliMOS, mTouch, Precision Edge, and Quiet-Wire are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, CodeGuard, CryptoAuthentication, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, JitterBlocker, KleerNet, KleerNet logo, Mindi, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PureSilicon, QMatrix, RightTouch logo, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2016-2018, Microchip Technology Incorporated, All Rights Reserved.

ISBN:

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-67-3636

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7289-7561

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820