




Wireless  
Security  
Solutions

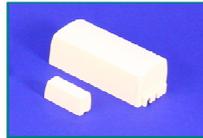

## RE101 GE-Compatible Standard Door / Window

### Features

- For sensing things that open or separate.
- Magnet and Internal reed switch operation.
- 2 supplemental hardwire zones.
  - GE-compatible version reports 2<sup>nd</sup> zone to 2<sup>nd</sup> ID.
- Cover tamper.
- Strong, reliable RF signal.
- 10-15 year battery life on CR123A battery.
- Low Battery indication.

### Key Instructions

- Battery “+” faces towards spring.
- No end-of-line resistors on hardwire zones.
- Panels assume hardwire zone alarm is state in which contact was enrolled.
- Center hardwire terminal is common.
- Reed switch and terminal closest to (outer) it are 1<sup>st</sup> ID
- Inner terminal is 2<sup>nd</sup> ID.
- Enrolling:
  - 1<sup>st</sup> ID: Reed switch and outer terminal zone are enrolled by tamper switch.
  - 2<sup>nd</sup> ID: Inner terminal zone is enrolled by holding down tamper while installing battery.

### Operation


- Magnetic and 1<sup>st</sup> (outer) hardwire zone (1<sup>st</sup> ID)
  - Alarm, when...
    - ... magnet is pulled away from reed switch.
    - ... contact changes to alarm.
  - Tamper, when cover is opened.
  - Supervisories, every hour.
- 2<sup>nd</sup> (inner) hardwire zone (2<sup>nd</sup> ID)
  - Alarm: when contact changes to alarm condition.
  - Tamper: none.
  - Supervisory: every hour.

### Specifications

Magnet trip distance: 1 inch nominal  
 Mounting hardware: # 4 or #6 screws  
 Replacement Battery: CR123A 1550mAH  
 Temperature Range: 0F to 120F  
 Housing dimensions: 3.3x1.4x1.1 inches

Specifications subject to change without notice.

### Internal Picture

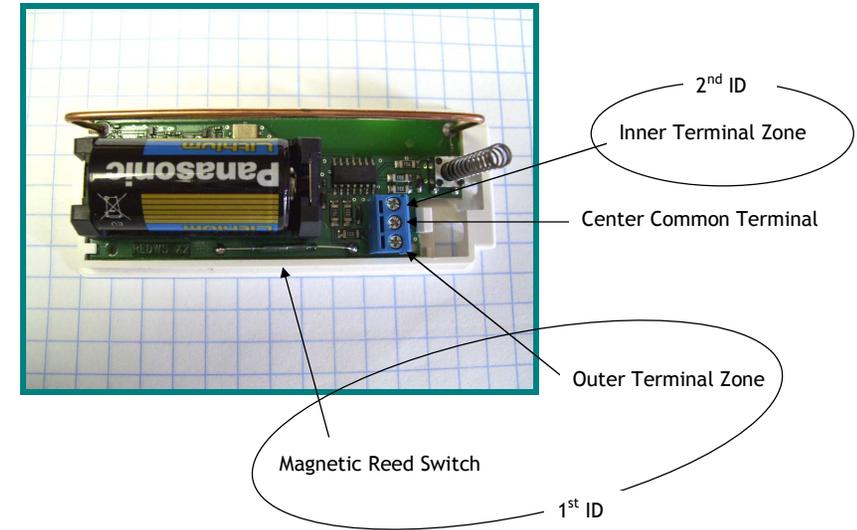

## Notices

“GE”, “Honeywell”, and “DSC” are trademarks owned by General Electric Company, Honeywell International Inc., and Tyco Safety Products Canada LTD, respectively.

Resolution Products, Inc. products will function with one of either GE, DSC or Honeywell systems. However, no Resolution product is produced by, endorsed by, nor is officially associated with GE, Honeywell or DSC. Resolution recommends verifying proper enrollment and operation, per control panel installation instructions, at installation.

### Warranty

Resolution Products, Inc. will replace products that are defective in their first year.

### FCC Notice

This device complies with Part 15 of the FCC rules. Operation is subject to the following two conditions:

This device may not cause harmful interference.

This device must accept any interference that may be received, including interference that may cause undesired operation.

Changes or modifications not expressly approved by the Resolution Products, Inc. could void the user's authority to operate this equipment.

FCC ID: U5X-RE101X

### IC Notice

This device complies with Industry Canada license-exempt RSS standard(s). Operation is subject to the following two conditions:

1. This device may not cause interference, and
2. This device must accept any interference, including interference that may cause undesired operation of the device.

Cet appareil est conforme avec d'Industrie Canada RSS standard exempts de licence. Son fonctionnement est soumis aux deux conditions suivantes:

1. Ce dispositif ne peut causer des interférences, et
2. Ce dispositif doit accepter toute interférence, y compris les interférences qui peuvent causer un mauvais fonctionnement du dispositif.

IC: 8310A-RE101X