

# Pulse Oximeter

## AP-10

# User Manual



Shenzhen Creative Industry Co., Ltd

## **Instructions to User**

Dear Customer,

Thank you for purchasing this quality product. Please read the manual very carefully before using this device. Failure to follow these instructions can cause measuring abnormality or damage to the Pulse Oximeter.

No part of this manual may be photocopied, reproduced or translated into another language without the prior written consent. We reserve the right to revise and amend it at any time without prior notice.

Version of the Manual: Ver 1.2

Issued Date: June 18<sup>th</sup>, 2019


All rights reserved.



3502-1290162

## Notes:



- The contents contained in this manual are subject to change without prior notice.
- Information furnished by **Creative** is believed to be accurate and reliable. However, no responsibility is assumed by **Creative** for its use, or any infringements of patents or other rights of third parties that may result from its use.

## Instructions for Safe Operation


-  Check the device to make sure that there is no visible damage that may affect user's safety and measurement performance. It is recommended that the device should be inspected minimally before each use. If there is obvious damage, stop using the device.

-  Necessary service must be performed only by qualified technicians. Users are not permitted to service this device.
-  The Pulse Oximeter must not be used with the devices and accessories not specified in User Manual.

## Cautions

-  Explosive hazard—DO NOT use the Pulse Oximeter in environment with inflammable gas such as some ignitable anesthetic agents.
-  **DO NOT** use the Pulse Oximeter while the Patient is under MRI or CT scanning. This device is NOT MRI Compatible.

## Warnings

-  Discomfort or pain may occur if using the sensor of this device

continuously on the same location for a long time, especially for the patients with poor microcirculation.

- Misapplication of a SpO<sub>2</sub> probe with excessive pressure for prolonged periods can induce pressure injury.
- Place the SpO<sub>2</sub> probe on the finger tightly will cause venous pulse and effect blood circulation, and lead to interstitial edema, hypoxia and inaccurate measurement.
- Biocompatibility tests have been performed on all the applied parts, some exceptional allergic patients may still have anaphylaxis. Do not apply to those who have anaphylaxis.
- For the individual patients, there should be a more prudent inspecting in the placing process. The sensor cannot be placed on the edema and tender tissue.

- 💣 The local law should be followed when disposing of the expired device or its accessories.
- 💣 DO NOT operate in the environment where strong electro-magnetic interference exists, such as radiogram, television, radiophone, etc.
- 💣 Please pay attention to the SpO<sub>2</sub> probe cable while using to avoid strangulating patient.
- 💣 The functional tester cannot be used to assess the accuracy of the device.
- 💣 Any Changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions: (1)  
This device may not cause harmful

interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

### FCC RF Radiation Exposure Statement:

1. This Transmitter must not be co-located or operating in conjunction with any other antenna or transmitter.
2. This equipment complies with RF radiation exposure limits set forth for an uncontrolled environment.

### Attentions



Keep the Oximeter away from dust, vibration, corrosive substances, explosive materials, high temperature and moisture.



If the Oximeter gets wet, please stop operating it and do not resume

operation until it is dry and checked for correct operation. When it is carried from a cold environment to a warm and humid environment, please do not use it immediately. Allow at least 15 minutes for the Oximeter to reach ambient temperature.



**DO NOT** operate the button on the front panel with sharp materials or sharp point.



**DO NOT** use high temperature or high pressure steam disinfection on the Oximeter and probes. Refer to related chapter for instructions regarding cleaning and disinfection.



The intended use of this device is not for therapy purpose.



The equipment is IP22 with protection against harmful solid foreign objects and ingress of liquid. So that means the equipment is



protected against solid foreign objects of 12.5mm and greater, and protected against vertically falling water drops when enclosure tilted up to 15°.



Please pay attention to the effects of lint, dust, light (including sunlight), etc.

## **Declaration of Conformity**

The manufacturer hereby declares that this device complies with the following standards:

IEC 60601-1:2005+A1: 2012,  
IEC60601-1-2:2014, IEC60601-1-11:2010,  
ISO 80601-2-61:2011 and follows the provisions of the council directive MDD93/42/EEC.

## Table of Contents

<b>1 Overview .....</b>	<b>1</b>
1.1 Appearance .....	1
1.2 Product Name and Model .....	3
1.3 Structure .....	3
1.4 Features .....	3
1.5 Intended Use .....	4
1.6 Working Environment .....	4
<b>2 Preparation .....</b>	<b>5</b>
2.1 Power Supply .....	5
2.2 Connection .....	5
<b>3 Make measurement .....</b>	<b>7</b>
3.1 Starting Measurement .....	7
3.2 SpO <sub>2</sub> Measurement .....	7
3.3 Setting Menu .....	13
3.4 Body Movement Detection .....	16
3.5 Additional Information .....	17

<b>4 Technical Specification.....</b>	<b>19</b>
<b>5 Classification .....</b>	<b>22</b>
<b>6 Packing List .....</b>	<b>22</b>
<b>7 Repair and Maintenance.....</b>	<b>23</b>
7.1 Maintenance .....	23
7.2 Cleaning and Disinfection.....	24
7.3 Storage and Transportation.....	25
<b>8 Troubleshooting .....</b>	<b>26</b>
<b>Appendix .....</b>	<b>27</b>
A Common Knowledge for SpO <sub>2</sub> Measurement	27
B Wristband Installation and Disassembly.....	32
C Key of Symbol.....	35

# 1 Overview

## 1.1 Appearance

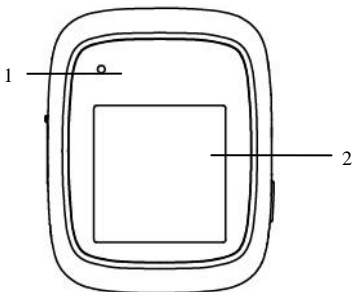


Figure 1A Front view

1. Working status indicator.
2. LCD display screen: Display measurement result, waveform.

Note: Two kinds of appearance for optional, please refer to the device you've purchased.

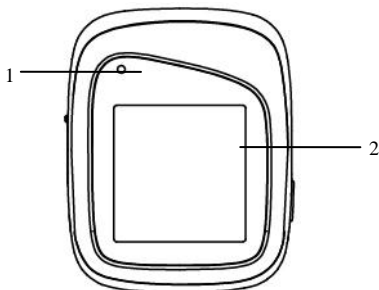


Figure 1B Front view




Figure 2 Right side view





Figure 3 Left side view

3. Power on/off key: Power on/off the device by

long pressing.

4. SpO<sub>2</sub> probe connector.

5.  Data interface: For charging and data uploading.

## 1.2 Product Name and Model

Name: Pulse Oximeter

Model: AP-10

## 1.3 Structure

It consists of main unit, SpO<sub>2</sub> probe, data interface as well as the bluetooth module (optional).

## 1.4 Features

- ✧ It's a smart wearable Pulse Oximeter, lightweight, small in size and easy to wear;
- ✧ 1.44 inch color LCD to display parameters and plethysmogram;
- ✧ Body activity recording and analysis function is available;
- ✧ Setting menu is available;

- ✧ Over-limit alert by vibration of the device. The over limits can be adjusted via the provided PC software .
- ✧ Convenient to measure and record SpO<sub>2</sub>, pulse rate in long-term while sleeping;
- ✧ Up to 72 hours data storage (500 pieces of record at most).
- ✧ Data can be uploaded to PC for review and analysis.

### 1.5 Intended Use

This Pulse Oximeter is intended for measuring and recording the functional oxygen saturation (SpO<sub>2</sub>) and pulse rate (PR). It's applicable for long-term tracking of SpO<sub>2</sub>, PR of adult or pediatric while sleeping in hospital, clinics or home. This device is not intended for continuous monitoring.

### 1.6 Working Environment

Operating temperature: 0~40℃

Operating humidity:

10%~90% (non-condensing)

Atmospheric pressure: 70kPa~106kPa

## 2 Preparation

### 2.1 Power Supply

- Internal power supply: built-in lithium battery 3.7V/500mAh.
- External power supply for charging via USB cable: the power source from USB cable should produce the capacity of 5V DC/1.2A.

### 2.2 Connection

The illustration of connection among SpO<sub>2</sub> probe and Pulse Oximeter is shown in figure 2.1.



Pulse Oximeter

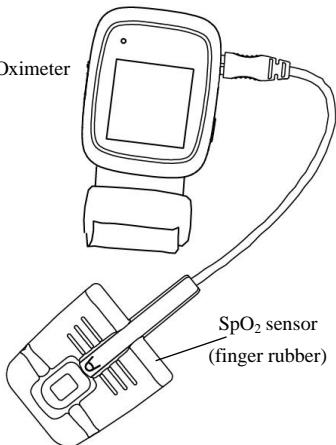


Figure 2.1 Device and accessories connection


----- Finger rubber SpO<sub>2</sub> sensor

## 3 Make measurement

### 3.1 Starting Measurement

- 1) Connect the required cables and probe.
- 2) Check that the cables and probe are correctly connected.
- 3) Long press power on/off key to turn on the device.

### 3.2 SpO<sub>2</sub> Measurement

1. Long press power on/off key to turn on the device.
2. Connect the SpO<sub>2</sub> probe to the connector “” on the side of the device, the red blinking light from the probe indicates a successful connection. (Note: When disconnecting the connector, be sure to hold the head of the connector firmly and pull).

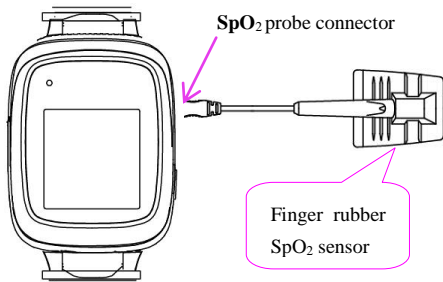


Figure 3.1 SpO<sub>2</sub> probe connection

3. Wear the Oximeter on your left hand.
4. For Finger rubber SpO<sub>2</sub> sensor: Insert the finger (index finger is preferred, the nail should be not too long) into the probe until the fingernail tip rests against the stop at the end of the probe (figure3.2). Adjust the finger to be placed evenly on the middle base of the sensor (make sure the finger is in the right position).

Note: If the index finger cannot be positioned correctly, or is not available, other finger can be

used.



Figure 3.2 Placement illustration

--- For Finger rubber SpO<sub>2</sub> sensor

The right placement of probe is as shown in figure3.3A.



Figure 3.3A

The wrong placement of probe is as shown in figure3.3B/3.3C.



Figure 3.3B Figure out

Figure 3.3C Not deep enough

5. The Oximeter will automatically start measurement in 2 seconds, and then recording the measured data automatically. The display screen is as shown in figure 3.4. User can read the values and view the waveform form the display screen.

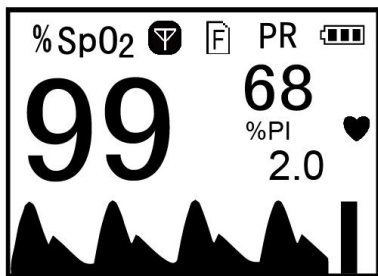


Figure 3.4 SpO<sub>2</sub> measuring screen display


### Screen description:

- ✧ “%SpO<sub>2</sub>”: SpO<sub>2</sub> label; “99”: current SpO<sub>2</sub> value.
- ✧ “PR”: Pulse rate label; “68”: current PR

value.


✧ “%PI”: Perfusion index label; “2.0”: current PI value.


✧ “❤️”: Pulse beat icon.


✧ “”: Pulse strength bar-graph.


✧ The displayed waveform is plethysmogram.

✧ “”: Battery voltage icon.

✧ “”: Wireless icon. If the wireless (bluetooth communication) link is setup successfully, the icon will be displayed on the screen; if the icon is flashing, it means a failure connection. If there is no wireless icon, it means the device is not configured with the wireless function.

✧ “”: Full memory icon. During measurement, if the memory is full, then

icon “” will appear on the screen for prompt; if the memory is fail to store (eg. the Oximeter is unexpected power off), then

icon “” will be displayed on screen. If the memory is full, it's recommended that the

user export the stored data from the device then delete the data, and the device can continue storing data.

### **Key Operation:**


Long press: press and hold the key for over 1 second.

Short press: press the key for less than 1 second


### **Description for Power indicator:**

- 1) The power indicator is always on during charging.
- 2) When the screen display is on, the indicator is off.
- 3) During measuring, short press the power on/off key, then the device enter into power saving mode (backlight is off), and the power indicator keeps on. Short press the power on/off key again, the power indicator off and device screen display is on.

### **Activate the device during standby status:**


- 1). Short press power on/off key “”.
- 2). Insert the air-flow module into the Oximeter.

### 3.3 Setting Menu

Double short time press the power on/off key “” to enter into Menu Setting Screen, as shown in figure 3.5.





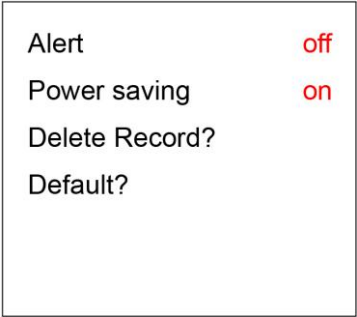

Alert off

Power saving on







Delete Record?

Default?




Figure 3.5

- ✧ Date: set current date;
- ✧ Time: set current time;
- ✧ SpO2 alm Lo: set SpO2 low limit; Setting range: 85%~100%, default setting: 85%;
- ✧ PR alm Lo: set pulse rate low limit; Setting range: 25bpm~99bpm, default setting: 50bpm;
- ✧ PR alm Hi: set pulse rate high limit; Setting range: 100bpm~250bpm, default setting:

120bpm;

- ✧ Alert: enable/disable the function of over-limit indication by vibration of the Oximeter, factory default is “off”.
- ✧ Power saving: turn on/off the power saving mode, factory default is “on”.
- ✧ Delete record: select “Delete record” and long press “” key to enter into Deletion Confirmation screen. Then, select “Yes” with “” key (short time press), and long pressing “” key to carry out the deleting action.
- ✧ Default: select “Default” and long press “” key to enter into Default Setting screen. Then select “Yes” with “” key (short time press), and long pressing “” key to carry out the action of resuming all items to factory setting.

### **Menu setting operation:**

Short time press “” to move the cursor to the item you need to set, and longtime press “” to activate the setting item, then short time press it to modify the setting parameter; Next, longtime press “” to confirm the modification and exit from this setting item. At last, move the setting item to “Exit setting” to exit from the setup menu.

### **3.4 Body Movement Detection**

Wearing the Oximeter and making measurement, if you rotate your wrist, then the screen enter into the time indicating screen, as shown in figure 3.6.

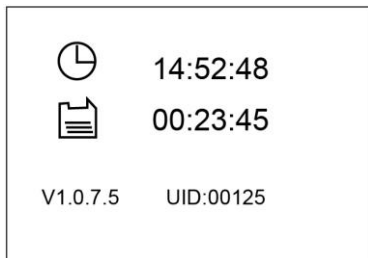




Figure 3.6

- ✧ “14:52:48”: the current time.
- ✧ “00:23:45”: the measuring duration up to now.
- ✧ “V1.0.7.5”: the software version.
- ✧ “UID 00125”: unique ID for the device.

### 3.5 Additional Information

- During measurement, if the memory is full, then icon “” appears on the screen, and the device will not store the following measured data again.

- If “” appears on the screen, it indicates that battery power is not enough, please charge for the battery. If you keep on using it, after a while the Oximeter will be off.
- Do not make measurement when the Oximeter is charging.
- Avoid shaking finger as possible as you can during measurement.
- Do not wrap wet finger or put wet finger directly into sensor.
- Do not let anything block the emitting light from device.
- Using enamel or other makeup on the nail may affect the measuring accuracy.
- If the first readings appear with poor plethysmogram (irregular or not smooth), then the readings are unlikely true, the more stable values are expected by waiting for a while.
- The measurement records will not be lost, and the settings will not be changed if the power supply of the Oximeter is interrupted. After

connecting the power again and turn on the Oximeter, it will resume to normal working and the setting for the Oximeter remains unchanged.

## 4 Technical Specification

A. Display Mode: 1.44 inch color LED display

B. SpO<sub>2</sub> measurement

Transducer: dual-wavelength LED

LED wavelength:

Red light: 660nm, Infrared light: 905nm

Maximal optical output power: less than 2mW maximum average

Measuring range: 0~100%

Display range: 0~100%

Measuring accuracy: *Arms* value (defined in ISO 80601-2-61) is not greater than 3% for SpO<sub>2</sub> range from 70% to 100%.

Data update: <10s

C. Pulse Rate measurement

Measuring range: 30bpm~250bpm

Measuring accuracy:  $\pm 2\text{bpm}$  or  $\pm 2\%$   
(whichever is greater)

Resolution: 1bpm

### D. Perfusion Index Display

Range: 0.2%~20%

### E. Preset alert limits

SpO<sub>2</sub> Low alert limit: 85%

PR high alert limit: 120bpm

PR low alert limit: 50bpm

### F. Power Supply:

Built-in lithium battery: 3.70V/500mAh

Operating current:  $\leq 90\text{mA}$

Continues working time (display is off and  
measuring SpO<sub>2</sub> Only): about 13 hours

### G. Operating environment

Operating temperature: 5~40°C

Operating humidity:

15%~93% (non-condensing)

Atmospheric pressure: 70kPa~106kPa

### H. Performance under low perfusion condition

The accuracy of SpO<sub>2</sub> and PR measurement still meets the specification described above when the modulation amplitude is as low as 0.6%.

### I. Resistance to ambient light interference:

The accuracy of SpO<sub>2</sub> and PR measurement still meets the specification described above when the device is tested by SpO<sub>2</sub> simulator (Fluke Biomedical Index 2 series) while setting the emulating interference of sun light and 50Hz/60Hz fluorescent light.

J. Over-limit alert by visible display: If the measured SpO<sub>2</sub>, PR exceeds the preset alert limit value, then visible alert should be available.

K. Dimensions: D 56mm× W 44mm×H 16mm

Net Weight: about 45g

### L. Bluetooth function

Frequency band: 2.4GHz

Working profile: BLE V4.0



## 5 Classification

The type of protection against electric shock:  
Internally powered equipment.

The degree of protection against electric shock: Type BF applied part.

The degree of protection against harmful ingress of liquids: IP22.

Electro-Magnetic Compatibility:

Group I, Class B

## 6 Packing List

1. SpO<sub>2</sub> probe.....One
2. Wristband .....One
3. AC power adapter.....One (Optional)
4. Data cable... .....One (Optional)

**Note: the accessories are subject to change, please refer to the items in your package.**


## 7 Repair and Maintenance


### 7.1 Maintenance

The service life (not a warranty) of this device is 5 years. In order to ensure its long service life, please pay attention to the maintenance.

- Please charge the device when low battery voltage indicator lightens.
- Please clean the surface of the device before using. Use cloth with alcohol to wipe the device first, and then let it dry in air or wipe it dry.
- The recommended storage environment of the device:  
ambient temperature:  $-20^{\circ}\text{C} \sim 60^{\circ}\text{C}$ , relative humidity 10%~95%, atmospheric pressure: 50kPa~107.4kPa.
- The oximeter is calibrated in the factory before sale, there is no need to calibrate it during its life cycle. However, if it is necessary to verify its precision routinely, the user can

do the verification by means of SpO<sub>2</sub> simulator, or it can be done by the local third party test house.

 **High-pressure /high temperature sterilization cannot be used on the device.**

 **Do not immerse the device in liquid.**

## **7.2 Cleaning and Disinfection**

- Surface-clean sensor with a soft gauze by wetting with a solution such as 75% isopropyl alcohol, if low-level disinfection is required, use a 1:10 bleach solution. Then surface-clean with a damp cloth and dry with a piece of cloth.
- Clean the wristband with soapy water. Please detach the wristband from the oximeter firstly.(Refer to Appendix for detailed disassembly method)

**Caution:** Do not sterilize by irradiation steam, or ethylene oxide.

Do not use the sensor if it is damaged.

## 7.3 Storage and Transportation

If the device will not be used for long period of time, wipe it clean and keep it in the packaging, which shall be kept in a dry and good ventilation place free from dust and corrosive gases.

### **Storage environment:**

Ambient temperature:  $-20\sim 60^{\circ}\text{C}$

Relative humidity: 10%~95% (non-condensing)

Atmospheric pressure: 50kPa~107.4kPa

### **Transportation:**

The device should be transported by land (vehicle or railway) or air in accordance with the contractual terms.

Do not hit or drop it with force.

## 8 Troubleshooting

Trouble	Possible Reason	Solution
<b>The SpO<sub>2</sub> and Pulse Rate display instable</b>	<ol style="list-style-type: none"><li>1. The finger is not placed far enough inside.</li><li>2. The finger is not wrapped correctly</li></ol>	<ol style="list-style-type: none"><li>1. Place the finger correctly inside and try again.</li><li>2. Wrap the finger properly and make the emitter focus on receiver</li></ol>
<b>Can not turn on the device</b>	<ol style="list-style-type: none"><li>1. Low battery voltage</li><li>2. The device is malfunctioning.</li></ol>	<ol style="list-style-type: none"><li>1. Please charging.</li><li>2. Please contact the local service center.</li></ol>
<b>Fragmental SpO<sub>2</sub> waveform</b>	<ol style="list-style-type: none"><li>1. Your finger is out of proper location in the probe.</li><li>2. Blood flow in the finger blocked.</li><li>3. Extreme movement</li></ol>	<ol style="list-style-type: none"><li>1. Adjust your finger location properly.</li><li>2. Make sure there is no object may occlude the blood flow.</li><li>3. Extreme movement may cause invalid measuring result.</li></ol>

## **Appendix**

### **A Common Knowledge for SpO<sub>2</sub> Measurement**

#### **1 Meaning of SpO<sub>2</sub>**

SpO<sub>2</sub> is the saturation percentage of oxygen in the blood, so called O<sub>2</sub> concentration in the blood; it is defined by the percentage of oxyhemoglobin (HbO<sub>2</sub>) in the total hemoglobin of the arterial blood. SpO<sub>2</sub> is an important physiological parameter to reflect the respiration function; it is calculated by the following method:

$$\text{SpO}_2 = \text{HbO}_2 / (\text{HbO}_2 + \text{Hb}) \times 100\%$$

HbO<sub>2</sub> are the oxyhemoglobins (oxygenized hemoglobin), Hb are those hemoglobins which release oxygen.

#### **2 Principle of Measurement**

Based on Lamber-Beer law, the light absorbance of a given substance is directly proportional with its density or concentration. When the light with

certain wavelength emits on human tissue, the measured intensity of light after absorption, reflecting and attenuation in tissue can reflect the structure character of the tissue by which the light passes. Due to that oxygenated hemoglobin ( $\text{HbO}_2$ ) and deoxygenated hemoglobin ( $\text{Hb}$ ) have different absorption character in the spectrum range from red to infrared light (600nm~1000nm wavelength), by using these characteristics,  $\text{SpO}_2$  can be determined.  $\text{SpO}_2$  measured by this oximeter is the functional oxygen saturation -- a percentage of the hemoglobin that can transport oxygen. In contrast, hemoximeters report fractional oxygen saturation – a percentage of all measured hemoglobin, including dysfunctional hemoglobin, such as carboxyhemoglobin or metahemoglobin.

**Clinical application of pulse oximeters:**  $\text{SpO}_2$  is an important physiological parameter to reflect the respiration and ventilation function, so  $\text{SpO}_2$  measurement used in clinical becomes more popularly, such as monitoring the patient with

serious respiratory disease, the patient under anesthesia during operation, premature and neonate. The status of  $\text{SpO}_2$  can be determined in time by measurement and find the hypoxemia patient earlier, thereby preventing or reducing accidental death caused by hypoxia effectively.

### **3 Factors affecting $\text{SpO}_2$ measuring accuracy (interference reason)**

- ✧ Intravascular dyes such as indocyanine green or methylene blue.
- ✧ Exposure to excessive illumination, such as surgical lamps, bilirubin lamps, fluorescent lights, infrared heating lamps, or direct sunlight.
- ✧ Vascular dyes or external used color-up product such as nail enamel or color skin care
- ✧ Excessive patient movement
- ✧ Placement of a sensor on an extremity with a blood pressure cuff, arterial catheter, or



intravascular line

- ✧ Exposure to the chamber with High pressure oxygen
- ✧ There is an arterial occlusion proximal to the sensor
- ✧ Blood vessel contraction caused by peripheral vessel hyperkinesias or body temperature decreasing

#### **4 Factors causing low SpO<sub>2</sub> Measuring value (pathology reason)**

- ✧ Hypoxemia disease, functional lack of HbO<sub>2</sub>
- ✧ Pigmentation or abnormal oxyhemoglobin level
- ✧ Abnormal oxyhemoglobin variation
- ✧ Methemoglobin disease
- ✧ Sulfhemoglobinemia or arterial occlusion exists near sensor
- ✧ Obvious venous pulsations
- ✧ Peripheral arterial pulsation becomes weak
- ✧ Peripheral blood supply is not enough

## B Wristband Installation and Disassembly

### Introduction:




Fig. A

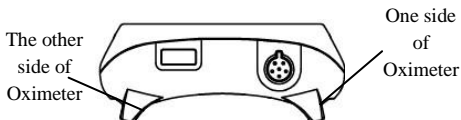


Fig. B Pulse Oximeter

### Installation Procedure:

**Step 1:** Insert the wristband to the Oximeter from one side to the other side, as shown in Fig.C.



Fig. C

**Step 2:** Put the Oximeter on the wrist, and stick the

Velcro ① to the inner side of wristband, press the wristband to make the Velcro ① stick to the inner side of wristband firmly, as shown in Fig.D.



Fig. D

**Step 3:** Bring the wristband out from the buckle, and fold back the wristband, as shown in Fig.E. Then press the Velcro② to make it stick to the outer side of wristband firmly, as shown in Fig.F.



Fig. E



Fig.F







**Disassembly:** The process of wristband disassembly is similar to the installation method, but with reverse procedure.









**Note:** Please detach the wristband from the Oximeter before cleaning the wristband.

---

## C Key of Symbol

Symbol		Description
Symbols on the enclosure		With Type BF applied part
		See User Manual
		Data interface
	SN	Serial number
		No alarm
		Do not litter at will
		Life span
Symbols on the screen	%SpO <sub>2</sub>	The oxygen saturation
	%PI	Perfusion Index
	PR	Pulse rate
	RR	Respiration rate

## User Manual for Pulse Oximeter

		Pulse beat
		Wireless
		Pulse strength bar-graph
		Low battery voltage
		Memory full
		Memory error

Note: the above symbol may appear on your device.

## Quality Certificate

Name: Pulse Oximeter

Model: AP-10

Date: \_\_\_\_\_

QA: \_\_\_\_\_

This product has been inspected in accordance with the standards specified in the User Manual.

Shenzhen Creative Industry Co., Ltd





CE 0123

**Floor 5, BLD 9, Baiwangxin High-Tech  
Industrial Park, Songbai Road, Xili Street,  
Nanshan District, 518110 Shenzhen,  
PEOPLE'S REPUBLIC OF CHINA**

**Tel: +86-755-2643 3514**

**Fax: +86-755-2643 0930**

**E-mail: [info@creative-sz.com](mailto:info@creative-sz.com)**

**Website: [www.creative-sz.com](http://www.creative-sz.com)**



**EC-Representative:**

**Shanghai International Holding Corp.  
GmbH (Europe)**

**Eiffestrasse 80, 20537 Hamburg Germany**